



# APEX WAVES PXIe-4302 32-Channel 24-Bit 5 kS/s-ch PXI Analog Input Module User Manual

[Home](#) » [APEX WAVES](#) » APEX WAVES PXIe-4302 32-Channel 24-Bit 5 kS/s-ch PXI Analog Input Module User Manual 



## CALIBRATION PROCEDURE PXIe-4302/4303 and TB-4302C 32 Ch, 24-bit, 5 kS/s or 51.2 kS/s Simultaneous Filtered Data Acquisition Module [ni.com/manuals](https://ni.com/manuals)

This document contains the verification and adjustment procedure for the National Instruments PXIe-4302/4303 module and the verification procedure for the National Instruments TB-4302C terminal block.

### Contents

- [1 Software](#)
- [2 Documentation](#)
- [3 PXIe-4302/4303 Verification and Adjustment](#)
- [4 Accuracy Verification](#)
- [5 Specifications](#)
- [6 World Wide Support and Services](#)
- [7 Documents / Resources](#)
  - [7.1 References](#)

## Software


 
 





Calibrating the PXIe-4302/4303 requires the installation of NI-DAQmx on the calibration system. Driver support for calibrating the PXIe-4302/4303 was first available in NI-DAQmx 15.1. For the list of devices supported by a specific release, refer to the NI-DAQmx Readme, available on the version-specific download page or installation media.

You can download NI-DAQmx from [ni.com/downloads](http://ni.com/downloads). NI-DAQmx supports LabVIEW, LabWindows™/CVI™, C/C++, C#, and Visual Basic .NET. When you install NI-DAQmx, you only need to install support for the application software that you intend to use.

No other software is required to verify the operation of the TB-4302C.

## Documentation

Consult the following documents for information about the PXIe-4302/4303, NI-DAQmx, and your application software. All documents are available on [ni.com](http://ni.com), and help files install with the software.

	NI PXIe-4302/4303 and TB-4302/4302C User Guide and Terminal Block Specifications NI-DAQmx driver software installation and hardware setup.
	NI PXIe-4302/4303 User Manual PXIe-4302/4303 usage and reference information.
	NI PXIe-4302/4303 Specifications PXIe-4302/4303 specifications and calibration interval.
	NI-DAQmx Readme Operating system and application software support in NI-DAQmx.
	NI-DAQmx Help Information about creating applications that use the NI-DAQmx driver.
	LabVIEW Help LabVIEW programming concepts and reference information about NI-DAQmx VIs and functions.
	NI-DAQmx C Reference Help Reference information for NI-DAQmx C functions and NI-DAQmx C properties.
	NI-DAQmx .NET Help Support for Visual Studio Reference information for NI-DAQmx .NET methods and NI-DAQmx .NET properties, key concepts, and a C enum to .NET enum mapping table.

## PXIe-4302/4303 Verification and Adjustment

This section provides information for verifying and adjusting the PXIe-4302/4303.

### Test Equipment


Table 1 lists the equipment recommended for the performance verification and adjustment procedures of the PXIe-4302/4303. If the recommended equipment is not available, select a substitute using the requirements listed in Table 1.

Table 1. Recommended Equipment for PXIe-4302/4303 Verification and Adjustment

Equipment	Recommended Model	Requirements
DMM	PXI-4071	Use a DMM that has an accuracy of 13 ppm or better when measuring the 10 V range, an accuracy of 30 ppm or better when measuring the 100 mV range, and an offset error of 0.8 mV or better at 0 V.
PXI Express Chassis	PXIe-1062Q	If this chassis is unavailable, use another PXI Express chassis, such as the PXIe-1082 or PXIe-1078.
Connection Accessory	TB-4302	—
SMU	PXIe-4139	Noise (0.1 Hz to 10 Hz, peak to peak) is 60 mV or better at 10 V.  Noise (0.1 Hz to 10 Hz, peak to peak) is 2 mV or better at 100 mV.

### Connecting the TB-4302

The TB-4302 provides connections for the PXIe-4302/4303. Figure 1 shows the pin assignments of the TB-4302. Figure 1. TB-4302 Circuit Board Parts Locator Diagram

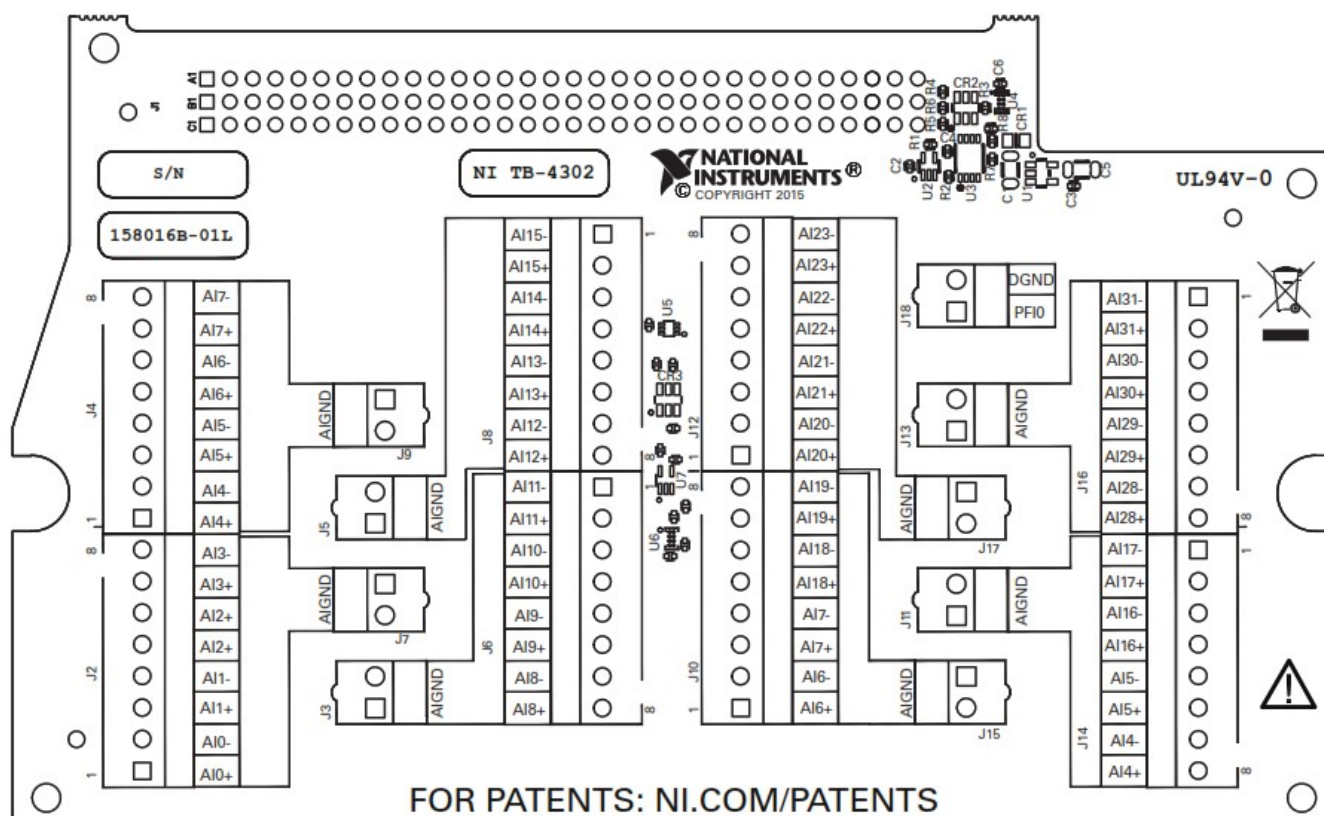

Each channel consists of two terminal connections specific to that channel as shown in Table 2.

You can verify or adjust the accuracy for any or all channels depending on the desired test coverage. Refer to Figure 2 and only connect the input channels required for verification or adjustment in parallel.

Refer to Table 2 for the analog signal names of the TB-4302.


**Table 2. TB-4302 Analog Signal Names**

Signal Name	Signal Description
AI+	Positive input voltage terminal
AI-	Negative input voltage terminal
AIGND	Analog ground input

**Complete the following steps to connect the TB-4302.**

1. Install the PXIe-4302/4303 and the TB-4302 in the PXI Express chassis according to the instructions in the NI PXIe-4302/4303 and TB-4302/4302C User Guide and Terminal Block Specifications.
2. Configure the PXIe-4139 to voltage output mode and enable remote sensing. Connect the PXIe-4139 output to the TB-4302 as shown in Figure 2.
3. Use two 10 kE resistors with 1% or better tolerance to build a voltage divider to bias the PXIe-4139 output and set the common-mode input of the PXIe-4302/4303 to zero volts.  
Connect one resistor between AI+ and AIGND and the other between AI- and AIGND as shown in Figure 2.
4. Connect the PXI-4071 to measure the differential voltage across the TB-4302 AI+ and AI- terminals. A detailed wiring diagram is shown in Figure 2.

**Figure 2. Connecting the TB-4302**

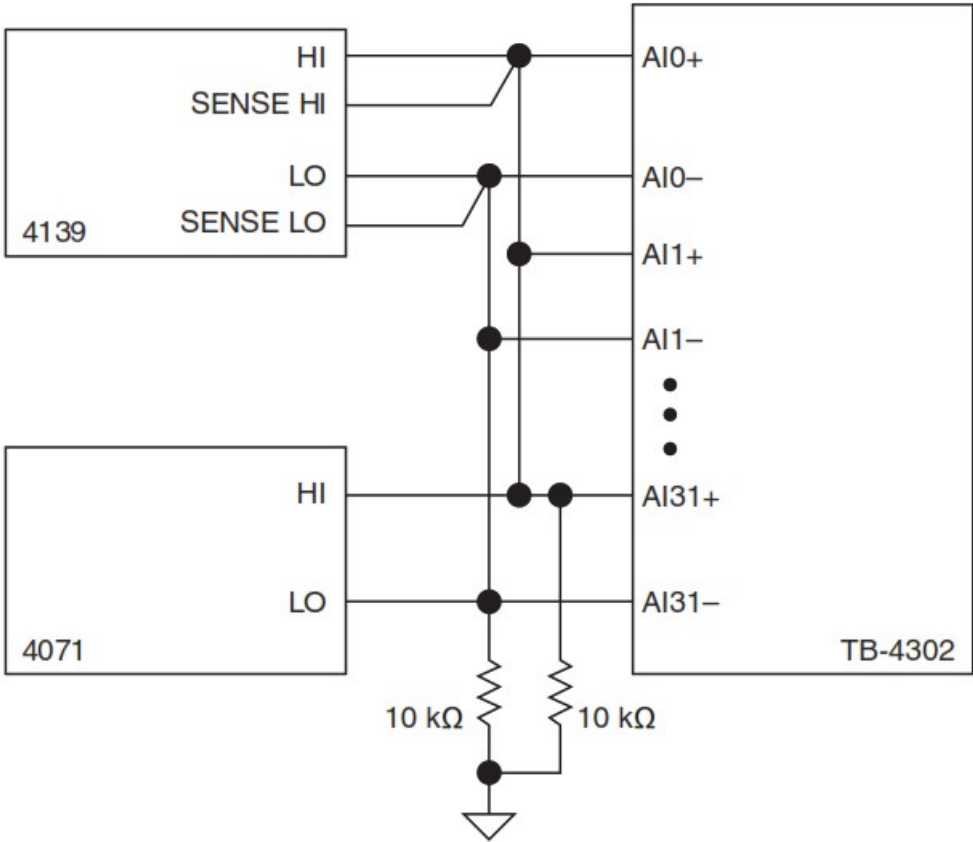

**Test Conditions**

The following setup and environmental conditions are required to ensure the PXIe-4302/4303 meets published specifications.

- Keep connections to the PXIe-4302/4303 as short as possible. Long cables and wires act as antennas, picking up extra noise that can affect measurements.
- Verify that all connections to the TB-4302 are secure.
- Use shielded copper wire for all cable connections to the TB-4302. Use twisted-pair wire to eliminate noise and thermal offsets.
- Maintain an ambient temperature of  $23\text{ }^{\circ}\text{C} \pm 5\text{ }^{\circ}\text{C}$ . The PXIe-4302/4303 temperature will be greater than the ambient temperature.
- Keep relative humidity below 80%.
- Allow a warm-up time of at least 15 minutes to ensure that the PXIe-4302/4303 measurement circuitry is at a stable operating temperature.
- Ensure that the PXI/PXI Express chassis fan speed is set to HIGH, that the fan filters are clean, and that the empty slots contain filler panels. For more information, refer to the Maintain Forced-Air Cooling Note to Users document available at [ni.com/manuals](http://ni.com/manuals).

### Initial Setup

Refer to the NI PXIe-4302/4303 and TB-4302/4302C Installation Guide and Terminal Block Specifications for information about how to install the software and hardware and how to configure the device in Measurement & Automation Explorer (MAX).



**Note** When a device is configured in MAX, it is assigned a device identifier. Each function call uses this identifier to determine which DAQ device to verify or to verify and adjust. This document uses Dev1 to refer to the device name. In the following procedures, use the device name as it appears in MAX.

### Accuracy Verification

The following performance verification procedures describe the sequence of operations and provides the test points required to verify the PXIe-4302/4303. The verification procedures assume that adequate traceable uncertainties are available for the calibration references. The PXIe-4302/4303 has 32 independent analog input channels. The input range of each channel can be set to 10 V or 100 mV. You can verify the accuracy of either range for any or all of the channels depending upon your desired test coverage.

**Complete the following steps to verify the voltage mode accuracy of the PXIe-4302/4303.**

1. Set the PXIe-4139 voltage output to zero volts.
2. Connect the PXIe-4139 and PXI-4071 to the TB-4302 as shown in Figure 2.
3. Use Table 3 to configure the PXIe-4139 to output a Test Point value for the appropriate range shown in Table 6, beginning with the values in the first row.

Table 3. PXIe-4139 Voltage Output Setup

Configuration	Value
Function	Voltage output
Sense	Remote
Range	600 mV range for test points less than 100 mV
	60 V range for all other test points
Current Limit	20 mA
Current Limit Range	200 mA

4. Refer to Table 4 to configure the PXI-4071 and acquire a voltage measurement.

Table 4. PXI-4071 Voltage Measurement Setup

Configuration	Value
Function	DC measurement
Range	1 V range for test points less than 100 mV.
	10 V range for all other test points.
Digital Resolution	7.5 digits
Aperture Time	100 ms
Autozero	On
ADC Calibration	On
Input Impedance	> 10 GW
DC Noise Rejection	High Order
Number of Averages	1
Power Line Frequency	Dependent upon the local power line characteristics.

5. Acquire a voltage measurement with the PXIe-4302/4303.
- Create a DAQmx task.
  - Create and configure the AI channel according to the values shown in Table 5.

Table 5. AI Voltage Mode Setup

Configuration	Value
Channel Name	Dev1/aix, where x refers to the channel number
Task	AI voltage
Sample Mode	Finite samples
Sample Clock Rate	5000
Samples per Channel	5000
Maximum Value	Appropriate maximum range value from Table 6
Minimum Value	Appropriate minimum range value from Table 6
Units	Volts

- c. Start the task.
  - d. Average the readings that you acquired.
  - e. Clear the task.
  - f. Compare the resulting average to the Lower Limit and Upper Limit values in Table 6.
- If the result is between these values, the device passes the test.

Table 6. Voltage Measurement Accuracy Limits

Range (V)		Test Point (V)	Lower Limit (V)	Upper Limit (V)
Minimum	Maximum			
-0.1	0.1	-0.095	DMM Reading – 0.0007 V	DMM Reading + 0.0007 V
-0.1	0.1	0	DMM Reading – 0.000029 V	DMM Reading + 0.000029 V
-0.1	0.1	0.095	DMM Reading – 0.0007 V	DMM Reading + 0.0007 V
-10	10	-9.5	DMM Reading – 0.004207 V	DMM Reading + 0.004207 V
-10	10	0	DMM Reading – 0.001262 V	DMM Reading + 0.001262 V
-10	10	9.5	DMM Reading – 0.004207 V	DMM Reading + 0.004207 V

6. For each value in Table 6, repeat steps 3 through 5 for all channels.
7. Set the PXIe-4139 output to be zero volts.
8. Disconnect the PXIe-4139 and PXI-4071 from the TB-4302.

### Adjustment

The following performance adjustment procedure describes the sequence of operations required to adjust the PXIe-4302/4203.

Complete the following steps to adjust the accuracy of the PXIe-4302/4203.

1. Set the PXIe-4139 output to be zero volts.

2. Connect the PXIe-4139 and PXI-4071 to the TB-4302 as shown in Figure 2.
3. Call the DAQmx Initialize External Calibration function with the following parameters:  
 Device In: Dev1  
 Password: NI 1
4. Call the 4302/4303 instance of the DAQmx Setup SC Express Calibration function with the following parameters:  
 calhandle in: calhandle output from DAQmx Initialize External Calibration rangeMax: Appropriate Range Max starting with the value in the first row of Table 7 rangeMin: Appropriate Range Min starting with the value in the first row of Table 7 physical channels: dev1/ai0:31

Table 7. Voltage Mode Adjustment Test Points

Range (V)		Test Points (V)
Max	Min	
0.1	-0.1	-0.09
		-0.06
		-0.03
		0
		0.03
		0.06
		0.09
10	-10	-9
		-6
		-3
		0
		3
		6
		9

5. Refer to Table 3 to configure the PXIe-4139. Set the PXIe-4139 output equal to the first Test Point for the corresponding range in Table 7 that was configured in step 4.
6. Enable the PXIe-4139 output.
7. Refer to Table 4 to configure the PXI-4071 and acquire a voltage measurement.
8. Call the 4302/4303 instance of the DAQmx Adjust SC Express Calibration function with the following



parameters: calhandle in: calhandle output from DAQmx Initialize External Calibration reference voltage: DMM measurement value from step 7

9. Repeat steps 5 through 8 for the remaining Test Point values from Table 7 for the corresponding range that was configured in step 4.
10. Repeat steps 4 through 9 for the remaining ranges from Table 7.
11. Call the 4302/4303 instance of the DAQmx Adjust SC Express Calibration function with the following parameters:  
calhandle in: calhandle output from DAQmx Initialize External Calibration action: commit

### EEPROM Update

When an adjustment procedure is completed, the PXIe-4302/4303 internal calibration memory (EEPROM) is immediately updated.

If you do not want to perform an adjustment, you can update the calibration date without making any adjustments by initializing an external calibration and closing the external calibration.

### Reverification

Repeat the Accuracy Verification section to determine the As-Left status of the device.



**Note** If any test fails Reverification after performing an adjustment, verify that you have met the Test Conditions before returning your device to NI. Refer to World Wide Support and Services for assistance in returning the device to NI.

### TB-4302C Verification

This section provides information for verifying the performance of the TB-4302C.

#### Test Equipment

Table 8 lists the equipment recommended for verifying the shunt value of the TB-4302C. If the recommended equipment is not available, select a substitute using the requirements listed in Table 8.


Table 8. Recommended Equipment for PXIe-4302/4303 Verification and Adjustment

Equipment	Recommended Model	Requirements
DMM	PXI-4071	Use a DMM with an accuracy of 13 6 ppm or better when measuring 5 $\Omega$ in 4-wire mode.

### Accuracy Verification

The TB-4302C has a total of 32, 5  $\Omega$  shunt resistors, one for each channel. The reference designators of the shunt resistors range from R10 to R41 as shown in Figure 3.

Figure 3. TB-4302C Circuit Board Shunt Resistor Locator Diagram

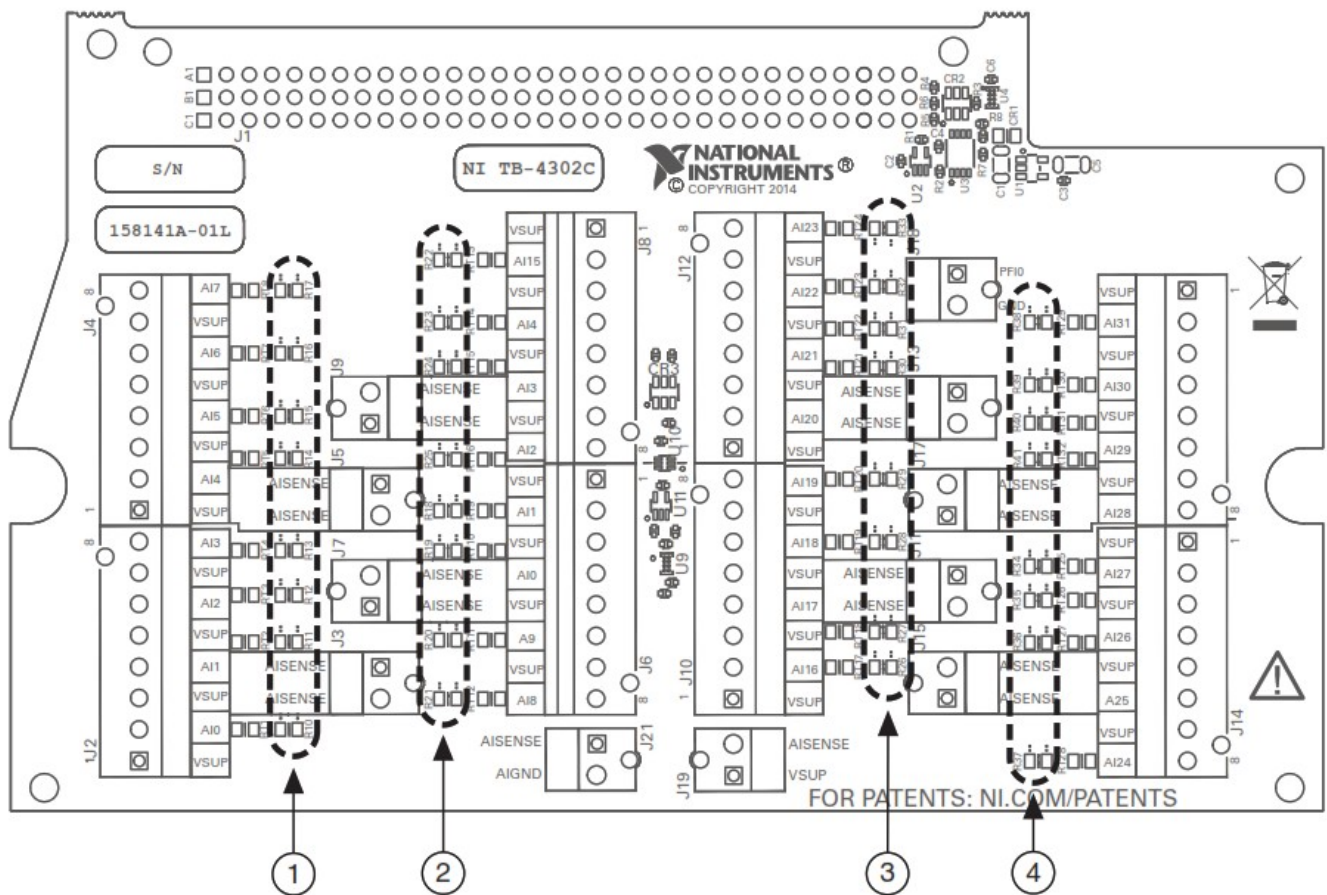

1. R10, R11, R12, R13, R14, R15, R16, R17 (Bottom to Top)
2. R21, R20, R19, R18, R25, R24, R23, R22 (Bottom to Top)
3. R26, R27, R28, R29, R30, R31, R32, R33 (Bottom to Top)
4. R37, R36, R35, R34, R41, R40, R39, R38 (Bottom to Top)

Table 9 shows the correlation between the AI channels and the shunt reference designators.  
 Table 9. Channel to Shunt Reference Designator Correlation

Channel	Shunt Reference Designator
CH0	R10
CH1	R11
CH2	R12
CH3	R13
CH4	R14
CH5	R15
CH6	R16
CH7	R17
CH8	R21

CH9	R20
CH10	R19
CH11	R18
CH12	R25
CH13	R24
CH14	R23
CH15	R22
CH16	R26
CH17	R27
CH18	R28
CH19	R29
CH20	R30
CH21	R31
CH22	R32
CH23	R33
CH24	R37
CH25	R36
CH26	R35
CH27	R34
CH28	R41
CH29	R40
CH30	R39
CH31	R38

The following performance verification procedure describes the sequence of operations to verify the shunt values of the TB-4302C.

1. Open the TB-4302C enclosure.
2. Configure the PXI-4071 for 4-wire resistance measurement mode as shown in Table 10.

Table 10. PXI-4071 Voltage Measurement Setup

Configuration	Value
Function	4-wire resistance measurement
Range	100 W
Digital Resolution	7.5
Aperture Time	100 ms
Autozero	On
ADC Calibration	On
Input Impedance	> 10 GW
DC Noise Rejection	High order
Number of Averages	1
Power Line Frequency	Dependent upon the local power line characteristics.
Offset Compensated Ohms	On

3. Locate R10 on the TB-4302C. Refer to Figure 3.
4. Hold the HI and HI\_SENSE probes of the PXI-4071 to one pad of R10 and hold the LO and LO\_SENSE probes to the other pad of R10.
5. Acquire a resistance measurement with the PXI-4071.
6. Compare the results to the Lower Limit and Upper Limit values in Table 11. If the results are between these values, the device passes the test.

Table 11. 5 Shunt Accuracy Limit

Nominal	Upper Limit	Lower Limit
5 W	5.025 W	4.975 W

7. Repeat steps 3 through 6 for all other 5 shunt resistors.



**Note** If the TB-4302C fails verification, refer to World Wide Support and Services for assistance in returning the terminal block to NI.

## Specifications

Refer to the NI PXIe-4302/4303 Specifications document for detailed PXIe-4302/4303 specification information. Refer to the NI PXIe-4302/4303 and TB-4302/4302C User Guide and Terminal Block Specifications document for detailed TB-4302C specification information.

## World Wide Support and Services

The National Instruments website is your complete resource for technical support. At [ni.com/support](http://ni.com/support) you have access to everything from troubleshooting and application development self-help resources to email and phone assistance from NI Application Engineers. Visit [ni.com/services](http://ni.com/services) for NI Factory Installation Services, repairs, extended warranty, and other services.

Visit [ni.com/register](http://ni.com/register) to register your National Instruments product. Product registration facilitates technical support and ensures that you receive important information updates from NI. National Instruments corporate headquarters is located at 11500 North Mopac Expressway, Austin, Texas, 78759-3504. National Instruments also has offices located around the world. For telephone support in the United States, create your service request at [ni.com/support](http://ni.com/support) or dial 1 866 ASK MYNI (275 6964). For telephone support outside the United States, visit the Worldwide Offices section of [ni.com/niglobal](http://ni.com/niglobal) to access the branch office websites, which provide up-to-date contact information, support phone numbers, email addresses, and current events.

Refer to the NI Trademarks and Logo Guidelines at [ni.com/trademarks](http://ni.com/trademarks) for more information on National Instruments trademarks. Other product and company names mentioned herein are trademarks or trade names of their respective companies. For patents covering National Instruments products/technology, refer to the appropriate location: Help>Patents in your software, the patents.txt file on your media, or the National Instruments Patents Notice at [ni.com/patents](http://ni.com/patents). You can find information about end-user license agreements (EULAs) and third-party legal notices in the readme file for your NI product. Refer to the Export Compliance Information at [ni.com/legal/export-compliance](http://ni.com/legal/export-compliance) for the National Instruments global trade compliance policy and how to obtain relevant HTS codes, ECCNs, and other import/export data. NI MAKES NO EXPRESS OR IMPLIED WARRANTIES AS TO THE ACCURACY OF THE INFORMATION CONTAINED HEREIN AND SHALL NOT BE LIABLE FOR ANY ERRORS. U.S. Government Customers: The data contained in this manual was developed at private expense and is subject to the applicable limited rights and restricted data rights as set forth in FAR 52.227-14, DFAR 252.227-7014, and DFAR 252.227-7015. © 2015 National Instruments. All rights reserved. 377005A-01 Sep15

## COMPREHENSIVE SERVICES

We offer competitive repair and calibration services, as well as easily accessible documentation and free downloadable resources.

## SELL YOUR SURPLUS

We buy new, used, decommissioned, and surplus parts from every NI series. We work out the best solution to suit your individual needs. Sell For Cash Get Credit Receive a Trade-In Deal

## OBSOLETE NI HARDWARE IN STOCK & READY TO SHIP


We stock New, New Surplus, Refurbished, and Reconditioned NI Hardware.

Request a Quote

## Z CLICK HERE

Bridging the gap between the manufacturer and your legacy test system.



 1-800-915-6216



[www.apexwaves.com](http://www.apexwaves.com)




[sales@apexwaves.com](mailto:sales@apexwaves.com)

All trademarks, brands, and brand names are the property of their respective owners.

PXIe-4303

## Documents / Resources

	<a href="#">APEX WAVES PXIe-4302 32-Channel 24-Bit 5 kS-s-ch PXI Analog Input Module</a> [pdf] User Manual PXIe-4302, PXIe-4303, 4302, 4303, TB-4302C, PXIe-4302 32-Channel 24-Bit 5 kS-s-ch PXI Analog Input Module, PXIe-4302, 32-Channel 24-Bit 5 kS-s-ch PXI Analog Input Module, Analog Input Module, Input Module, Module
---	--

## References

- [NI Engineer Ambitiously - NI](#)
- [NI Engineer Ambitiously - NI](#)
- [NI Software and Driver Downloads - NI](#)
- [NI Trade Compliance - NI](#)
- [NI Product Documentation - NI](#)
- [NI Contact Us - NI](#)
- [NI National Instruments Patents - NI](#)
- [NI Log In - National Instruments](#)
- [NI NI Services - NI](#)
- [NI Support - NI](#)
- [NI NI Trademarks and Logo Guidelines - NI](#)
- [NI ni.com](#)
- [NI Software and Driver Downloads - NI](#)
- [NI Contact Us - NI](#)
- [NI Log In - National Instruments](#)
- [NI Support - NI](#)
- [NI PXIe-4303 National Instruments PXI Analog Input Module | Apex Waves](#)