



# DrayTek Vigor2862 VDSL2 Router Instructions

[Home](#) » [DrayTek](#) » DrayTek Vigor2862 VDSL2 Router Instructions 

## Contents

- [1 DrayTek Vigor2862 VDSL2 Router](#)
- [2 Release Note for Vigor2862 Series](#)
- [3 New Features](#)
- [4 Improvement](#)
- [5 Version and Modem Code](#)
- [6 Documents / Resources](#)

**DrayTek**

## DrayTek Vigor2862 VDSL2 Router



## Release Note for Vigor2862 Series

Firmware Version:	3.9.9
Release Type:	Normal
Applied Models:	Vigor2862 / Vigor2862n / Vigor2862ac / Vigor2862Vac / Vigor2862L / Vigor2862Ln / Vigor2862Lac

Vigor2862 series is a VDSL2 router with a multi-subnet for secure and efficient workgroup management. It integrates IP layer QoS, NAT session/bandwidth management to help users control works well with large bandwidth. Besides, “n” and “ac” series have built-in Wireless LAN for wireless connection.

Vigor2862 series is a VDSL2 router with a multi-subnet for secure and efficient workgroup management. It integrates IP layer QoS, NAT session/bandwidth management to help users control works well with large bandwidth. Besides, “n” and “ac” series have built-in Wireless LAN for wireless connection.

## New Features

- Support Cyren Zero-Day WCF.

## Improvement

- **Improved:** Add new Annex B modem code 779B07 in the MDM4 firmware to solve a VDSL sync issue with German ISP M-Net.
- **Corrected:** An issue that the Secondary NTP server box was cleared after editing Daylight Saving.
- **Corrected:** An IPsec IKE buffer leakage issue when receiving retransmitted phase2 PFS negotiation.
- **Corrected:** An issue with system uptime display for switch status on Central Management >> Switch >> Status.
- **Corrected:** An issue with the system not working if entering more than a certain number (e.g., 500) characters for the hotspot web portal terms and conditions.

## Version and Modem Code

- “Vigor2862\_v3.9.9\_STD\_en.zip” provides Annex A modem code 776d07\_772801 and 774307\_771801, and Annex B modem code 773306\_771502 and 773307\_771C02.
- “Vigor2862\_v3.9.9\_MDM1\_en.zip” provides Annex A modem code 779517\_773F01 and 77B507\_775401, Annex B modem code 779B06\_774F02 and 779B07\_774C12. Recommended for Australia.
- “Vigor2862\_v3.9.9\_MDM2\_en.zip” provides Annex A modem code 77B506\_775401, 778C06\_773F01, and Annex B modem code 779906\_774402, 779B06\_774C02.
- “Vigor2862\_v3.9.9\_MDM3\_en.zip” provides Annex A modem code 77C717\_775A11, and Annex B modem code 77C717\_775A12.
- “Vigor2862\_v3.9.9\_MDM4\_en.zip” provides Annex A modem code 776d07\_772801, 774307\_771801, and Annex B modem code 779B07\_774C12.

## Known Issue

- None.

