Keyence IL-065 Sensor Head



\$515.00

In Stock **Qtv Available: 2 Used and in Excellent Condition**

Open Web Page

https://www.artisantg.com/94395-1

ARTISAN'

Your definitive source for quality pre-owned equipment.

Artisan Technology Group

(217) 352-9330 | sales@artisantg.com | artisantg.com

All trademarks, brandnames, and brands appearing herein are the property of their respective owners.

- Critical and expedited services
- In stock / Ready-to-ship

- · We buy your excess, underutilized, and idle equipment
- · Full-service, independent repair center

Artisan Scientific Corporation dba Artisan Technology Group is not an affiliate, representative, or authorized distributor for any manufacturer listed herein.



CMOS Multi-Function Analog Laser Sensor IL Series

User's Manual

Read this manual before using in order to achieve maximum performance.

After reading, keep this manual in a safe place so that you can refer to it at any time.



Introduction

This manual describes the basic operations and information for the IL Series.

Read this manual carefully to ensure performance and function of the IL Series for safe use. Keep this manual in a safe place for future reference.

Make sure this manual is provided to the end user of this device.

■ Symbols

The following symbols alert you to important messages. Be sure to read these messages carefully.

⚠ DANGER	It indicates a hazardous situation which, if not avoided, will result in death or serious injury.
⚠ WARNING	It indicates a hazardous situation which, if not avoided, could result in death or serious injury.
A CAUTION	It indicates a hazardous situation which, if not avoided, could result in minor or moderate injury.
NOTICE	It indicates a situation which, if not avoided, could result in product damage as well as property damage.
► Important	It indicates cautions and limitations that must be followed during operation.
► Important	•
► Important • Point	•
	operation.
	operation.

Safety Precautions

General Precautions

- At startup and during operation, be sure to monitor the functions and performance of this
 product and confirm normal operation.
- We recommend that you take substantial safety measures to avoid any damage in the event that a problem occurs.
- If the product is modified or used in any way other than those described in the specifications, its functions and performance cannot be guaranteed.
- When this product is used in combination with other devices, the functions and performance may be weaken, depending on the operating conditions, surrounding environment, etc.
- Do not use this product for the purpose of protecting the human body.
- Do not subject each device including peripheral devices to rapid temperature change.
 Product failure may occur due to condensation.

Safety Information for the IL series



- This product is just intended to detect the object(s). Do not use this product for the purpose to protect a human body or a part of human body.
- This product is not intended for use as explosion-proof product.
 Do not use this product in hazardous location and/or potentially explosive atmosphere.

Safety Precautions on Laser Products

- Use of controls or adjustments or performance of procedures other than those specified herein may result in hazardous radiation exposure.
- Follow the instructions mentioned in this manual. Otherwise, injury to the human body (eyes and skin) may result.
- Do not disassemble this product. Laser emission from this product is not automatically stopped when it is disassembled.
- Precautions on class 2 laser products
 - Do not stare into the beam.
 - Do not direct the beam at other people or into areas where other people unconnected with the laser work might be present.
 - Be careful of the path of the laser beam.
 When the laser beam is reflected or diffused from a mirror surface, and this reflection may cause danger, block this reflection using a surrounding enclosure.
 - Install the products so that the path of the laser beam is not as the same height as that of human eye.


Item		Description	
Model		IL-030	IL-065/IL-100/ IL-300/IL-600/IL-2000
Wavelength		655 nm	655 nm
FDA (CDRH)	Laser Class	Class 1 Laser Product*	Class 2 Laser Product*
Part1040.10	Output	220 μW	560 μW
IEC 60825-1	Laser Class	Class 1 Laser Product	Class 2 Laser Product
120 00023-1	Output	220 μW	560 μW

The classification is implemented based on IEC60825-1 following the requirement of Laser Notice No.50 of FDA (CDRH).

Safety measures for the laser

■ Laser radiation emission indicator

The laser radiation emission indicator is lit during laser emission. It flashes when laser emission is stopped.

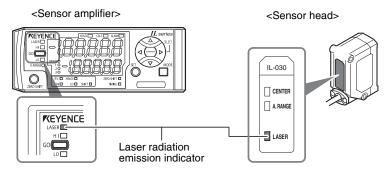

The position of the indicator of the IL-2000 will differ from above.

Laser emission stop input

When laser emission stop input is set as an external input, laser emission can be stopped by turning on the external input (input response time 20 ms). Laser emission remains stopped while the external input is on. The laser is emitted within 20 ms being external input of the turned off. For the conditions of detection outputs and analog outputs during laser emission stop input, refer to "11. External Input" (page 4-30) of the User's Manual.

Warming up


Leave the IL Series about 30 minutes after turning on the power.

The circuit is not stable immediately after the power turns on, so the display value may gradually fluctuate.

Laser warning labels

The following diagrams show the type and position of laser warning labels on to the IL Series.

IL-065/IL-100/IL-300/IL-600

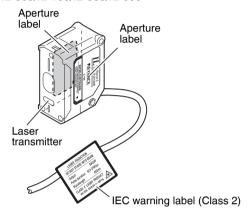


■ Aperture label



■ IEC warning/explanatory label (CLASS 2)



IL-2000

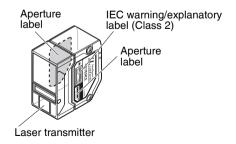

■ Aperture label



 
■ IEC warning/explanatory label (CLASS 2)




The IEC warning/explanatory labels are only affixed to Class 2 laser products. Use the suitable IEC warning/explanatory label included in the package of this product according to the countries and/or regions where this product is used.

In this case, it can be affixed on the IEC warning/explanatory label, which has already been affixed to this product.

Abnormal Conditions



Precautions on Use

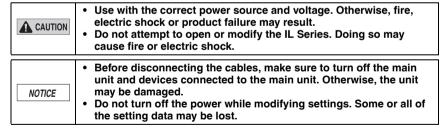

Installation environment

To use this product normally and safely, do not install this product in the following locations. Product failure may occur.

- High-humidity, dusty and poorly-ventilated locations
- High-temperature locations where the unit is exposed to direct sunlight
- Locations where there is corrosive or combustible gas
- Locations where the unit may be directly subjected to vibration or impact
- · Locations where water, oil or chemicals may splash onto the unit
- · Locations where static electricity tends to be generated

Influence of dirt

Measurement errors may occur due to dust, water, oil, etc.

- Blow away dirt on the transmitter and the receiver with clean air. Wipe with a soft cloth
 moistened with alcohol for heavy dirt.
- Blow away the dirt attached to the object with clean air or wipe it off.
- If dirt is floating in the measurement range, take adequate measures, such as installing a
 protective cover or air purge.

Anti-noise prevention

When the unit is installed near electric noise source such as a power source or high-voltage line, operational errors or product failure may occur. Take adequate measures such as using a noise filter, arranging cables separately or insulating the sensor amplifier and the sensor head.

Power ON Reset

After the power is turned ON, it will take approx. two seconds for the measurement to start. The judgment results will be output after the sampling period has elapsed.

Other Precautions

Power source

- Noise superimposed on the power supply may cause malfunction. Use a direct current stabilized power source which uses an insulation transformer.
- When using a commercially available switching regulator, make sure to ground the frame ground terminal.

Precautions on Regulations and Standards

CE Marking

Keyence corporation has confirmed that this product complies with the essential requirements of the applicable EC Directives, based on the following specifications. Be sure to consider the following specifications when using this product in the Member States of European Union.

■ EMC Directive

Applicable standards EMI : EN61326-1, ClassA

EMS: EN61326-1

• The length of the sensor head cable and all I/O cables must be less than 30m.

Remarks

These specifications do not give any guarantee that the end-product with this product incorporated complies with the essential requirements of EMC Directive.

The manufacturer of the end-product is solely responsible for the compliance on the end-product itself according to EMC Directive.

CSA Certificate

IL series complies with the following CSA and UL standards and has been certified by CSA (Class 2252 05 / Class 2252 85).

- Applicable standard: CAN/CSA C22.2 No.61010-1 UL61010-1
- Use the following power supply.
 CSA/UL-listed power supply that provides Class 2 output as defined in the CEC (Canadian Electrical Code) and NEC (National Electrical Code), or CSA/UL-listed power supply that has been evaluated as a Limited Power Source as defined in CAN/CSA-C22.2 No. 60950-1/UL60950-1
- Use this product at the altitude of 2000 m or less.
- · Indoor use only.
- The sensor head cable and the sensor head connection cable must be installed in such a
 way as to avoid mechanical damage (e.g.: crushing).
- The power/input-output cable for amplifier unit is for internal wiring only.
- The following cables are rated 30 V.
 - sensor head cable
 - sensor head connection cable
 - power/input-output cable for amplifier unit

Install these cables where it is separated from the circuit over 30 V.

Table of Contents

Int	roduction	
Sa	afety Precautions	1
	General Precautions	1
	Safety Information for the IL series	1
	Safety Precautions on Laser Products	1
	Abnormal Conditions	
	Precautions on Use	4
	Other Precautions	
	Precautions on Regulations and Standards	5
Chap	ter 1 Before Use	
1-	1 Checking the Package Contents	1.0
1-	Sensor Amplifier	
	•	
	Sensor HeadList of Optional Parts	
	·	
1-:		
	Sensor Amplifier Unit	
	Sensor Head Unit	1-8
Chap	ter 2 Installation and Connection	
2-	1 Mounting and Wiring the Sensor Amplifier	2-2
	Mounting the Sensor Amplifier	2-2
	Sensor Amplifier Wiring	
2-	2 Connecting and Mounting the Sensor Head	
	Mounting the Sensor Head	
	Connection and Wiring	
	Connection and willing	2-3
Chap	ter 3 Basic Operations	
3-	Operation When the Power is Turned on for the First Time	3-2
	·	
3-	·	
	R.V. (Internal Measurement Value) and P.V. (Judgment Value)	
	Main Display (Upper Level)	
	Sub Display (Lower Level)	
	Setting Operations	ა-ნ

3-4	Setting the Tolerance Setting Value	
	Manual Setting	
	Automatic Setting (When other than step count filter)	
	Automatic Setting (When step count filter)	3-16
3-5	Zero Shift Function (Shifting the Internal Measurement Va	, ,,
	Setting the Shift Target Value	
	Enabling the Zero Shift	
	Canceling the Zero Shift (Reset)	
3-6	Bank Function (Registering Multiple Tolerance Setting Va	ılues). 3-20
	Settings Registered with the Bank	3-20
	How to Switch the Bank	3-20
3-7	Key Lock Function	3-21
	Starting the Key Lock	3-21
	Canceling the Key Lock (Unlock)	3-21
hante	er 4 Setting Various Functions	
пари	The Colling Various Functions	
4-1	Setting Operations	1-2
4-1	•	
	Setting Operations	
4-2	Basic Settings and Advanced Settings	
	List of Setting Items	
	Setting Screen	
	Measurement Direction	
	2. Sampling Rate	
	3. Averaging rate, Step count filter, High-pass filter	
	4. Alarm Setting	
	5. Output State	
	6. Hold Function	
	7. Timing Input	
	8. Delay Timer	
	9. Hysteresis	
	10. Analog Output Scaling	
	Analog Output Accuracy	
	11. External Input	
	12. Bank Switching Method	
	13. Zero Shift Value Memory Function	4-38
		9

Operation for Changing the Model of Connected Head......3-9

IL-E

3-3

		14. Interference Prevention Function (Only for IL-1000/1500)	
		15. Display Digit	
		16. Power Saving Function	
		17. Head Display Mode	
	4.2	18. Display Color	
	4-3	Calculation Function	
		Calculation Value (CALC value)	
		Subtraction Mode	
		Setting Method (Only Main Unit)	
	4-4	Calibration Function	
	4-4	Setting method (Calibrating R.V.)	
		Setting method (Calibrating N.V.) Setting method (Two-point calibration of calculated value (CALC)	
		Setting method (1 wo point calibration of calculated value (CALO	
		Setting method (Three-point calibration of calculated value (CALC	
Ch	napte	er 5 Specifications	
	5-1	Specifications	5-2
		Sensor Head	
		Sensor Amplifier	
	5-2	Circuit Diagram	
	<i>5 </i>	Output Circuit Diagram	
		Analog Output Circuit	
		Input Circuit Diagram	
	5-3	Dimensions	5-6
		Mutual-interference	5-12
		Spot Diameter	
	5-4	Response Time	5-16
Δr	pen	div	
~ ŀ	pen	uix	
	Troi	plachasting	٨٥
	1100	ibleshooting Frequently Asked Questions	
		Error Displays and Corrective Actions	
		Non-Error Displays and Corrective Actions	
	Dien	lay Screen and Output	
	PISP	nay ooreen and output	^-0

Factory Setting (Default Value) List	A-9
Index	A-10

Before Use

This chapter describes the overview of the IL Series and the name and function of each part.

1-1	Checking the Package Contents	1-2
1-2	Part Names and Functions	1-5

IL-E 1-1


Checking the Package Contents

The following equipment and accessories are included in the package. Before using the unit, make sure that all items are included.


We have thoroughly inspected the package contents before shipment. However, in the event of defective or broken items, contact your nearest KEYENCE office.


Sensor Amplifier

DIN rail mount type

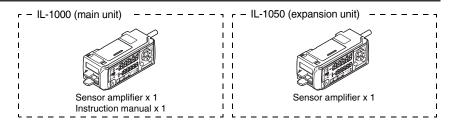


Panel mount type

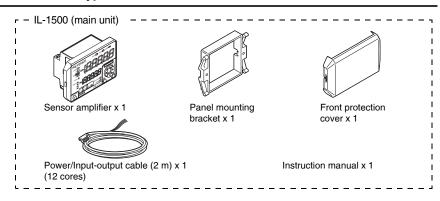

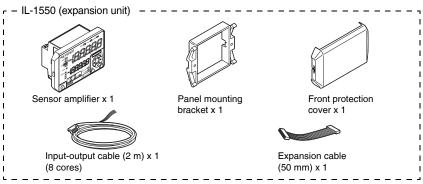



1-2

Sensor Head

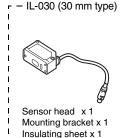


Flat nut x 1

 

 

 Sensor head x 1 Mounting bracket x 1 Insulating sheet x 1 Flat nut x 1 M3 x L30 screw x 2 Laser warning sticker x 1





Sensor head x 1 Mounting bracket x 1 Insulating sheet x 1 Flat nut x 1 M4 x L35 screw x 2 Laser warning sticker x 1




M3 x L30 screw x 2



Sensor head x 1 M5 x L60 screw x 2 Laser warning sticker x 1


List of Optional Parts


For sensor amplifier

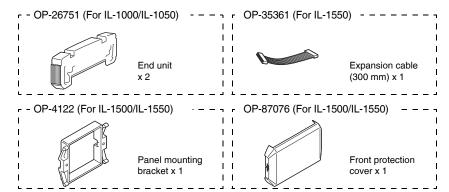

IL-E 1-3

For sensor head

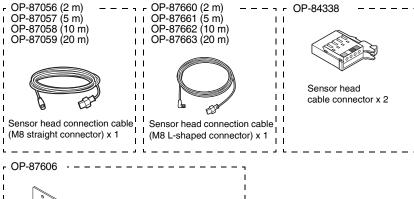

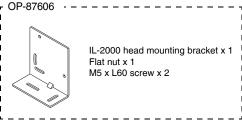


1-4

1-2 Part Names and Functions


Sensor Amplifier Unit

DIN rail mount type (IL-1000/IL-1050)

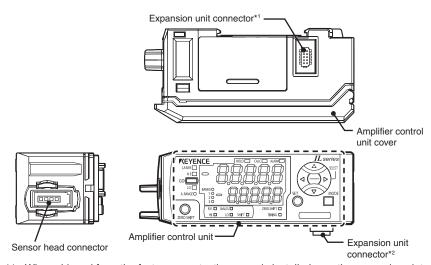

- *1 When shipped from the factory, a protective cover is installed over the expansion slots.
- *2 It is not installed on the main unit (IL-1000).

Panel mount type (IL-1500/IL-1550)

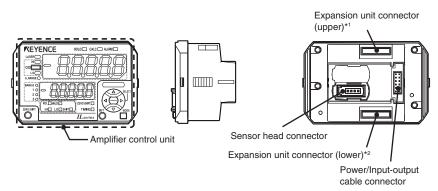


- *1 It is not installed on the main unit (IL-1500).
- *2 When shipped from the factory, a protective seal is attached.


IL-E 1-5

Amplifier control unit

■ DIN rail mount type (IL-1000/IL-1050)

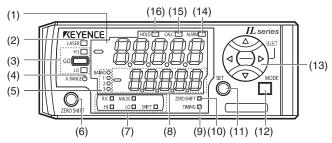

■ Panel mount type (IL-1500/IL-1550)

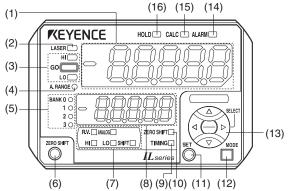

Item	Description
(1) Main display	Displays the judgment value (P.V.) and each setting item.
(2) Laser warning emission	Lights up while the laser beam is being emitted.
indicator	Blinks while the laser beam emission is stopped.
(3) Judgment indicator	Displays whether the judgment value (P.V.) is HIGH (over the upper limit), GO (within the acceptable range) or LOW (below the lower limit) against the tolerance setting value.
	☐ "3-4 Setting the Tolerance Setting Value" (page 3-10)
(4) Analog range indicator	Lights up when the P.V. (judgment value) is within the analog output range. If the analog output setting is OFF, or when using the expansion unit, the indicator lights within the following detection range. • IL-030: 30 ± 5 mm • IL-065: 65 ± 10 mm • IL-100: 100 ± 20 mm • IL-300: 300 ± 140 mm • IL-600: 600 ± 400 mm • IL-2000: 2000 ± 1000mm


1-6


Item	Description
	Displays a bank in use.
(5) Bank indicator	☐ "3-6 Bank Function (Registering Multiple Tolerance
	Setting Values)" (page 3-20)
	Press this button to match the internal measurement value
(6) Zero shift button	(R.V.) to the shift target value.
	"3-5 Zero Shift Function (Shifting the Internal
	Measurement Value (R.V.))" (page 3-18) Lights up according to the type of values displayed on the
(7) Sub display indicator	sub display.
	Displays the internal measurement value (R.V.), analog
(8) Sub display	output value and each setting (selection) item.
	Lights up while the timing input is ON when the timing input
(9) Timing input indicator	(external input) is set to Level. Lights on approx. 0.5 sec.
(3) Tilling input indicator	when the timing input is set to Edge and the timing input is
	turned ON.
(10) Zero shift indicator	The zero shift indicator will light up for approx. 0.5 second when the zero shift function is used.
	Used to automatically adjust the setting values when setting
(11) SET button	each item.
(10) 1100551	Used when setting each item, starting/ending the setting or
(12) MODE button	moving items.
(13) Arrow button	Used when selecting settings, changing display contents on
	the sub display, etc.
(14) Alarm indicator	Lights up in the alarm state or error state.
	Lights up when calculation is in process using the calculation
(15) Calculation indicator	function.
	"4-3 Calculation Function" (page 4-42)
(40) [[-]-]-	Lights up when the Judgment Value (P.V.) is held and when
(16) Hold indicator	the step count filter is used. The continuation of the continua
	LD 6. Hold Pullction (page 4-15)

IL-E 1-7

Sensor Head Unit

  IL-030/IL-065/IL-100/IL-300/IL-600/IL-2000





Item	Description
(1) Laser receiver	Laser receiver port. The surface is covered with glass.
(2) Laser transmitter	Laser emission port. The surface is covered with glass.
(3) Mounting section	Screwed onto dedicated bracket, etc.
(4) Reference distance indicator	By default (normal display mode), and "17. Head Display Mode" (page 4-40), the reference distance indicator lights within the following detection range. • IL-030: 30 mm ± 0.25 mm • IL-065: 65 mm ± 0.5 mm • IL-300: 300 mm ± 7 mm • IL-600: 600 mm ± 20 mm • IL-2000: 2000 mm ± 50 mm
(5) Analog range indicator	By default (normal display mode), the analog range indicator lights when the P.V. (judgment value) is within analog output range. The indicator lights within the following detection range, when the analog output setting is OFF and with the expansion units. • IL-030: 30 mm ± 5 mm • IL-065: 65 mm ± 10 mm • IL-100: 100 mm ± 20 mm • IL-300: 300 mm ± 140 mm • IL-600: 600 mm ± 400 mm • IL-2000: 2000 ± 1000 mm
(6) Laser warning emission indicator	Lights up while the laser beam is being emitted. Blinks while the laser beam emission is stopped.

1-8 IL-E

Installation and Connection

This chapter describes precautions when installing and connecting the IL Series.

2

2-1	Mounting and Wiring the Sensor Amplifier 2-2
2-2	Connecting and Mounting the Sensor Head 2-8


IL-E 2-1

Mounting and Wiring the Sensor Amplifier

Mounting the Sensor Amplifier

DIN rail mount type, main unit (IL-1000)

Align the claw at the bottom of the main body with the DIN rail. While pushing the main body in the direction of the arrow (1), slant it in the direction of the arrow (2).

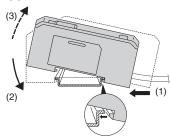

To dismount the sensor, raise the main body in the direction of the arrow (3) while pushing the main body in the direction of the arrow (1).

DIN rail mount type, expansion unit (IL-1050)

Up to 7 expansion units can be connected to one main unit.



- · Always mount expansion units onto a DIN rail.
- When connecting multiple amplifiers (expansion units), first check to make sure that the power is turned OFF to all of the main and expansion units. Connecting the units with the power turned ON may cause damage to the units.
- Push the amplifiers (expansion units) as close as possible the main unit. Improper connections may damage the equipment.

 
Point

- When connecting the expansion units, make sure to initialize the connected expansion units and set the output polarity.
- (1) When turning on the amplifier for the first time after connecting the sensor head
- "3-1 Operation When the Power is Turned on for the First Time" (page 3-2)

 (2) When performing the initial reset
- "3-3 Initial Reset (Initialize)" (page 3-8)
- Expansion units with different setting of output polarity (such as an NPN output expansion unit to a PNP output main unit) cannot be connected together.
- Expansion units of DIN rail mount type cannot be connected to the main unit of panel mount type.

2-2 IL-E

Remove the expansion protective cover from the IL-1000 (main unit).




1 Install the amplifiers (expansion units) on the DIN rail.

Refer to "DIN rail mount type, main unit (IL-1000)" (page 2-2) for details about how to mount.


Push the expansion unit into the main unit connector until a clicking sound can be heard.

 The expansion unit installed next to the main unit is referred to as expansion unit 1. Subsequent expansion units are referred to as expansion unit 2, expansion unit 3, etc.



Install the end units (OP-26751: 2 units in a set) (optional accessory) on both sides of the amplifiers (main and expansion units). Secure the end units in place with screws on top (2 on each end unit).

 The end units are mounted in the same way as the amplifiers.



Point

Fix the amplifiers securely using the end units (OP-26751: 2 units in a set) (optional accessory) or commercially available DIN rail fixing tool to prevent the amplifiers from slipping the DIN rail or coming off from the DIN rail due to machine vibration.

 
IL-E 2-3


Panel mount type, main unit (IL-1500)

Make a hole on the panel as shown in the diagrams below.


When stacking the units vertically.

nits vertically. When stacking the units horizontally.




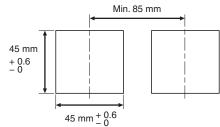

- · Panel thickness 1 to 6 mm
- X=48 x (number of amplifiers) -3
- Insert the amplifier into the panel.
- Arrange the panel mounting bracket as shown below, attach the bracket to the amplifier from the back and attach the front protection cover to the amplifier.

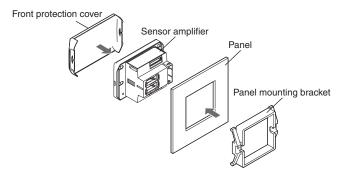

 To remove the panel mounting bracket, widen the claws at both ends of the panel mounting bracket using a screwdriver, etc. and remove alternately.



Panel mount type, expansion unit (IL-1550)

Up to 7 expansion units can be connected to one main unit.



- Turn OFF the power before connecting the expansion cable.
 Inserting or removing the cable with the power turned on may cause damage to the units.
- Be sure to completely connect the expansion cable. Improper connections may damage the equipment.



- When connecting the expansion units, make sure to initialize the connected expansion units and set the output polarity.
- (1) When turning on the amplifier for the first time after connecting the sensor head
- "3-1 Operation When the Power is Turned on for the First Time" (page 3-2)
 - (2) When performing the initial reset
 - "3-3 Initial Reset (Initialize)" (page 3-8)
 - Expansion units with different setting of output polarity (such as an NPN output expansion unit to a PNP output main unit) cannot be connected together.
- Expansion units of panel mount type cannot be connected to the main unit of DIN rail mount type.
- Make holes on the panel to attach according to the number of amplifiers (connected expansion units).


For the panel cutout dimensions, refer to the "Panel mount type, main unit (IL-1500)" (page 2-4).

2 Install the amplifiers (expansion units) on the panel.

For the amplifier mounting method, refer to the "Panel mount type, main unit (IL-1500)" (page 2-4).

Connect the amplifier (main unit) and amplifier (expansion unit) using the expansion cable (50 mm) supplied with the expansion unit.

The expansion unit installed next to the main unit is referred to as expansion unit 1. Subsequent expansion units are referred to as expansion unit 2, expansion unit 3, etc.

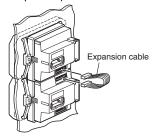

Reference D


When arranging the amplifiers side by side, the expansion cable of 300 mm (OP-35361) is necessary.

IL-E 2-5

Sensor Amplifier Wiring

Connecting power/Input-output cable (only for panel mount type)

Connect the power/input-output cable to the panel mount type main unit and connect the input-output cable to the expansion units.

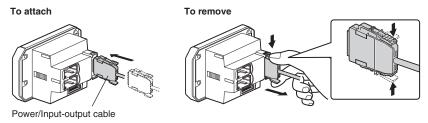




- The power/input-output cable for the main unit has 12 core wires, and the Input-output cable for the expansion units has 8.
- Power for the expansion units is supplied from the main unit.
- If the input-output is not used for the expansion units, cut the cable at the connector base or terminate the wires properly for future use.

2-6 IL-E

Power/Input-output cable

"Output Circuit Diagram" (page 5-4)

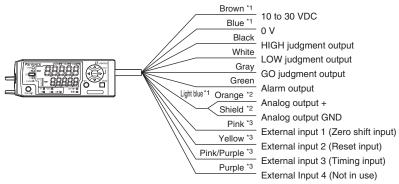

- *1 IL-1050/IL-1550 (expansion units) do not have brown, blue or light blue wires. Power is supplied to the expansion units through IL-1000/IL-1500 (main unit).
- *2 The analog output can be set to any of the following options either "When the power is turned on for the first time" or "When performing the initial reset".
 - · Not used (OFF)
 - 0 to 5 V
 - -5 to 5 V
 - 1 to 5 V
 - 4 to 20 mA
 - "3-1 Operation When the Power is Turned on for the First Time" (page 3-2)
 - "3-3 Initial Reset (Initialize)" (page 3-8)
- *3 The external input can be selected among the following in addition to the above.
 - · Bank A input
 - · Bank B input
 - · Laser emission stop input
 - Not used (OFF)

Gain input only be selected for external input 4.

- 11. External Input" (page 4-30)
- *4 When expanding to six or more units, use a power supply that provides 20 to 30 V.

IL-E 2-7

Connecting and Mounting the Sensor Head


Mounting the Sensor Head

Attach the sensor head using the dedicated mounting bracket.

When the dedicated bracket is not used, place the included insulation sheet between the mounting surface and the sensor head as indicated in the diagram. (When the dedicated bracket is used, or when the IL-2000 is used, the insulation sheet is unnecessary.)




The optical axis may vary by approximately $\pm 1.5^{\circ}$ (IL-2000), or $\pm 2.0^{\circ}$ (IL-030/IL-065/IL-100/IL-300/IL-600).

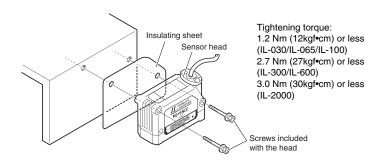

 Mounting when detecting targets close to a wall



 Variations in the detection value are possible due to stray laser light.






 The target cannot be detected when the transmitter or receiver is blocked.

When detecting uneven workpieces



  Stable detection even on uneven areas.




 Incorrect values can be detected on uneven areas.

2-8 IL-E

Connection and Wiring

Connecting the sensor head and amplifier

 Attach the sensor head connection cables to the sensor head cable




Point

Tighten the connectors securely by hand. If they are loose, the IP67 environmental resistance rating cannot be guaranteed.


1 Attach the sensor head connection cable to the amplifier connector.

 Remove the lock cover of the connector and insert it into the connectors of amplifier until a clicking sound is heard.




DIN rail mount type (IL-1000/IL-1050)

 Panel mount type (IL-1500/IL-1550)




IL-E 2-9

 Attach the lock cover to the connector to secure the cable.



Point

 When removing the sensor head connection cable, push the lock lever and pull it out.




2-10 IL-E

Attaching the sensor head cable connector (OP-84338: optional accessory)

Cut the sensor head connection cable to the required length and attach the new connector to use the sensor. The attaching method is the same for both transmitter and receiver.

 1 Cut the cable to the required length and strip approx. 15 mm of insulation from the end of the cable.




Point


Do not strip the core wire insulation.

2 Insert each cable to the end matching to the same color marks on the connector.

The cables should be inserted to the end and held in place.

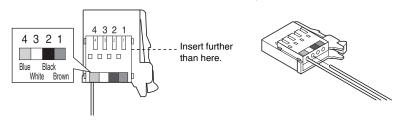

 Confirm that all cables are inserted to the specified position and crimp them using pliers or a similar tool.



Point

If the connector is changed, make sure to connect it to the amplifier and confirm the normal operation.

If it does not operate normally, crimp the connector again with pliers.

Once the connector is crimped, it cannot be reused.

IL-E 2-11

МЕМО

2-12 IL-E

Basic Operations

This chapter describes basic operations and settings for the IL Series.

3

3-1	Operation When the Power is Turned on for the First Time 3-2
3-2	Operations on the Main Screens 3-3
3-3	Initial Reset (Initialize) 3-8
3-4	Setting the Tolerance Setting Value 3-10
3-5	Zero Shift Function (Shifting the Internal Measurement Value (R.V.)) 3-18
3-6	Bank Function (Registering Multiple Tolerance Setting Values) 3-20
3-7	Key Lock Function 3-2

IL-E 3-1

-1 Operat

Operation When the Power is Turned on for the First Time

When the amplifier is turned on for the first time after the sensor head is connected, the initial setting screen appears after a few seconds. Make the initial settings according to the following procedure.

The initial setting is necessary for both the main unit and the expansion units when units are added.



Once the initial setting is completed, the initial setting display will not appear when the power is turned on the second time or the after. To change these settings, perform an initial reset.

"3-3 Initial Reset (Initialize)" (page 3-8)

 












Press ▲/▼ button to select the polarity of judgment output and edge check output, and then press [MODE] button.

Setting value	ue	Description
nPn	NPN output	
PnP	PNP output	

Press ▲/▼ button to select the type of analog output and press [MODE] button. (for IL-1000 / IL-1500 only)

Setting value	Description
oFF	Not output
0-5 u	Analog output after the judgment value (P.V.) is converted to the range from 0 to 5 V.
-5-5 u	Analog output after the judgment value (P.V.) is converted to the range from -5 to 5 V.
1-5 u	Analog output after the judgment value (P.V.) is converted to the range from 1 to 5 V.
RiPr	Analog output after the judgment value (P.V.) is converted to the range from 4 to 20 mA.

10. Analog Output Scaling" (page 4-27)



After the setting is complete, [End] blinks several times on the sub display and the main screen appears.

▲ Make other settings as necessary.

3-2 IL-E

3

3-2 Operations on the Main Screens

R.V. (Internal Measurement Value) and P.V. (Judgment Value)

This section describes R.V. (Internal Measurement Value) displayed on the sub display (lower level) and P.V. (Judgment Value) displayed on the main display (upper level).

R.V. (Internal Measurement Value)

R.V. (Internal Measurement Value) is the value displayed when a target is inserted into the measurement range.

* R.V. = Raw Value

P.V. (Judgment Value)

P.V. (Judgment Value) is the value to set the judgment output to ON/OFF according to the tolerance setting value. Also, the analog output is output based on the P.V..

- * P.V. = Present Value
- "3-4 Setting the Tolerance Setting Value" (page 3-10)

The Judgment value (P.V.) and the Internal Measurement Value (R.V.) are in general the same value. However, when the hold function or step-count filter is used, or when only the calculation function is used, they will become different values.

- "6. Hold Function" (page 4-15)
- 1 "4-3 Calculation Function" (page 4-42) (page 4-39)

Main Display (Upper Level)

The judgment value (P.V.) is displayed on the main display.

The display varies as below according to each function to be used such as Normal, Hold function, Calculation function.



Normal

 
The same value as the internal measurement value (R.V.) is displayed as a judgment value (P.V.).



[CALC] ON

When the hold function is used, when the step count filter is used

The judgment value (P.V.) is held according to the hold function settings. The Judgment Value (P.V.) is held according to the step count filter settings if they are stepped and acknowledged.



"3. Averaging rate, Step count filter, High-pass filter" (page 4-9)

When the calculation function is used

Main unit: Displays the calculated result (calculation value) with the calculation function as a judgment value (P.V.).

Expansion unit: The same display as for Normal


"4-3 Calculation Function" (page 4-42) (page 4-39)



When using both the hold function and calculation function with the main unit, the hold indicator [HOLD] and calculation indicator [CALC] will light. The judgment value (P.V.) on the main display will follow the hold function settings. The calculated value (CALC value) will be held and displayed as the judgment value (P.V.)

Sub Display (Lower Level)

The sub display can be switched with the arrow button ◀/▶. According to the type of displayed value, the sub display indicator [R.V. / ANALOG / HI / LO / SHIFT] lights up.

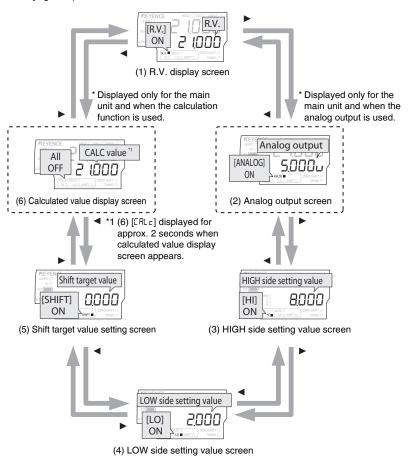

3-4 IL-E

(1) R.V. display screen


The internal measurement value (R.V.) is displayed. The displayed value is not held.


,	
The voltage value (unit: V) or curre	d when using main unit's analog output) ent value (unit: mA) of the analog output is displayed. is Turned on for the First Time" (page 3-2) ige 3-8)
(3) HIGH side setting value screen	
The upper limit of the acceptable ra	•
(4) LOW side setting value screen	
The lower limit of the acceptable ra	, ,
(5) Shift target value screen	
When the zero shift button is press measurement value (R.V.) is adjus	sed or the zero shift input is set to ON, the internal ted to the value set here. If the Internal Measurement Value (R.V.))" (page 3-18)
` .	yed when using main unit's calculation function) is displayed. The displayed value is not held. 4-42) (page 4-39)

Setting Operations


This section explains functions operable on the main screen and functions operable after the display changes to each setting screen.

  Functions Operable on the Main Screen





Panel mount type (IL-1500/IL-1550)

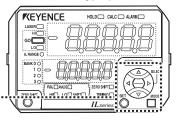

Main screen



Press ◀ or ▶ button.

- Switching display on the sub display (lower level) (page 3-4)
 Any of the internal measurement value (R.V.), analog output
 value, HIGH side setting value, LOW side setting value or shift
 target value are displayed and the settings can be changed.
- 3-4 Setting the Tolerance Setting Value (page 3-10)
 HIGH side setting value and LOW side setting value are set. The judgment is made among HIGH/GO/LOW, and the value is displayed and output.
- 3-5 Zero Shift Function (Shifting the Internal Measurement Value (R.V.)) (page 3-18)

The internal measurement value (R.V.) can be shifted (offset) to an arbitrary shift target value.

While pressing down [MODE], press \blacktriangle or \blacktriangledown button.

3-6 Bank Function (Registering Multiple Tolerance Setting Values) (page 3-20) HIGH side setting value, LOW side setting value, shift target value, and analog output scaling upper / lower limit value can be saved at up to four banks and switched.

Press [MODE] and ▲ buttons for approx. 2 seconds.

or

Press [MODE] and ▼ buttons for approx. 2 seconds.


3-7 Key Lock Function (page 3-21)

This function prevents unwanted button operations during measurement.

3-6 IL-E

Available Functions from the Main Screen

Main screen

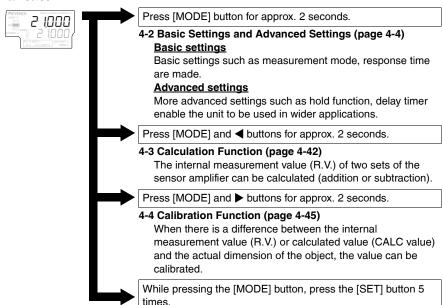

3-3 Initial Reset (Initialize) (page 3-8)

All settings, excluding the calibration function, are initialized.

Initial Reset (Initialize)

 
When initial reset is performed, all settings, excluding the calibration function, are initialized. The judgment output's polarity and analog output setting can be changed with the same operation.

Main screen



While pressing the [MODE] button, press the [SET] button 5 times.

 














While pressing the [MODE] button on the main screen, press the [SET] button 5 times.

[rE5EL] is displayed on the main display (upper level).

Press ▲/▼ button to select [كE5] and press the [MODE] button.

If $[n_0]$ is selected at this point, only the output polarity and analog output settings can be changed without performing the initial reset.

Press ▲/▼ button to select the output polarity and press the [MODE] button.

Setting value	Description
nPn	NPN output
PnP	PNP output

Press ▲/▼ button to select the analog output and press the [MODE] button. (only for IL-1000 / IL-1500 only)

Setting value	Description
oFF	Not output
0-5 u	Analog output after the judgment value is converted to the range from 0 to 5 V.
-5-5 u	Analog output after the judgment value is converted to the range from -5 to 5 V.
1-5 u	Analog output after the judgment value is converted to the range from 1 to 5 V.
AñPr	Analog output after the judgment value is converted to the range from 4 to 20 mA.

110. Analog Output Scaling" (page 4-27)

After the initialization is complete, [End] blinks several times on the sub display and the main screen is restored.

Point

If the calculation function is used, perform the initial reset for the main unit first.

Reference [

- When buttons other than the ▲/▼ button and [MODE] button are pressed during the initial reset procedure, the initial reset is canceled and the screen in step 2 is restored.
- When you attempt to initialize the unit while the key lock function is set, the screen shown on the right appears and the initialization fails.

Cancel the key lock before attempting to initialize the unit.

"3-7 Key Lock Function" (page 3-21)



3-8

Operation for Changing the Model of Connected Head

If the model of the connected head has been changed, the zero shift function and calibration function must be initialized.

The following display will appear when the connected head's model is changed.

Connect the head of different model into the amplifier.

[reset] will appear on the main display, and [Yorn] will appear on the sub display.



Press ▲/▼ button to select [9E5] and press the [MODE] button.

When [9E5] is selected, all functions including the calibration function will be initialized. After the initialization is complete, [End] blinks several times on the sub display and the main screen is restored. When [no] is selected, the main screen is restored. The zero shift function and calibration function will not be initialized.


Setting the Tolerance Setting Value

The tolerance setting value consists of the upper limit value (HIGH side setting value) and the lower limit value (LOW side setting value). By setting these values, judgments are made in three levels: when the judgment value (P.V.) goes beyond the upper limit (HIGH judgment), when the judgment goes beyond the lower limit (LOW judgment) and when the judgment is within the acceptable range (GO judgment). Then, the judgment indicator and judgment output are turned ON/OFF.

judgment	judgment output *1		judgment indicator *2			
juuginent	HIGH	GO	LOW	HI	GO	LO
HIGH	ON	OFF	OFF	Red	OFF	OFF
GO	OFF	ON	OFF	OFF	Green	OFF
LOW	OFF	OFF	ON	OFF	OFF	Red
Error *3	ON	OFF	ON	Red	OFF	Red

- *1 When the output state of judgment output is Normally Open (default value) ON/OFF is reversed for Normal Close.
 - 5. Output State" (page 4-14)
- *2 The judgment indicator ON/OFF condition can be changed.
 - "18. Display Color" (page 4-41)

 DIN rail mount type (IL-1000/IL-1050) Panel mount type (IL-1500/IL-1550)



The tolerance setting value can be set either manually or automatically.

Item		Setting Method
Manual setting		Directly enter the tolerance setting value (HIGH side setting value, LOW side setting value).
Automatic setting	Tolerance tuning	Detect the master workpiece and set the tolerance.
(When other than step count filter)	2 point tuning	Detect the good target and defective target and set the tolerance.
Automatic setting	2 point tuning	Detect the step, set the tolerance.
(When step count filter)	1 point tuning	Detect the present P.V. (Judgment Value), set the tolerance.

Point

When setting the tolerance setting value manually using the two-point tuning, make sure to set "HIGH side setting value > LOW side setting value".

3-10 IL-E



When setting "HIGH side setting value < LOW side setting value", the judgment output is as follows.

- GO judgment output is not output regardless of the judgment value (P.V.).
 (When setting HIGH side setting value = LOW side setting value = judgment value (P.V.) and setting the hysteresis to 0.000, GO judgment output is turned on.)
- When the judgment value (P.V.) goes beyond the HIGH side setting value and falls below the LOW side setting value, the HIGH judgment output and LOW judgment output are output at the same time.

Manual Setting

This is the method to directly enter the tolerance setting value (HIGH side setting value, LOW side setting value).

Press the ◀/▶ button several times on the main screen. Then display the HIGH side setting value on the sub display (lower level).

"Sub Display (Lower Level)" (page 3-4)



? Press ▲ / ▼ button to set the HIGH side setting value.

IL-030/IL-065/IL-100

Item	Setting range	Default value
HIGH side setting value	-99.999 to 99.999	5.000

IL-300/IL-600

Item	Setting range	Default value
HIGH side setting value	-999.99 to 999.99	50.00

IL-2000

Item	Setting range	Default value
HIGH side setting value	-9999.9 to 9999.9	500.0

Press the ▶ button once and display the LOW side setting value on the sub display (lower level).



Press ▲ / ▼ button to set the LOW side setting value.

IL-030/IL-065/IL-100

Item	Setting range	Default value
LOW side setting value	-99.999 to 99.999	-5.000

IL-300/IL-600

Item	Setting range	Default value
LOW side setting value	-999.99 to 999.99	-50.00

IL-2000

Item	Setting range	Default value
LOW side setting value	-9999.9 to 9999.9	-500.0

After setting, press ◀ / ▶ button to return the sub display to the original display as necessary.



As soon as the HIGH side setting value and the LOW side setting value are entered, the judgment and output begin with the new setting value.

Automatic Setting (When other than step count filter)

Tolerance tuning

When the target (master workpiece) as a reference is present, the HIGH side setting value (upper limit) and LOW side setting value (lower limit) can automatically be set with the master workpiece measurement value as the center value.



When the tuning result exceeds the setting range, the limit value of the setting range is considered as the setting value.



The tolerance tuning cannot be performed when the judgment value (P.V.) is displayed as [----].

If attempting to perform, [now RL] blinks several times on the main display.

Press the ◀ / ▶ button several times on the main screen. Then display the R.V. display screen on the sub display (lower level).

☐ "Sub Display (Lower Level)" (page 3-4)



9 Measure the master workpiece and press the [SET] button.

The judgment value (P.V.) as a reference value for the tolerance setting is imported. [5£L] and the tolerance setting width are displayed alternately on the sub display (lower level).

Press ▲ / ▼ button to set the tolerance setting width.



IL-030/IL-065/IL-100


Item	Setting range	Default value
Setting width	0.000 to 99.999	0.200

IL-300/IL-600

Item	Setting range	Default value
Setting width	0.00 to 999.99	2.00

IL-2000

Item	Setting range	Default value
Setting width	0.0 to 9999.9	20.0

 

⚠ Press the [SET] button to complete the tolerance tuning.

[5EŁ] blinks on the main display (upper level), and the HIGH side setting value and LOW side setting value are determined. Then, the display returns to the R.V. screen automatically.

2 point tuning

With this method, the median value of the good target and defective target is set as the tolerance setting value when there are good target and HIGH/LOW defective target.



When the tuning result exceeds the setting range, the limit value of the setting range becomes the setting value.



Two-point tuning is not performed if the internal measurement value (R.V.) is [----].

If performed, [nguAL] will blink several times on the main display.

Press the ◀ / ▶ button several times on the main screen. Then display the HIGH side setting value on the sub display (lower level).

"Sub Display (Lower Level)" (page 3-4)



2 Measure the good target and press the [SET] button. (HIGH side 1st point confirmation operation)

The internal measurement value (R.V.) is imported as a good target measurement value. IH .5Et1 is displayed on the main display (upper level).

Measure the HIGH side defective target and press the [SET] button. (HIGH side 2nd point confirmation operation)

The internal measurement value (R.V.) is imported as a measurement value for HIGH side defective target.

After [5Et] blinks on the main display (upper level), the judgment value (P.V.) is displayed.

On the sub display (lower level), the median value of the good target value (1st point) imported on step 5 and HIGH defective target value (2nd point) is displayed. Setting the HIGH side setting value (upper limit) is complete.

Press the ▶ button once and display the LOW side setting value on the sub display (lower level).



3-14 IL-E

Measure the good target again and press the [SET] button. (LOW side 1st point confirmation operation)

The internal measurement value (R.V.) is imported as a good target measurement value.

[Lo5EL] is displayed on the main display (upper level).

Measure the LOW side defective target and press the [SET] button. (LOW side 2nd point confirmation operation)

 
The internal measurement value (R.V.) is imported as a measurement value for LOW side defective target.

After [5££] blinks on the main display (upper level), the judgment value (P.V.) is displayed.

On the sub display (lower level), the median value of the good target value (1st point) imported on step 5 and LOW defective target value (2nd point) is displayed.

Setting the LOW side setting value (lower limit) is complete.

The two-point tuning is complete.



Automatic Setting (When step count filter)

2 point tuning


When there is a standard step, 2 times the value of the step will be set as HIGH (upper limit value) and half of the value of the step will be set as LOW (lower limit value) automatically. If the step of the measured value of the upper part is A, and the measured part of the lower part of the step is B, it will be set as HIGH= $|(A-B) \times 2|$, LOW= $|(A-B) \div 2|$ If the tuning result exceeds the setting range, the setting range limit will become the setting value.




When the R.V. (Internal Measurement Value) is [----], the 2 point tuning cannot occur. If it does occur, [nauAL] will be displayed on the main screen, and the number of points will decrease. The setting value cannot be changed.

From the main screen press the ◀/ ▶ button multiple times, from the subdisplay (bottom step) the R.V. (Internal Measurement Value) display screen will appear.

 "Sub Display (Lower Level)" (page 3-4)




 Press the [SET] button at the top of the step.*1
The following screen is displayed after operation.



Change the position of the work piece, press the (SET) button at the bottom of the step.*1

 The following screen is displayed after operation.



The HIGH side setting value (upper limit value) will be set as a value double of the step, and the LOW side setting value (lower limit value) will be set as a value of half of the step.

(Example) The case below is when the upper part of the step is 5.000, the lower part of the step is 2.000.

HIGH side setting value: $|(5.000-2.000) \times 2| = 6.000$ LOW setting side value: $|(5.000-2.000) \div 2| = 1.500$

3-16 IL-E

^{*1} The upper and lower parts of 2 and 3 can be switched.

1 point tuning

When there is a measurement object (herein masterwork) that can be understood from the standard step, based on the step value (P.V.) of the masterwork, 2 times the Judgment Value HIGH side setting value (upper limit) and 1/2 of the Judgment Value LOW side setting value (lower limit) can be set automatically.


If the P.V. (Judgment Value) is A, HIGH = $|(A) \times 2|$, and LOW = $|(A) \div 2|$ will be the settings. If the tuning result surpasses the setting range, the setting value will be the setting range limit value.



When the P.V. (Judgment Value) is [----], the 1 point tuning cannot occur. If it does occur, [naufl] will be displayed on the main screen, and the number of points will decrease. The setting value cannot be changed.

 1 From the main screen press the ◀ / ▶ button multiple times, from the subdisplay (bottom step) the R.V. (Internal Measurement Value) display screen will appear.





- After the step measurement by the masterwork (after P.V. is fixed), press and hold the [SET] button.
- The HIGH side setting value (upper limit value) will be set a 2 times the value of the P.V. (Judgment Value), and the LOW side setting value (lower limit value) will be set as 1/2 of the setting value.

(Example) When the P.V. (Judgment Value) is 4000, it will be as follows.

HIGH side setting value: $|(4.000) \times 2| = 8.000$ LOW setting side value: $|(4.000) \div 2| = 2.000$

Zero Shift Function (Shifting the Internal Measurement Value (R.V.))

The internal measurement value (R.V.) is shifted (offset) to an arbitrary shift target value. The judgment value (P.V.) is shifted (offset) as well.

On a main unit using the calculation function, the calculated value (CALC value) will be shifted (offset) to the shift target value instead of R.V.

The following two methods can be used.

- Press the [ZERO SHIFT] button (within 1 second).
- · Set the external input (zero shift input) to ON for 20 ms or more.*
- * When the zero shift input is set for the external input 1 (pink wire), the zero shift is enabled when the input is triggered..
 - 11. External Input" (page 4-30)

Setting the Shift Target Value

- Press the ◀ / ▶ button several times on the main screen. To display the shift target value on the sub display (lower level).
 - "Sub Display (Lower Level)" (page 3-4)



Press ▲ / ▼ button to set the shift target value.

IL-030/IL-065/IL-100

Item	Setting range	Default value
Shift target value	-99.999 to 99.999	0.000

IL-300/IL-600

Item	Setting range	Default value
Shift target value	-999.99 to 999.99	0.00

IL-2000

Item	Setting range	Default value
Shift target value	-9999.9 to 9999.9	0.0

Press ◀ / ▶ button to return the sub display to the original screen.

3-18 IL-E

Enabling the Zero Shift

When the following operation is performed on the main screen, the zero shift indicator [ZERO SHIFT] lights up for approx. 0.5 second and the current internal measurement value (R.V.) shifts to the shift target value.

- · Press the zero shift button [ZERO SHIFT] (within 1 second).
- Turn ON the zero shift input of external input for 20 ms or more.



 When the zero shift from the external input is performed, if the power is turned OFF, the previous state before the zero shift function is restored. If you wish to keep the shifted state of the internal measurement value (R.V.) even after the power is turned OFF, set the zero shift value memory function to ON.

"13. Zero Shift Value Memory Function" (page 4-38)

 When the internal measurement value (R.V.) is [----], and "3.AVE" is [HPF], the zero shift function cannot be used. After the screen below is displayed, it will be automatically returned to the main screen.





When the zero shift is performed by pressing the zero shift button, the shifted state of the internal measurement value (R.V.) is preserved even after the power is turned off.

Canceling the Zero Shift (Reset)

When the following operation is performed on the main screen, the zero shift is canceled and the internal measurement value (R.V.) returns to the previous state (initial state) before the zero shift function is used.

• Press the zero shift button [ZERO SHIFT] for 2 seconds or more.

The following screen appears after operation.



Bank Function (Registering Multiple Tolerance Setting Values)

Using the bank function, you can register up to four patterns of specified tolerance settings. By using the bank function, each setting item registered beforehand can be switched easily.

Settings Registered with the Bank

Settings	Reference page
HIGH side setting value	"3-4 Setting the Tolerance Setting Value" (page 3-
LOW side setting value	10)
Shift target value *1	"3-5 Zero Shift Function (Shifting the Internal Measurement Value (R.V.))" (page 3-18)
Analog output free range upper limit/lower limit	"10. Analog Output Scaling" (page 4-27)

^{*1} The shifted amount when the internal measurement value (R.V.) is shifted using the zero shift function is saved in each bank. (example) Suppose the zero shift function is used with bank 0, then the unit is switched

to bank 1, and while in bank 1, the zero shift is used again. If the unit is switched back to bank 0, the zero shift associated with bank 0 is recalled.

How to Switch the Bank

The bank switching method can be done in any of the 3 fashions below.

- Front panel commands on the amplifier.
- . Use the external inputs (Bank A input, Bank B input)*
- Send command from DL-RS1A (Refer to DL-RS1A User's Manual for details)
- * If the bank switching method is set to external input, and bank A input or bank B input is set for the external input, the bank can be switched with the external input.
 - 11. External Input" (page 4-30)
 - 12. Bank Switching Method" (page 4-35)

3-20 IL-E

3-7 Key Lock Function

The key lock function prevents unwanted button operations during measurement. When the key lock function is active, operations other than switching the main screen and canceling the key lock function are disabled.

Starting the Key Lock

While pressing the [MODE] button on the main screen, press ▲ or ▼ button for 2 seconds or more.

After [Lac] blinks on the main display (upper level) for several seconds, the main screen is restored.



If buttons other than display switching button on the sub display (lower level) are operated in the key-locked state, [Lac] is displayed on the main display (upper level) and setting change operation is ignored.

Canceling the Key Lock (Unlock)

While pressing the [MODE] button, press ▲ or ▼ button for 2 seconds or more.

After [unl] blinks on the sub display (lower level) for several seconds, the main screen is restored.



MEMO

3-22 IL-E

Setting Various Functions

This chapter describes the various functions of the IL Series.

4

4-1	Setting Operations	4-2
4-2	Basic Settings and Advanced Settings	4-4
4-3	Calculation Function	4-42
4-4	Calibration Function	4-45

IL-E 4-1

 
Setting Operations

Setting Operations


This section explains functions operable on the main screen and functions operable after the display changes to each setting screen.

Functions Available on the Main Screen





Panel mount type (IL-1500/IL-1550)

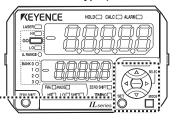

Main screen



Press ◀ or ▶ button.

Switching display on the sub display (lower level) (page 3-4)

The internal measurement value (R.V.), the analog output value, the HIGH side setting value, the LOW side setting value or Calculation value (CALC value) is displayed and the setting can be changed.

3-4 Setting the Tolerance Setting Value (page 3-10)

HIGH side setting value and LOW side setting value are set. The judgment is made among HIGH/GO/LOW, and the value is displayed and output.

3-5 Zero Shift Function (Shifting the Internal Measurement Value (R.V.)) (page 3-18)

The internal measurement value (R.V.) can be shifted (offset) to an arbitrary shift target value.

While pressing down [MODE], press ▲ or ▼ button.

3-6 Bank Function (Registering Multiple Tolerance Setting Values) (page 3-20)

HIGH side setting value, LOW side setting value, shift target value, and analog output scaling upper / lower limit value can be saved in up to four banks and switched.

Press [MODE] and ▲ buttons for approx. 2 seconds.

or

Press [MODE] and ▼ buttons for approx. 2 seconds.


3-7 Key Lock Function (page 3-21)

This function prevents unwanted button operations during measurement.

4-2 IL-E

Functions Available after the Display Changes to Each Setting Screen

Main screen

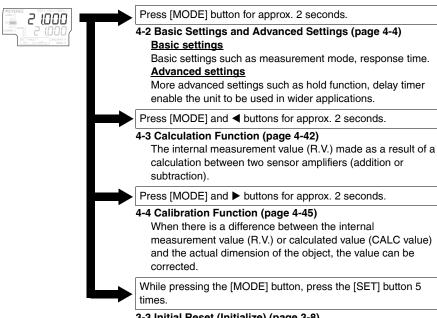

3-3 Initial Reset (Initialize) (page 3-8)

All settings, excluding the calibration function, are initialized.

IL-E 4-3

Basic Settings and Advanced Settings

List of Setting Items

The following items can be set.

Туре	Setting items	Description	Reference page
	1. Measurement direction	Set whether the display value increases or decreases when the object approaches the sensor head.	4-8
	2. Sampling rate 2. 5Pd	Set the data sampling rate. To sample at a high speed, set a faster rate, and if the incoming light level is low, set a slower rate.	4-8
Basic setting	3. Averaging rate, Step count filter, High-pass filter 3. AuE	Set the averaging for the data retrieved from the sampling rate.	4-9
5.	4. Alarm setting	Set the alarm response when the measurement range is exceeded, or when the light amount is excessive or insufficient.	4-13
	5. Output state 5. out	According to the judgment value (P.V.), select the output state (N.O./ N.C.) of judgment output ON/OFF.	4-14
	6. Hold function [5. HL d]	The hold method is set for the judgment value (P.V.).	4-15
Adv	7. Timing input	Set the timing input response used for the hold function.	4-23
Advanced setting	8. Delay timer	Set the delay timer for the judgment output.	4-23
ting	9. Hysteresis 9. Hy5	Set the hysteresis used to stabilize the judgment output.	4-26
	10. Analog output scaling	The analog output scaling for the judgment value (P.V.) is set.	4-27

IL-E 4-4

Туре	Setting items	Description	Reference page
	11. External input	Select functions of the 4 external inputs.	4-30
	12. Bank switching method	Set the bank switching method.	4-35
	13. Zero shift value memory function	Store the settings of the state of the display based on the zero shift function into the nonvolatile memory. (EEPROM)	4-38
Advanced setting	14. Interference prevention function	Set the operation of the mutual-interference prevention function.	4-38
d setting	15. Display digit	Set the displayed digits of the judgment value (P.V.), the internal measurement value (R.V.), and calculation value (CALC value).	4-39
	16. Power saving function	Select power saving options for the display.	4-40
	17. Head display mode	Select the operation of the head LED indicators.	4-40
	18. Display color	Set the color of the judgment indicator and the display color of the main display of the panel mount type amplifier (IL-1500/IL-1550).	4-41

IL-E 4-5

Setting Screen

This section describes operations and the setting screen to modify the basic settings and the detailed setting.

How to go to the setting screen

Press the [MODE] button for approx. 2 seconds on the main screen. The setting screen appears.

Basic operations on the setting screen

Changing the setting value: ▲/▼ button


Go to the next setting item: [MODE] button or ▶ button

Return to the previous setting item: ◀ button


Skip the rest of the settings and finish: Press and hold the [MODE] button for approx. 2 seconds.

Setting screen view

The setting is displayed on the main display (upper level) and the setting value is displayed on the sub display (lower level).

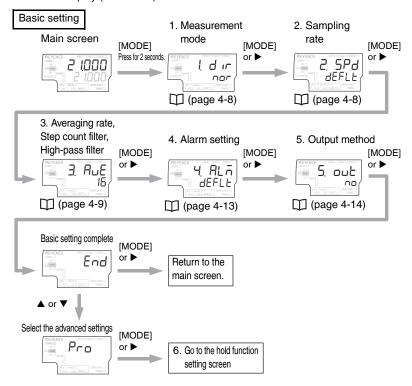

4-6

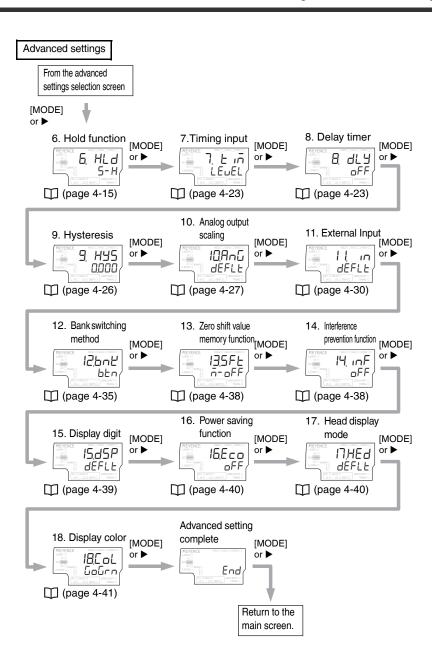

IL-E 4-7

1. Measurement Direction

ldir

Set whether the display value increases or decreases when the object approaches the sensor head.

Measurement increase/decrease direction	Description	Default value
Normal Fig.	The display value increases when the object approaches the sensor head. Display value 99.999 Measurement value	0
Reverse	The display value decreases when the object approaches the sensor head. Display value 99.999 O Measurement value	

2. Sampling Rate



Set the measurement sampling rate.

Normally the default value is used, but to sample at a faster rate, set a fast rate, and if the incoming light amount is low, set a slower rate.

Item	Setting range	
Sampling rate	dEFLE / Q33 / 1 / 2 / 5 (ms)	dEFLE

^{*} As for dEFLE, IL-030/IL-065/IL-100 is 1ms, IL-300/IL-600 is 2 ms, and IL-2000 is 5 ms.

4-8 IL-E



- When the mutual-interference prevention function is enabled, the sampling rate of the expansion unit is set equal to that of the main unit, so the sampling rate setting screen for the expansion unit is skipped.
- When the calculation function is enabled, the sampling rate of expansion unit 1 is set equal to that of the main unit, so that the sampling rate setting screen for expansion unit 1 is skipped.
 Expansion unit 2 and following, units are each set individually.
- If the data between the heads is not synchronized when using the
 calculation function or when the DL series is connected, disable
 the mutual-interference prevention function and set the main unit's
 sampling rate to a rate other than 0.33 ms. When the mutual-interference prevention function is enabled, or 0.33 ms is set, the timing for updating the main unit and expansion unit's internal data
 will not match. In this case, when measuring a moving target using
 the calculation function, the measured value may greatly differ
 from the actual value.
- When the mutual-interference prevention function is enabled, 2 ms or 5 ms cannot be set for IL-030/IL-065/IL-100, and dEFLL, 2 ms or 5 ms cannot be set for IL-300/IL-600/IL-2000.
- If the [FrE9] settings of the "3.AVE" of the [HPF] are set to 50 Hz/ 100 Hz, the IL-030/IL-065/IL-100 cannot be set to 2 ms/5 ms, and the IL-300/IL-600/IL-2000 cannot be set to dEFLE/2 ms/5 ms.
- When "3.AVE" is [diFF], 5 ms cannot be set.
- When using in an environment that greatly interferes with the beam, set 2 ms or 5 ms.

 
3. Averaging rate, Step count filter, High-pass filter



The averaging rate, the step count filter, and the high-pass filter data acquired by the sampling cycle will be set.

Averaging rate

The average value is the moving average. If the measured values fluctuate, stable measurements can be obtained by increasing the average count. Also, when selecting [d iFF], the step function, or [HPF] the High-pass filter function will be enabled.




Item	Setting range (rate)	Default value
Averaging rate	1 / 2 / 4 / 8 / 16 / 32 / 64 / 128 / 256 / 5 12 / 1024 / 2048 / 4096 / d .FF / HPF	16

IL-E 4-9

Step count filter

 Acknowledge the steps above the specified height (LOW setting value), it is the filter that does the one shot output. If the steps are acknowledged, the internal measurement value (R.V.) from the time that there is a sudden change in the + direction until that change has stopped will be the P.V. (Judgment Value). Also, the set one shot time, will make the Go decision output on, and will hold the P.V. (Judgment Value) until the next steps are acknowledged. The count and seam detection etc. is enabled. If [diFF] is selected using the setting screen of the averaging count, it will move to the setting screen of the continuous one shot time.



Item	Setting range (ms)	Default value
One-shot time	2 to 9999	10


- Use work pieces moving at 200 mm/s or more.
- Set the LO side setting value for approximately half of the desired step.
- While the timing input is ON, The P.V. (Judgment Value) will not renew. When OFF, The operation will restart using the first taken value as a standard.
- When the LO side setting is less than 0, no matter what step, the P.V. (Judgment Value) will not operate. Concerning LO side setting value settings, refer to ☐ "3-4 Setting the Tolerance Setting Value" (page 3-10)



- The change of the Internal Measurement Value (R.V.) is taken and will be the Judgment Value (P.V.). Therefore, the Judgment Value will be fixed via changes in the target value of zero shift or shift.
- Set "1. Measuring Direction" so that a change of the Internal Measurement Value (R.V.) of the step portion desired to be detected becomes a change in the plus direction.
- The sampling rate will be 5 ms and when at dEFLE, the IL-2000 cannot be set to d iFF.

▲ CAUTION


4-10

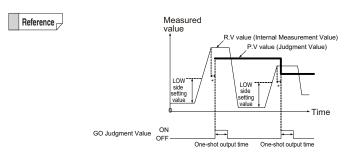


The sampling cycle is 5.5 ms when 0.33 ms, 6 ms when 5.5 ms, and 8 ms when 2 ms.

■ High-pass filter

The average value is moved and averaged. If the measured values fluctuate, stable measurements can be obtained by increasing the average number of times. When [HPF] is set, the high-pass filter will be enabled.

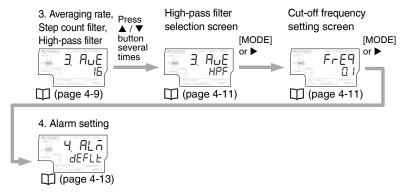

Item	Setting range (Hz)	Default value
Cut-off frequency	0,1/0,2/0,5/1/2/5/10/20/50/100	1

 

IL-E 4-11

Point

- When the mutual-interference prevention function is enabled, the averaging of the expansion units is set equal to that of the main unit, so that the averaging setting screen for expansion units is skipped. (Use of the Step counter and High-pass filter is the same)
- When the calculation function is enabled, the averaging of expansion unit 1 is set equal to that of the main unit, so that the averaging setting screen for expansion unit 1 is skipped. Expansion unit 2 and following, units are each set individually.
- If the data between the heads is not synchronized when using the
 calculation function or when the DL series is connected, set the
 number of main unit averaging to 256 times or less. If the averaging
 is set to 512 times or more, the timing for updating the main unit and
 expansion unit's internal data will not match. In this case, when
 measuring a moving target using the calculation function, the measured value may greatly differ from the actual value.
- When the sampling cycle is set to 2 ms, 5 ms at the time of the high-pass filter, a cut off frequency of 50 Hz or over cannot be selected.
- For amplifiers delivered before December 21st, 2010, [diFF2]/[HPF] cannot be selected.
- For products shipped before December 21th, 2010, that have even one amplifier, when the "14. mutual interference prevention function" is ON, [d FF]/[HPF] cannot be selected.
- When using the calculation function, [d FF] cannot be selected.
- Even if the hold function is set, it will operate as sampling hold until selected as [diFF].
- For amplifiers with the main device shipped after December 22th 2010, and those with the extension after December 21th, 2010, while using the calculation function, [d "FF]/[HPF] cannot be selected.

4-12 IL-E

4. Alarm Setting

4 ALA

The IL series cannot complete a measurement if it is outside the measurement range or if the light amount is excessive or insufficient. (If the measurement is impossible for a number of samples equal to the alarm number, "---" will appear.)

Details of operations when measurement is impossible are set with the alarm setting.

The alarm output is ON during normal measurement. It turns OFF when an alarm or error state occurs.

Setting value	Descr	Default value	
Default	When measurement is impossible, this option sets the default number of samples for which the previous normal value is held. This differs according to the set sampling rate.		0
dEFLE	Sampling rate	Sampling rate	
	0.33 ms	6 times	
	Other than 0.33 ms	7 times	
Clamp	When measurement is impossible, the previous normal value is held until measurement is restored.		
	When measurement is impossible, this option sets the number of samples for which the previous normal value is held.		
User setting	The settable range is as follows:		
<u>Ubr</u>	Setting range	Default value	
	2 to 1000 times	7 times	

^{*} If measurement is impossible immediately after powering on or immediately after reset input, the display [-----] is held.



- If the default or user setting is selected and measurement remains impossible after the number of alarms, the measured value is displayed as [----]. This is called the alarm state.
- When the amplifier is in alarm state and valid measurement values are obtained for a number of samples equal to the averaging value + 2, the amplifier recovers from the alarm state and displays the measured value.
- If measurement is restored not later than the number of sampling times specified for the default or user setting, the hold function is cancelled.
- The alarm output after power up or reset input is ON until the amplifier recognizes an unmeasurable state even if [----] is displayed.
- The alarm output is turned ON once a reset is executed in response to reset input.
- The alarm output operates as a normally closed contact irrespective of how the output method is changed ("5. Output State" (page 4-14)).
- · The alarm output is not held by timing input.

IL-E 4-13

5. Output State

5. out

According to the judgment value (P.V.), set the output state (N.O./N.C.) of judgment output ON/OFF and edge check output.

Item	Setting range	Default value
Output state	no (Normally Open), n∈ (Normally Closed)	no

There are three judgment outputs as below.

- HIGH judgment output (Black wire)
- GO judgment output (Gray wire)
- LOW judgment output (White wire)

The judgment output is turned ON/OFF as below according to the tolerance setting value.

"3-4 Setting the Tolerance Setting Value" (page 3-10)

When Normally Open is set

Judgment	Judgment output			
Juaginent	HIGH	GO	LOW	
HIGH	ON	OFF	OFF	
GO	OFF	ON	OFF	
LOW	OFF	OFF	ON	
Error*1	ON	OFF	ON	
""*2	OFF	OFF	OFF	

When Normally Closed is set

Judgment	Judgment output		
Juagment	HIGH	GO	LOW
HIGH	OFF	ON	ON
GO	ON	OFF	ON
LOW	ON	ON	OFF
Error*1	OFF	ON	OFF
""*2	ON	ON	ON

Reference -

Regardless of the output state setting, the judgment indicator on the sensor amplifier interlocks the judgment output when Normally Open is set.

"3-4 Setting the Tolerance Setting Value" (page 3-10)

The following is the default state of the judgment indicator. The lighting status can be changed in the items for "18. Display Color".

118. Display Color" (page 4-41)

Judgment	Judgment output			
Judgillelli	HIGH	GO	LOW	
HIGH	Red	OFF	OFF	
GO	OFF	Green	OFF	
LOW	OFF	OFF	Red	
Error	Red	OFF	Red	
""	OFF	OFF	OFF	

4-14

^{*2} When the judgment value (P.V.) is "----".

6. Hold Function

6. HLd

The holding method is set for the judgment value (P.V.).

Functions other than "Auto peak hold" and "Auto bottom hold" require the use of the external input (timing input).

NOTICE

When functions other than "Auto peak hold" and "Auto bottom hold" are set, assign external input 3 (pink/purple wire) to the timing input.

11. External Input" (page 4-30)

Reference -

 While the judgment value (P.V.) is held, the hold indicator on the sensor amplifier lights up.



Hold Function	Description	Default value
Sample hold	When the timing input is turned ON, the judgment value (P.V.) is held. I Sample hold" (page 4-16)	0
Peak hold	The maximum value of the specified period (sampling period) is held as the judgment value (P.V.). "Peak hold" (page 4-17)	
Bottom hold	The minimum value of the specified period (sampling period) is held as the judgment value (P.V.). "Bottom hold" (page 4-18)	
Peak-to-peak hold	The difference between the maximum value and minimum value of the specified period (sampling period) is held as the judgment value (P.V.). "Peak-to-peak hold" (page 4-19)	
Auto peak hold	According to the specified trigger level, the maximum value sampled is held as a judgment value (P.V.). The external input is not required. "Auto peak hold" (page 4-21)	
Auto bottom hold	According to the specified trigger level, the minimum value sampled is held as a judgment value (P.V.). The external input is not required. "Auto bottom hold" (page 4-22)	

 
IL-E 4-15

Sample hold 5-8

When the timing input is turned ON, the judgment value (P.V.) is held.


■ When "Level" is set for "7. Timing Input" (page 4-23)

The judgment value (P.V.) is held only while the timing input is ON.



- *1 The main unit (IL-1000/IL-1500) displays the calculation value (CALC value) when the calculation function is used.
 - "4-3 Calculation Function" (page 4-42)
- When "Edge" is set for "7. Timing Input" (page 4-23)

The judgment value (P.V.) is held while the timing input is ON.

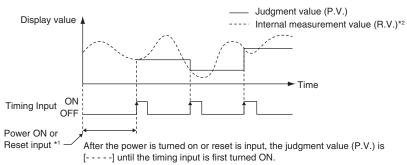

- *1 11. External Input" (page 4-30)
- *2 The main unit (IL-1000/IL-1500) displays the calculation value (CALC value) when the calculation function is used.
 - "4-3 Calculation Function" (page 4-42)


4-16

Peak hold

The maximum value of the specified period (sampling period) is held as a judgment value (P.V.).

■ When "Level" is set for "7. Timing Input" (page 4-23)


The sampling period is from the falling edge of the timing input to the next rising edge. On the rising edge, the internal measurement value (R.V.) maximized during the sampling period is held as a judgment value. When the timing input is turned OFF, the next sampling period begins.

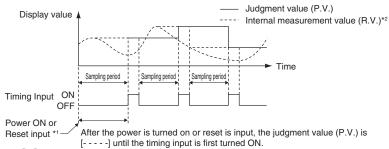

- *1 🔲 "11. External Input" (page 4-30)
- *2 The main unit (IL-1000/IL-1500) displays the calculation value (CALC value) when the calculation function is used.
 - "4-3 Calculation Function" (page 4-42)
- *3 If the R.V. value (or CALC value) causes an alarm even once during the sampling period, the hold results will be "-----".

■ When "Edge" is set for "7. Timing Input" (page 4-23)

The sampling period is from the rising edge of the timing input to the next rising edge of the timing input. On the rising edge, the internal measurement value (R.V.) maximized during the sampling period is held as a judgment value. When the timing input is turned ON, the next sampling period has already begun.

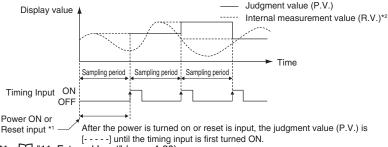


- *2 The main unit (IL-1000/IL-1500) displays the calculation value (CALC value) when the calculation function is used.
 - 1 "4-3 Calculation Function" (page 4-42)
- *3 If the R.V. value (or CALC value) causes an alarm even once during the sampling period, the hold results will be "----".

Bottom hold 5-8

The minimum value of the specified period (sampling period) is held as a judgment value (P.V.).

■ When "Level" is set for "7. Timing Input" (page 4-23)


The sampling period is from the falling edge of the timing input to the next rising edge. On the rising edge, the internal measurement value (R.V.) minimized during the sampling period is held as a judgment value. When the timing input is turned OFF, the next sampling period begins.

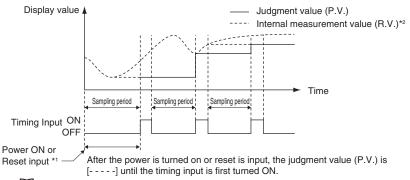

- *1 III "11. External Input" (page 4-30)
- *2 The main unit (IL-1000/IL-1500) displays the calculation value (CALC value) when the calculation function is used.
 - "4-3 Calculation Function" (page 4-42)
- *3 If the R.V. value (or CALC value) causes an alarm even once during the sampling period, the hold results will be "-----".

■ When "Edge" is set for "7. Timing Input" (page 4-23)

The sampling period is from the rising edge of the timing input to the next rising edge of the timing input. On the rising edge, the internal measurement value (R.V.) minimized during the sampling period is held as a judgment value. When the timing input is turned ON, the next sampling period has already begun.

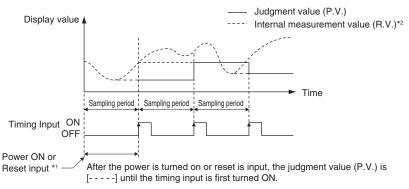

4-18 IL-E

- *1 | "11. External Input" (page 4-30)
- *2 The main unit (IL-1000/IL-1500) displays the calculation value (CALC value) when the calculation function is used.

 ["4-3 Calculation Function" (page 4-42)
- *3 If the R.V. value (or CALC value) causes an alarm even once during the sampling period, the hold results will be "----".


Peak-to-peak hold

P-P

The difference between the maximum value and minimum value of the specified period (sampling period) is held as a judgment value (P.V.).

■ When "Level" is set for "7. Timing Input" (page 4-23)


The sampling period is from the falling edge of the timing input to the next rising edge. On the rising edge, the difference between the maximum value and minimum value of the internal measurement value (R.V.) during the sampling period is held as a judgment value (P.V.). When the timing input is turned OFF, the next sampling period begins.

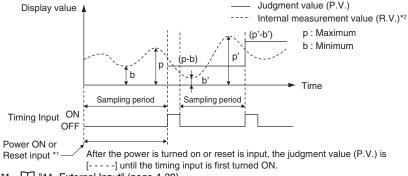

- *1 III "11. External Input" (page 4-30)
- *2 The main unit (IL-1000/IL-1500) displays the calculation value (CALC value) when the calculation function is used.
 - "4-3 Calculation Function" (page 4-42)
- *3 If the R.V. value (or CALC value) causes an alarm even once during the sampling period, the hold results will be "----".

■ When "Edge" is set for "7. Timing Input" (page 4-23)

The sampling period is from the rising edge of the timing input to the next rising edge of the timing input. On the rising edge, the difference between the maximum value and minimum value of the internal measurement value (R.V.) during the sampling period is held as a judgment value (P.V.). When the timing input is turned ON, the next sampling period has already begun.

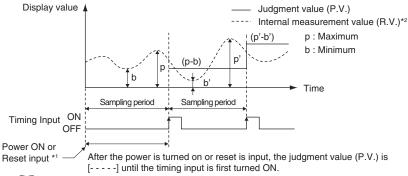

- *1 III "11. External Input" (page 4-30)
- *2 The main unit (IL-1000/IL-1500) displays the calculation value (CALC value) when the calculation function is used.
 - "4-3 Calculation Function" (page 4-42)
- *3 If the R.V. value (or CALC value) causes an alarm even once during the sampling period, the hold results will be "----".


4-20 IL-E

Auto peak hold



When the internal measurement value (R.V.) goes beyond the specified trigger level, the sampling begins. When it falls below the trigger level, the sampling finishes. When the sampling finishes, the maximum internal measurement value (R.V.) during the sampling period is held as a judgment value (P.V.).

The external input is not required.

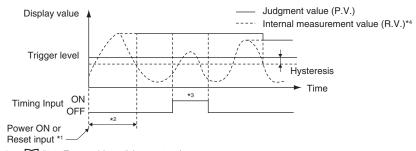

- *1 III "11. External Input" (page 4-30)
- *2 After the power is turned on or reset is input, the judgment value (P.V.) is [----] until the judgment value (P.V.) is first held.
- *3 While the timing input is ON, the sampling does not start. If the sampling is already in process, it continues.
- *4 The main unit (IL-1000/IL-1500) displays the calculation value (CALC value) when the calculation function is used.

"4-3 Calculation Function" (page 4-42)



- The operation by the timing input is the same regardless of the "7. Timing Input" (page 4-23) setting.
- After the sampling starts, if the internal measurement value (R.V.) becomes "-----" before the sampling falls below the specified trigger level, the sampling is automatically finished and the maximized value during the sampling period is held as a judgment value (P.V.).

■ Trigger level setting screen

When the auto peak hold is set, the display goes to the trigger level setting screen.



Press ▲ / ▼ button on the trigger level setting screen to specify the trigger level.

/IL-030/IL-065/IL-100

Item	Setting range	Default value
Trigger level	-99.999 to 99.999	1.000

IL-300/IL-600

Item	Setting range	Default value
Trigger level	-999.99 to 999.99	10.00

IL-2000

Item	Setting range	Default value
Trigger level	-9999.9 to 9999.9	100.0

Reference


The hysteresis presents the same value as the one set for "9. Hysteresis" (page 4-26).

Auto bottom hold

Rubab

When the internal measurement value (R.V.) falls below the specified trigger level, the sampling begins. When it goes beyond the trigger level, the sampling finishes. When the sampling finishes, the internal measurement value (R.V.) minimized during the sampling period is held as a judgment value (P.V.).

The external input is not required.

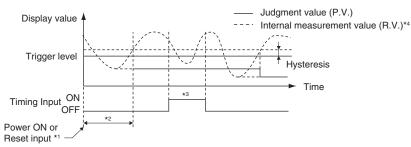

- *1 III "11. External Input" (page 4-30)
- *2 After the power is turned on or reset is input, the judgment value (P.V.) is [----] until the judgment value (P.V.) is first held.
- *3 While the timing input is ON, the sampling does not start. If the sampling is already in process, it continues.
- *4 The main unit (IL-1000/IL-1500) displays the calculation value (CALC value) when the calculation function is used.
 - "4-3 Calculation Function" (page 4-42)

Reference

- The operation by the timing input is the same regardless of the "7. Timing Input" (page 4-23) setting.
- After the sampling starts, if the internal measurement value (R.V.) becomes "-----" before the sampling goes beyond the specified trigger level, the sampling is automatically finished and the minimized value during the sampling period is held as a judgment value (P.V.).

■ Trigger level setting screen

When the Auto bottom hold is set, the display goes to the trigger level setting screen.



Press ▲ / ▼ button on the trigger level setting screen to specify the trigger level.

IL-030/IL-065/IL-100

Item	Setting range	Default value
Trigger level	-99.999 to 99.999	1.000

IL-300/IL-600

Item	Setting range	Default value
Trigger level	-999.99 to 999.99	10.00

4-22 IL-E

IL-2000

Item	Setting range	Default value
Trigger level	-9999.9 to 9999.9	100.0

Reference

The hysteresis presents the same value as the one set for "9. Hysteresis" (page 4-26).

7. Timing Input

. П Э.

The external input (timing input) operation used for "6. Hold Function" (page 4-15) is set. If "Auto peak hold" or "Auto bottom hold" is set, this item is skipped.

Item	Setting range	Default value
Timing Input	LEUEL (Level), EdGE (Edge)	LEUEL

For details, refer to the "6. Hold Function" (page 4-15).

8. Delay Timer



The delay timer for the judgment output is set.

There are three judgment outputs as below.

- HIGH judgment output (Black wire)
- GO judgment output (Gray wire)
- LOW judgment output (White wire)

The judgment output is turned ON/OFF according to the tolerance setting value and the output state settings.

- "3-4 Setting the Tolerance Setting Value" (page 3-10)
- 5. Output State" (page 4-14)

Delay Timer	Description	Default value
Delay timer off	The delay timer is not used.	0
ON-delay timer	Time required to change the GO judgment output operation from OFF to ON is delayed for specified time set on the timer.	
OFF-delay timer	Time required to change the GO judgment output operation from ON to OFF is delayed for specified time set on the timer. Toff-delay timer (page 4-25)	
1-shot timer	When GO judgment output is turned ON, if the specified time elapses, GO judgment output is automatically turned OFF. "1-shot timer" (page 4-25)	


Timing chart



- The following are the timing charts when the output state of judgment output is Normally Open (default value). ON/OFF is reversed for Normally Close.
- — "5. Output State" (page 4-14)
- The hysteresis is not taken into account in the following timing charts.
 Note that the hysteresis affects the ON/OFF timing of the actual judgment output.
- 🔲 "9. Hysteresis" (page 4-26)


■ Delay timer off

The delay timer is not used.

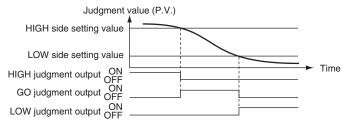

■ ON-delay timer


Time required to change the GO judgment output operation from OFF to ON is delayed for specified time set on the timer. Also, time required to change the HIGH judgment output and LOW judgment output operations from ON to OFF is delayed.

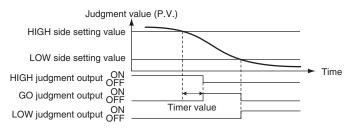

4-24 IL-E


■ OFF-delay timer

Time required to change the GO judgment output operation from ON to OFF is delayed for specified time set on the timer. Also, time required to change the HIGH judgment output and LOW judgment output operations from OFF to ON is delayed.

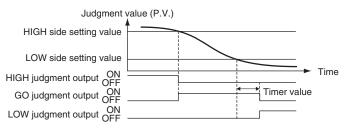


■ 1-shot timer

When the GO judgment output is turned ON, if the specified time set on the timer elapses, the GO judgment output is forcibly turned OFF. The HIGH judgment output and the LOW judgment output are not turned ON.

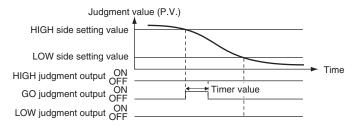

Timer setting screen

 When the timer settings other than the Delay timers off are set, the display goes to the timer setting screen. (When the Delay timer off is set, this screen is skipped.)



Press ▲ / ▼ button on the timer setting screen to specify the timer.

Item	Setting range	Default value
Timer value	5 to 9999 (ms)	60

9. Hysteresis

9. HYS

The hysteresis for the tolerance setting value is set.

If the judgment value (P.V.) fluctuates due to the vibration of the object, etc. and the judgment output repeats ON/OFF, increasing the hysteresis value stabilizes ON/OFF.

"3-4 Setting the Tolerance Setting Value" (page 3-10)

IL-030/L-065/IL-100


Item	Setting range	Default value
Hysteresis	0.000 to 99.999	0.000

IL-300/IL-600

Item	Setting range	Default value
Hysteresis	0.00 to 999.99	0.00

IL-2000

Item	Setting range	Default value
Hysteresis	0.0 to 9999.9	0.0

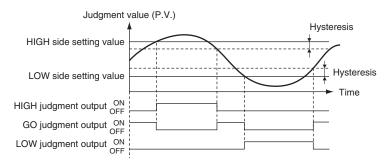

Reference _

The above is the timing chart when the output state of judgment output is Normally Open (default value). ON/OFF is reversed for Normally Close.

☐ "5. Output State" (page 4-14)

4-26 IL-E

10. Analog Output Scaling

10An5

The analog output scaling for the judgment value (P.V.) is set. If the analog output is set to no output, this screen is skipped.


- "3-1 Operation When the Power is Turned on for the First Time" (page 3-2)
- "3-3 Initial Reset (Initialize)" (page 3-8)

Analog output	Description	Default value
Default setting	Scaling is not performed.	0
dEFLE		
Free range	Scaling is performed. The analog output range can be	
F-88	changed by specifying the upper limit and lower limit of the judgment value (P.V.).	
Bank	A different scaling is provided for each bank. The analog	
bRnY	output range can be changed by designating an upper limit and lower limit for each bank.	

Example 1: Lower limit < Upper limit (Analog output 1 to 5 V)

 Example 2: Lower limit > Upper limit (Analog output 1 to 5 V)





Reference

If Upper limit = Lower limit is set, the analog output is output as below. Judgment value (P.V.) \leq Upper limit. Analog output lower limit (When 1 to 5 V \rightarrow 1 V) Judgment value (P.V.) > Upper limit. Analog output upper limit (When 1 to 5 V \rightarrow 5 V)

■ Relation of voltage and analog output in default state (dEFLL)

Model	Upper limit	Lower limit
IL-030	5.000	- 5.000
IL-065	10.000	- 10.000
IL-100	20.000	- 20.000
IL-300	140.00	- 140.00
IL-600	400.00	- 400.00
IL-2000	1000.0	-1000.0


The upper and lower limits for the different selections of analog outputs are as follows.

Analog setting	Output upper limit	Output lower limit
OFF	Not o	output
0-5u	5 V	0 V
-5-5u	5 V	- 5 V
1-5 ₀	5 V	1 V
RōPr	20 mA	4 mA

Upper limit setting screen and lower limit setting screen


When set to the default state [dEFLL], the following screens will be skipped. When set to free range or bank, the upper limit setting and lower limit setting screens will appear.

 ■ For free range (FrEE)



Press ▲ / ▼ button on each setting screen to specify the upper limit and the lower limit.

■ For bank (bflnt)

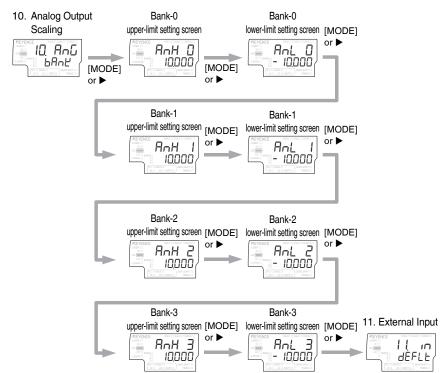

Press ▲/▼ button on each setting screen to specify the upper limit and the lower limit.

4-28 IL-E

■ Setting range for analog output scaling

If free range or bank is selected for the analog output scaling state, the upper limit and lower limit can be set within the range shown below.

IL-030/IL-065/IL-100

Item	Setting range	Default value
Upper limit	-99.999 to 99.999	10.000
Lower limit	-99.999 to 99.999	-10.000

IL-300/IL-600

Item	Setting range	Default value
Upper limit	-999.99 to 999.99	100.00
Lower limit	-999.99 to 999.99	-100.00

IL-2000

	Item	Setting range	Default value
Upp	er limit	-9999.9 to 9999.9	1000.0
Low	er limit	-9999.9 to 9999.9	-1000.0

Analog Output Accuracy

The analog output can be selected from \pm 5 V, 1-5 V, 0-5 V or 4-20 mA.

	Voltage output	Current output
Output range	± 5 V (Full scale 10 V)	4 - 20 mA (Full scale 16 mA)
Output resistance	100 Ω	-
Maximum load resistance	-	350 Ω
Repeatability	± 1 mV	± 1.5 μA
Accuracy in respect to display	± 0.05% of F.S.	± 0.25% of F.S.
Temperature characteristics	± 0.005% of F.S./°C	± 0.01% of F.S./°C
Refresh rate*1	Same as sensor head sampling rate	

^{*1} The averaging is as follows after 512 times.

512 times: Sampling rate x 2 1024 times: Sampling rate x 4 2048 times: Sampling rate x 8 4096 times: Sampling rate x 16

11. External Input

11 in


You can select functions to be assigned to four external inputs (External input 1 to 4).

"Power/Input-output cable" (page 2-7)

External Input	Description	Default value
Default setting	Functions for the external inputs remain the same as the factory default setting.	0
User setting	Functions for the external inputs are changed from the factory default setting.	

External input setting screen

When the user setting is set, each function of the external input 1 to 4 can be set. Functions that can be set differ for each external input. (When the default is set, these four screens are skipped.)

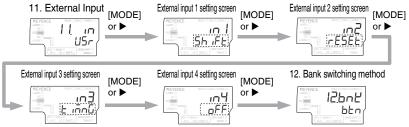

Press ▲ / ▼ button on each setting screen to specify functions.

External Input 1 (Pink wire)

Setting value	Description	Default value
5h iFt	Zero shift input	0
bnĽ-R	Bank A input	
Ե ∩Ľ-Ь	Bank B input	
L-SEP	Laser emission stop input	
oFF	Not use	

External Input 2 (Yellow wire)

Setting value	Description	Default value
rESEŁ	Reset input	0
bot-8	Bank A input	
Puf-P	Bank B input	
L-SEP	Laser emission stop input	
off	Not use	

External input 3 (Pink/Purple wire)

Setting value	Description	Default value
ב והֿח9	Timing Input	0
b∩Ľ-A	Bank A input	
Puf-P	Bank B input	
L-off	Laser emission stop input	
oFF	Not use	

External Input 4 (Purple wire)

Setting value	Description	Default value
oFF	Not use	0
bot-8	Bank A input	
Ե ∩Է- Ե	Bank B input	
L-SEP	Laser emission stop input	

Reference

When the same function is selected for multiple external inputs, if any are ON, ON (OR operation) works.

4-30 IL-E

 
Zero shift input

Sh iFE

When the zero shift input is set to ON, the internal measurement value (R.V.) is shifted (offset) to an arbitrary shift target value.

"3-5 Zero Shift Function (Shifting the Internal Measurement Value (R.V.))" (page 3-18)

■ Timing chart



■ Minimum Input Time

ON time: 20 ms OFF time: 20 ms


Reset input

r858b

When the reset input is turned ON while using the hold function, the judgment value (P.V.) in the held state is canceled and the value becomes [-----].

"6. Hold Function" (page 4-15)

■ Timing chart

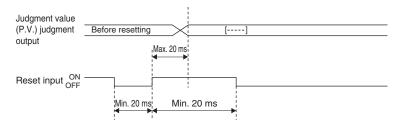

■ Minimum Input Time

ON time: 20 ms OFF time: 20 ms

Timing Input




When the timing input is turned ON while using the hold function, the judgment value (P.V.) is held.

1 "6. Hold Function" (page 4-15)


■ Timing chart

When Sample hold is set

"7. Timing Input" (page 4-23) setting: "Level"

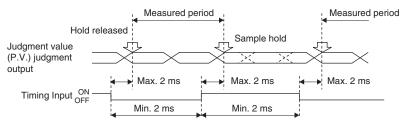

 
"7. Timing Input" (page 4-23) setting: "Edge"




4-32 IL-E

When Peak hold, Bottom hold or Peak-to-peak hold is set

 
"7. Timing Input" (page 4-23) setting: "Level"



"7. Timing Input" (page 4-23) setting: "Edge"

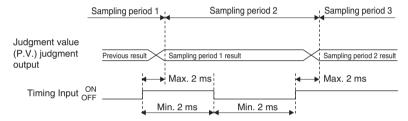

 When Auto peak hold or Auto bottom hold is set



■ Minimum Input Time

ON time: 2 ms OFF time: 2 ms


Bank A input/Bank B input

6-Y-8 6-Y-6

By combining ON/OFF setting of bank A input and bank B input, you can switch the banks.

- "3-6 Bank Function (Registering Multiple Tolerance Setting Values)" (page 3-20)
- 12. Bank Switching Method" (page 4-35)

Timing chart

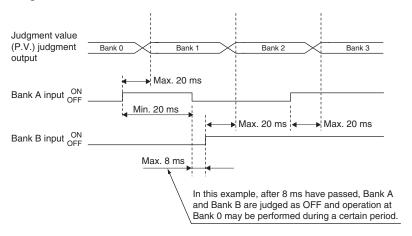

Reference -

When the judgment value (P.V.) is held using the hold function, the judgment value (P.V.) remains held even if ON/OFF for bank A input or bank B input is switched. However, the judgment output changes according to the setting value set for the new bank.

1 "6. Hold Function" (page 4-15)

■ Minimum Input Time

ON time: 20 ms OFF time: 20 ms

4-34 IL-E

Laser emission stop input

L-5EP

The laser emission remains interrupted while the laser emission stop input is ON. The laser emission indicator on the sensor amplifier lights off while the laser emission is stopped.

 
"Amplifier control unit" (page 1-6)

Reference

Measurements are disabled while the laser emission is stopped. R.V. is determined by the alarm process.

"2 Display Screen and Output" (page A-8)

Timing chart



■ Minimum Input Time

ON time: 2 ms OFF time: 2 ms

12. Bank Switching Method

12,6nE


Set whether to switch the bank with the amplifier buttons or with external inputs.

Setting	Description	Default value
Switching with buttons	The banks are switched by operating the amplifier buttons.	0
Switching with external input	The banks are switched only by turning ON/OFF the bank A input or bank B input set in "11. External input".	

^{*} If switching with buttons is selected, the bank can be switched only with the buttons. If switching with external input is selected, the bank can be switched only from the external input cable.

Switching the bank with button operations

Press the ▲/▼ button while holding down the [MODE] button on the main screen. The bank will switch, and the bank indicator [BANK0 to 3] will light according to the selected bank.

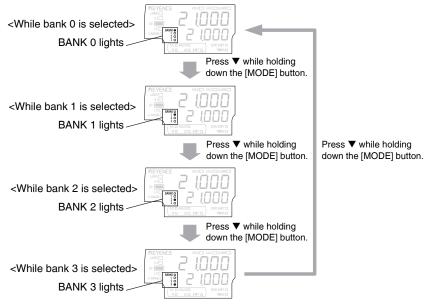

Reference

- If the
 <u>has button</u> button is pressed while holding down the [MODE] button, the
 banks will change in the reverse direction.
- The banks cannot be switched with buttons if the bank switching method is set to external input. If the banks are switched with buttons, the following is displayed.



4-36

Switching the bank by the external input

When the Bank A input and Bank B input are set for the external inputs, the bank can be switched using the external inputs.

- "11. External Input" (page 4-30)
- "12. Bank Switching Method" (page 4-35)

1 The banks are switched with the ON/OFF combination of the bank A input and bank B input.

- The bank input must be held 20 ms or longer.
- 11. External Input" (page 4-30)
- The combinations of bank A input and bank B input are shown in the following table.

Bank	Bank A input	Bank B input
Bank 0	OFF	OFF
Bank 1	ON	OFF
Bank 2	OFF	ON
Bank 3	ON	ON

ON: Short-circuited

OFF: Open

Reference -

If the external input is not set to bank A or bank B, it is regarded as OFF. (Example) If only Bank A input is set for the external input, only two patterns (bank 0 and bank 1) can be switched using the external input.

2 The bank switching method is switched from button input to external input.

"12. Bank Switching Method" (page 4-35)

13. Zero Shift Value Memory Function

13.5FL

When the zero shift is performed with the external input, make the setting for the nonvolatile memory (EEPROM) to save the shifted status.

When the zero shift is performed with the sensor amplifier button operation, it is saved on the nonvolatile memory (EEPROM) regardless of the setting.

"3-5 Zero Shift Function (Shifting the Internal Measurement Value (R.V.))" (page 3-18)



If the data is written in the nonvolatile memory (EEPROM) over 1 million times, the error message is displayed and the setting may not be saved any more. (It is still possible to obtain a measurement value.)

"Error Displays and Corrective Actions" (page A-4)

For such cases as the zero shift occurring frequently from the PLC, and, it is not necessary to store it in the nonvolatile memory (EEPROM), it is recommended to set it as OFF.

Saving the Standard Waveform	Description	Default value
OFF N-OFF	Not save on the nonvolatile memory (EEPROM)	0
ON	Save on the nonvolatile memory (EEPROM)	

14. Interference Prevention Function (Only for IL-1000/1500)

This function allows the amplifier to prevent the mutual interference caused by light interaction between sensor heads.

If the "mutual-interference prevention function setting" is ON, the function is effective between adjacent amplifiers.

When set to OFF, the laser emission timing is synchronized if the sampling rate is the same within "(number of amplifiers - 1) x 5 µs".

"3. Averaging rate, Step count filter, High-pass filter" (page 4-9)

When the expansion units are not installed, this screen is skipped.

4-38



- If the data between the heads is not synchronized when using the calculation function or when the DL series is connected, disable the mutual-interference prevention function and set the main unit's sampling rate to a rate other than 0.33 ms. When the mutual-interference prevention function is enabled, or 0.33 ms is set, the timing for updating the main unit and expansion unit's internal data will not match. In this case, when measuring a moving target using the calculation function, the measured value may greatly differ from the actual value.
- The timing cannot be synchronized for the following time after the power has been turned ON and after the interference prevention setting has been changed.

When sampling rate is 0.33 ms/1 ms/2 ms : 3 seconds When sampling rate is 5 ms : 15 seconds

"4-3 Calculation Function" (page 4-42)

- The screen is skipped if the sampling rate is set to 2 ms or 5 ms for IL-030/IL-065/IL-100, and dEFLE, 2 ms or 5 is set for IL-300/IL-600/ IL-2000.
- Skipped if there is no expansion unit or if expansion unit 1 is not an IL Series unit.
- For those items with even one amplifier included and shipped before December 21th, 2010, when the "3.AVE" settings of the main unit are [d iFF]/[HPF], the screen will be skipped.

Interference prevention	Description	Default value
off off	Interference prevention function OFF	0
ON	Interference prevention function ON	

^{*} When the mutual-interference prevention function is ON, the expansion unit's sampling rate and number of average times are the same as the main unit settings.

15. Display Digit

<u> 1575P</u>

The number of digits of the judgment value (P.V.), the internal measurement value (R.V.) or the calculation value (CALC value) displayed on the sensor amplifier is set.

Display Digit	Description	Default value
dEFLE	A different value is displayed for each head.*1	0
0.00 1	3 decimal places ^{*2 *3}	
0.0 1	Truncate the 3rd decimal place*3	
0.1	Truncate the 2nd decimal place	
1	Truncate the 1st decimal place	

- *1 The 7 segment inscription of [dEFLt] is IL-030/IL-065/IL-100: 0.01, IL-300/IL-600: 0.1, and IL-2000: 1.
- *2 This cannot be set under IL-300/IL-600/IL-2000.
- *3 This cannot be set under IL-2000.

16. Power Saving Function

16.Eco

When no buttons are pressed for more than one minute, the power saving function is activated with the sensor amplifier.

The power saving function is activated as soon as the setting is complete. The normal display is restored by pressing any of the buttons.

Power save function	Sensor Amplifier	Default value
off off	Normally ON	0
Half	Animation display ^{*1}	
AII R <u>!</u> !	All OFF	

^{*1} Only one segment (horizontal bar in the center) on the main display (upper) flashes, moving in order on the display from right to left. Also, the sub display indicator turns off.



17. Head Display Mode

ПНЕН

The display status of the sensor head is set.


Head display mode	Item Description		Default value
	(1) Reference distance indicator	Lights near the center of the measurement range.	
Normal display mode	(2) Analog range indicator	Lights when in the range of the analog output.*1	0
<u>ocrte</u>	(3) Laser radiation emission indicator	Lights while the laser is being emitted, and blinks when stopped.	
Judgment status display mode	(1) Reference distance indicator	During GO judgment: Green LED turns ON ² During HI, LOW, Err: Red LED turns ON ² Judgment standby status: OFF	
	(2) Analog range indicator	Always OFF	-
	(3) Laser radiation emission indicator	Lights while the laser is being emitted, and blinks when stopped.	
	(1) Reference distance indicator	Always OFF	
OFF _ C C	(2) Analog range indicator	Always OFF	
oFF	(3) Laser radiation emission indicator	Lights while the laser is being emitted, and blinks when stopped.	

4-40

Near measurement center

 $\begin{array}{l} IL\text{-}030:30~\text{mm}\pm0.25~\text{mm} \\ IL\text{-}065:65~\text{mm}\pm0.5~\text{mm} \\ IL\text{-}100:100~\text{mm}\pm1~\text{mm} \\ IL\text{-}300:300~\text{mm}\pm7~\text{mm} \end{array}$

 IL-600 : 600 mm ± 20 mm IL-2000: 2000 mm ± 50 mm



*1 When the analog output of the main unit is set to OFF, or the expansion unit is operating, the indicator turns on if the following distances are detected.

IL-030: 30 ± 5 mm IL-065: 65 ± 10 mm

IL-100: 100 ± 20 mm

IL-300: 300 ± 140 mm

IL-600: 600 ± 400 mm

IL-2000: 2000 mm ± 1000 mm

- *2 If GO is set to red with "18. Display color", the green LED and red LED lighting methods will be reversed.
- *3 The position of the display light (CENTER/A.RANGE) of the IL-2000 is different from that of above.

18. Display Color



The LED color of the judgment indicator is set. The display color for the main display (upper part) can be set at the same time only for the panel mount type amplifier (IL-1500/IL-1550).

"3-4 Setting the Tolerance Setting Value" (page 3-10)

Display color	DIN rail mount type (IL-1000/1050)	Panel mount type (IL-1500/IL-1550)		Default value
	Judgment indicator	Judgment indicator	Main display	value
GO Green	HI: Red GO: Green	HI: Red GO: Green	GO: Green,	0
GoGra	LO: Red	LO: Red	otherwise: Red	O
GO Red	HI: Green	HI: Green	GO: Red, otherwise:	
SorEd	GO: Red	GO: Red	Green	
	LO: Green	LO: Green	0.00	
Always Red	HI: Red	HI: Red		
_ I I	GO: Red	GO: Red	Always Red display	
	LO: Red	LO: Red		

Calculation Function

The internal measurement value (R.V.) for the "main unit" and the "expansion unit additionally installed next to the main unit (referred to as expansion unit 1)" can be calculated (addition or subtraction).

If there is more than one expansion unit, the calculation function can be used between the "main unit" and the "expansion unit 1" only.

There are two calculation modes for the calculation function.

- Addition Mode
- Subtraction Mode



- When using the calculation function, the setting of the averaging of expansion unit and sampling rate will be changed to the same setting as the main unit.
- 2. If the sampling rate is set to 0.33 ms or if the interference prevention function is ON, the timing for updating the main unit and expansion unit's internal data will not match. In this case, when measuring a moving target using the calculation function, the measured value may be greatly differ from the actual value.

Calculation Value (CALC value)

The calculation result of the internal measurement value (R.V.) for the "main unit" and the "expansion unit 1" is referred to as calculation value (CALC value).

The "main unit" operates with the calculation value (CALC value) considered as a judgment value (P.V.).

The "expansion unit 1" operates with its internal measurement value (R.V.) considered as a judgment value (P.V.).



- The calculation value (CALC value) can be displayed on the sub display (lower level) on the main unit.
 - "Sub Display (Lower Level)" (page 3-4)
- When the hold function is used, the calculation value (CALC value) is not held
 - ☐ "6. Hold Function" (page 4-15)

The calculation function cannot be used when a mixture of units from the following groups is used: IL-030/IL-065/IL-100. IL-300/IL-600. and IL-2000.

The calculation function can be used when a combination of units from within each of the following groups is used: IL-030/IL-065/IL-100 and IL-300/IL-600. The calculation function can also be used when multiple IL-2000s are used in combination.

4-42 IL-E

 
Addition Mode

In the addition mode, the added value of the internal measurement value (R.V.) for the "main unit (A)" and the "expansion unit 1 (B)" is considered as the calculation value (CALC value).

Calculation value = (A's R.V.) + (B's R.V.)

The thickness or width of a large object that cannot be measured with the measurement range of one sensor head can be measured.

Setting example 1



If the zero shift function is used, the actual diameter or width of the object can be displayed as a calculation value (CALC value).


"3-5 Zero Shift Function (Shifting the Internal Measurement Value (R.V.))" (page 3-18)

Subtraction Mode

In the subtraction mode, the value obtained by subtracting the internal measurement value (R.V.) for the "expansion unit 1 (B)" from the internal measurement value (R.V.) for the "main unit (A)" is considered as the calculation value (CALC value).

Calculation value = (A's R.V.) - (B's R.V.)

Setting example 1

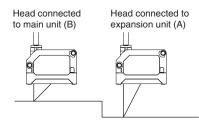

If the zero shift function is used, the actual levels of the object can be displayed as a judgment value (P.V.).

"3-5 Zero Shift Function (Shifting the Internal Measurement Value (R.V.))" (page 3-18)

Setting Method (Only Main Unit)

Main screen



Press [MODE] +

◀ button
2 seconds or more
at the same time









Main screen



Press [MODE] button and ◀ button for approx. 2 seconds on the main screen at the same time.

[20.ERL] is displayed on the main display (upper level).

Press ▲ / ▼ button to set the mode and press [MODE] or ▶ button.

Setting value	Description	Default value
oFF	The calculation function is not used.	0
PLU5	Addition Mode	
กี เกบ5	Subtraction Mode	

If there is no expansion unit additionally installed, the setting cannot be changed from [pFF].

3 [End] blinks on the sub display (lower level). When the settings are finished with [MODE] or the ▶ button, the main screen is restored.


When settings other than "The calculation function is not used" are set on the main screen, the calculation indicator "CALC" lights up.

4-44

Setting method (Calibrating R.V.)

When there is a difference between the internal measurement value (R.V.) and the actual dimension of the object, the value can be calibrated.

The zero point (offset) and tilt are both corrected.

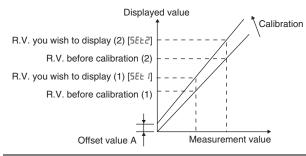



 If the following conditions are not satisfied, the screen below is displayed when the setting is complete. Make the setting again.

 


- $0.5 \le \frac{(\text{R.V. you wish to display (2)}) (\text{R.V. you wish to display (1)})}{(\text{R.V. before calibration (2)}) (\text{R.V. before calibration (1)})} \le 2$
- · Workpiece is not within measurement range.
- The setting was switched during the calibration.

When calculation function is disabled

Main screen








Press [MODE] button and ▶ button for approx. 2 seconds on the main screen at the same time.

[30[Lb] is displayed on the main display (upper level).

Press \triangle / ∇ button to set [U5r] and press \triangleright button.

Setting value	Description	Default value
dEFLL	Standard	0
USr	User setting	

 

Insert workpiece A for which the measured value is known, and using the ▲ / ▼ buttons, set the "R.V. you wish to display (1)" for that workpiece A.

The current internal measurement value is displayed on the main display (upper level). [5EŁ /] and the "R.V. you wish to display (1)" are alternately displayed on the sub display (lower level).

IL-030/IL-065/IL-100

Item	Setting range	Default value
SEŁ I	-99.999 to 99.999	0.000

IL-300/IL-600

Item	Setting range	Default value
SEL I	-999.99 to 999.99	0.00

IL-2000

Item	Setting range	Default value
SEL I	-9999.9 to 9999.9	0.0

⚠ Press the [SET] button. (SET1 confirmation operation)

After [5EŁ /] blinks several times on the sub display (lower level), [5EŁ2] is displayed.

Insert workpiece B for which the measured value is known, and using the ▲ / ▼ buttons, set the "R.V. you wish to display (2)" for that workpiece B.

The current internal measurement value is displayed on the main display (upper level). [5EL2] and the "R.V. you wish to display (2)" are alternately displayed on the sub display (lower level).

IL-030/IL-065/IL-100

Item	Setting range	Default value
SEE2	-99.999 to 99.999	5.000


IL-300/IL-600


Item	Setting range	Default value
SEE2	-999.99 to 999.99	50.00

IL-2000

Item	Setting range	Default value
SEE2	-9999.9 to 9999.9	500.0

  4-46





After [5££2] blinks several times on the sub display (lower level), [End] blinks.

 
This completes the calibration.

7 Press the ▶ button.

The main screen is restored.

When using the calculation function





Press [MODE] button and ▶ button for approx. 2 seconds on the main screen at the same time.

[[RL 16]] is displayed on the main display (upper level).

Press ▲ / ▼ button to set [HEAd] and press ▶ button.

Setting value	Description
HERd	The internal measurement value (R.V.) calibration is set.
ERLc	The calculated value (CALC) calibration is set.




Go to Step 2 of "When calibration function is disabled".

Setting method (Two-point calibration of calculated value (CALC value))

When there is a difference between the calculated value (CALC value) and the actual dimension of the object, the value can be corrected.

Both the zero point (offset) and tilt (span) are corrected.

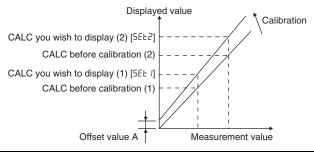

Point

 If the following conditions are not satisfied, the screen below is displayed when the setting is complete. Make the setting again.



- $0.5 \le \frac{\text{(CALC you wish to display (2)) (CALC you wish to display (1))}}{\text{(CALC before calibration (2)) (CALC before calibration (1))}} \le 2$
- · Workpiece is not within measurement range.
- . The setting was changed during the calibration.

Main screen



Press [MODE] +

▶ button
2 seconds or more
at the same time





Press [MODE] button and ▶ button for approx. 2 seconds on the main screen at the same time.

[[RL 1b]] is displayed on the main display (upper level).

Press ▲ / ▼ button to set [[AL 1b] and press ▶ button.

Setting value	Description	
HERd	The internal measurement value (R.V.) calibration is set.	
CALc	The calculated value (CALC) calibration is set.	

Press ▲ / ▼ button to set [U5r,2P] and press ▶ button.

Setting value	Description	Default value
dEFLL	Standard	0
U5-,2P	User setting (Two-point calibration)	
USr.3P	User setting (Three-point calibration)	

4-48 IL-E





Insert workpiece A for which the measured value is known, and using the ▲ / ▼ buttons, set the "CALC you wish to display (1)" for that workpiece A.

The current internal measurement value is displayed on the main display (upper level). [5EŁ I] and the "CALC you wish to display (1)" are alternately displayed on the sub display (lower level).

IL-030/IL-065/IL-100

	Item	Setting range	Default value
5	EL I	-99.999 to 99.999	5.000

IL-300/IL-600


Item	Setting range	Default value
SEŁ I	-999.99 to 999.99	50.00

IL-2000

Item	Setting range	Default value
SEL I	-9999.9 to 9999.9	500.0

5 Press the [SET] button. (SET1 confirmation operation)

 After [5EŁ I] blinks several times on the sub display (lower level), [5EŁ2] is displayed.



 6 Insert workpiece B for which the measured value is known, and using the ▲ / ▼ buttons, set the "CALC you wish to display (2)" for that workpiece B.

The current internal measurement value is displayed on the main display (upper level). [5Et2] and the "CALC you wish to display (2)" are alternately displayed on the sub display (lower level).

IL-030/IL-065/IL-100

Item	Setting range	Default value
SEE2	-99.999 to 99.999	10.000

IL-300/IL-600


Item	Setting range	Default value
SEE2	-999.99 to 999.99	100.00

IL-2000

Item	Setting range	Default value
SEE2	-9999.9 to 9999.9	1000.0

[SET] button

 IL-E



Main screen

7 Press the [SET] button. (SET2 confirmation operation)

After [5££2] blinks several times on the sub display (lower level), [End] blinks.

This completes the calibration.

Press the ▶ button.

The main screen is restored.

Setting method (Three-point calibration of calculated value (CALC value))

When there is a difference between the calculated value (CALC value) and the actual dimension of the object, the value can be corrected.

With two-point calibration of the calculated value (CALC value), the zero point (offset) and tilt (span) of the calculated value are corrected, but with three-point calibration of the calculated value (CALC value), the tilt (span) of the main unit's internal measurement value (R.V.) is calibrated with the zero point (offset) and tilt (span) of the calculated value. Even when measuring the same workpiece, an error may result in the measurement position. This error can be calibrated with three-point calibration.

Point

- . Move the same workpiece between the 1st point and 2nd point.
- If the following conditions are not satisfied, the screen below is displayed when the setting is complete. Make the setting again.



• 0.5 \leq $\frac{\text{(CALC you wish to display (3)) - (CALC you wish to display (1))}}{\text{(CALC before calibration (3)) - (CALC before calibration (1))}} <math>\leq 2$

•Addition

 $\textbf{0.5} \leq \frac{-(\text{R.V. of expansion unit at 2nd point - R.V. of expansion unit at 1st point)}}{(\text{R.V. of main unit at 2nd point before calibration) - (R.V. of main unit at 1st point before calibration)}} \leq 2$

•Subtrac-

tion

 $\textbf{0.5} \leq \frac{\text{R.V. of expansion unit at 2nd point - R.V. of expansion unit at 1st point}}{(\text{R.V. of main unit at 2nd point before calibration}) - (\text{R.V. of main unit at 1st point before calibration})} \leq 2 + \frac{1}{2} + \frac{1}{2$

- •Workpiece is not within measurement range.
- The setting was switched during the calibration.
- •Workpieces inserted at the 1st point and 2nd point are different.
- When three-point calibration is performed, the main unit's internal measurement value (R.V.) is calibrated. Thus, the calibration settings for the main unit's head are automatically changed to [U5r].

4-50

Main screen



Press [MODE] +

button
2 seconds or more at the same time









[SET] button

Press [MODE] button and ▶ button for approx. 2 seconds on the main screen at the same time.

[[RL 16]] is displayed on the main display (upper level).


Press ▲ / ▼ button to set [[RLc] and press ▶ button.

Setting value	Description	
HERd	The internal measurement value (R.V.) calibration is set.	
CALc	The calculated value (CALC) calibration is set.	

Press ▲ / ▼ button to set [U5r∃P] and press ▶ button.

Setting value	Description	Default value
dEFLE	Standard	0
U5r.2P	User setting (Two-point calibration)	
USr.3P	User setting (Three-point calibration)	

Workpiece A is set closer to the head connected to the main unit allowing for the possible workpiece positional deviation. Then set the "CALC value you wish to display (1)" for that workpiece A by ▲ / ▼ buttons.

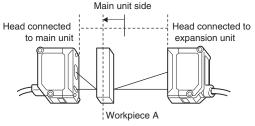

The current internal measurement value is displayed on the main display (upper level). [5EŁ I] and the "CALC you wish to display (1)" are alternately displayed on the sub display (lower level).

IL-030/IL-065/IL-100


Item	Setting range	Default value
SEL I	-99.999 to 99.999	5.000

IL-300/IL-600

Item	Setting range	Default value
SEL I	-999.99 to 999.99	50.00

IL-2000

Item	Setting range	Default value
SEL I	-9999.9 to 9999.9	500.0

 


Setting you wish to display



5 Press the [SET] button. (SET1 confirmation operation)

After [5EŁ I] blinks several times on the sub display (lower level), [5EŁ2] is displayed.

Workpiece A is set closer to the head connected to the expansion unit allowing for the possible workpiece positional deviation.

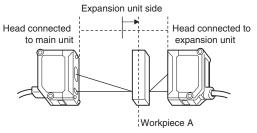

The current internal measurement value is displayed on the main display (upper level). [5££2] and the "CALC you wish to display (2)" are alternately displayed on the sub display (lower level). The "CALC value you wish to display (2)" cannot be set. The same value of "CALC value you wish to display (1)" is displayed.



 
The same workpiece as point 1 is moved.

7 Press the [SET] button. (SET2 confirmation operation)

4-52 IL-E



8 Insert workpiece B for which the measured value is known, and using the ▲ / ▼ buttons, set the "CALC you wish to display (3)" for that workpiece B.



The current internal measurement value is displayed on the main display (upper level). [5EĿ3] and the "CALC you wish to display (3)" are alternately displayed on the sub display (lower level). IL-030/IL-065/IL-100

Item	Setting range	Default value
SEE3	-99.999 to 99.999	10.000

IL-300/IL-600

Item	Setting range	Default value
SEE3	-999.99 to 999.99	100.00

IL-2000

Item	Setting range	Default value
SEE3	-9999.9 to 9999.9	1000.0



[SET] button

Main screen

9 Press the [SET] button. (SET3 confirmation operation)

After [5££3] blinks several times on the sub display (lower level), [End] is displayed.

This completes the calibration.

1 ∩ Press the button.

The main screen is restored.

IL-E 4-53

MEMO

4-54 IL-E

Specifications

This chapter describes the specifications, circuit diagrams, and dimensions of the IL Series.

5

5-1	Specifications	5-2
5-2	Circuit Diagram	5-4
5-3	Dimensions	5-6
5-4	Response Time	5-16

IL-E 5-1

Specifications

Sensor Head

Model		IL-030	IL-065	IL-100	IL-300	IL-600	IL-2000	
Mounting distance		30 mm	65 mm	100 mm	300 mm	600 mm	2000 mm	
Measurement range)	20 to 45 mm	55 to 105 mm	75 to 130 mm	160 to 450 mm	200 to 1000 mm	1000 to 3500 mm	
			Red semiconductor laser; wavelength 655 nm (visible light)					
Light source	Laser Class	Class 1 (FDA CDRH Part 1040.10*1, IEC 60825-1: 2014)	DA DA BH Art 1.10 1 Class 2 (FDA CDRH Part1040.10 1, IEC 60825-1 EC 25-1:					
	Output	220 μW			560 μW			
Spot diameter (at the reference dis	tance)	Approx. 200 x 750 μm	Approx. 550 x 1750 μm	Approx. 400 x 1350 μm	Approx. ø500 μm	Approx. ø1600 μm	Approx. 1400 x 7000 μm	
Linearity*2 *3		±0.1% of F.S. (When used under 25 to 35 mm)	±0.1% of F.S. (When used under 55 to 75 mm)	±0.15% of F.S. (When used under 80 to 120 mm)	± 0.25% of F.S. (When used under 160 to 440 mm)	±0.25% of F.S. (When used under 200 to 600 mm) ±0.5% of F.S. (When used under 200 to 1000 mm)	± 0.16% of F.S. (When used under 1000 to 3500 mm)	
Repeatability*4		1 μm	2 μm	4 μm	30 μm	50 μm	100 μm	
Sampling rate		0.33/1/2/5 ms (Variable to 4 levels)						
Operating indicators	3	Laser emission warning indicator: green LED, Analog range indicator: orange LED, Reference distance indicator: red/green LED						
Temperature charac	teristic*3	0.05% of F.S./°C	0.06% of F.S./°C	0.06% of F.S./°C	0.08% of F.S./°C	0.08% of F.S./°C	0.016% of F.S./°C	
	Enclosure rating			IP	67			
	Ambient light*5	Incandescent lamp: 5000 lx	Incandescent lamp: 7500 lx Incandescent lamp: 5000 lx		Incandescent lamp: 10000 lx			
Environmental resistance	Ambient temperature	-10 to + 50°C (No condensation and freezing)						
	Relative humidity	35 to 85% RH (No condensation)						
	Vibration	10 to 55 l	Hz, 1.5 mm do	ouble amplitue	de, 2 hours ea	ach for X, Y, a	nd Z axes	
Pollution degree		3						
Material		-		rial: PBT, Met ens cover: Gla			,	
Weight		Approx. 60 g	Appro	x. 75 g	Approx	c. 135 g	Approx. 350 g	

^{*1} The classification is implemented based on IEC60825-1 following the requirement of Laser Notice No.50 of FDA (CDRH).

5-2 IL-E

^{*2} Value when measuring the KEYENCE standard target (white diffuse object).

^{*3} The F.S. of all of the models are as follows. IL-030: ±5 mm, IL-065: ±10 mm, IL-100: ±20 mm, IL-300: ±140 mm, IL-600: ±400 mm, IL-2000: +1000 to -1500 mm

^{*4} Is the value for when our standard object (white diffuse object) is measured at an average of 128 times and with a sampling rate of 1 ms from a standard distance. (IL-300/IL-600 is 2 ms and IL-2000 is 5 ms)

^{*5} Value when the sampling rate is set to 2 ms or 5 ms.

Sensor Amplifier


Model		IL-1000	IL-1500	IL-1050	IL-1550		
Amplifier typ	е	DIN rail mount	Panel mount	DIN rail mount	Panel mount		
Main unit/Ex	rpansion unit	Mair	unit	Expans	ion unit		
Head comp	Head compatibility		Yes				
	Minimum display unit		IL-030: 1 μm, IL-065/IL-100: 2 μm, IL-300: 10 μm, IL-600: 50 μm, IL-2000: 10				
Display	Display range	IL-300/IL-600:	IL-030/IL-065/IL-100: ± 99.999 mm to ± 99 mm (Variable to 4 levels) IL-300/IL-600: ± 999.99 mm to ± 999 mm (Variable to 3 levels) IL-2000: ± 9999.9 to ± 9999 (Variable to 2 levels)				
	Display rate			times/sec			
Analog volta	age output*1		5 V, 0 to 5 V dance 100 Ω	N	lo.		
Analog curr	Analog current output*1		$^{!0}$ mA esistance 350 Ω	- No			
Control input*2 Bank switching input Zero shift input Emission stop input Timing input		No-voltage input					
	Reset input						
Control	Judgment output	Open collector (NPN/PNP switchable, N.O./N.C. switchable)					
output*3	Alarm output	Open collector (NPN/PNP switchable, N.C. switchable)					
Power	Power voltage*4	10 to 30 VDC, including ripple (P-P) 10% Class2 or LPS ^{*5}		Supplied from main unit			
supply	Power consumption (without load)	2300 mW or less (at 30 V, 77 mA max.)*6	2500 mW or less (at 30 V, 84 mA max.)*7	2000 mW or less (at 30 V, 67 mA max.)	2200 mW or less (at 30 V, 74 mA max.)		
	Ambient temperature		-10 to +50°C				
Environmental	Relative humidity		35 to 85% RH (N	lo condensation)			
resistance	Vibration	10 to 55 Hz, 1.5 mm double amplitude, 2 hours each for X, Y, Z axes					
	Pollution degree		•	2			
Materials		Main unit case/Front panel: polycarbonate, keytop: polyacetal, cable: PVC					
Mass (includ	ling accessories)	Approx. 150 g	Approx. 170 g	Approx. 140 g	Approx. 160 g		

- *1 \pm 5 V, 1 to 5 V, 0 to 5 V, or 4 20 mA should be selected.
- *2 The four external input wires are assigned with desired inputs. Rated no-voltage input: ON voltage 2 V or less; OFF current 0.02 mA or less. Rated voltage input is max. input rating 30 V or less, ON voltage 7.5 V or more, and OFF
- current 0.05 mA or less.
 *3 Rated NPN open collector output: max. 50 mA/ch (20 mA/ch when expansion units are connected), 30 V or less, residual voltage 1 V or less. (1.5 V or less when five or more
 - expansion units are connected.)
 Rated PNP open collector output: max. 50 mA/ch (20 mA/ch when expansion units are connected), power voltage or less, residual voltage 2 V or less. (2.5 V or less when five or more expansion units are connected.)
- *4 When connecting five or more expansion units, ensure that the power voltage is 20 to 30 V.
- *5 Use Class 2 or LPS power supply with the overcurrent protection device rated 2.5 A or less.
- *6 18 W max. (Total power consumption when connecting seven expansion units and DL Series)
- *7 19.5 W max. (Total power consumption when connecting seven expansion units and DL Series)

Circuit Diagram


Output Circuit Diagram

When NPN output is selected

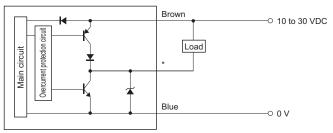


^{*} Black (HIGH judgment output)/White (LOW judgment output)/ Gray (GO judgment output)/Green (alarm output)

When PNP output is selected

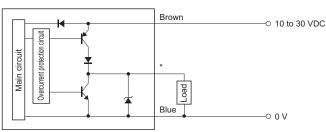


* Black (HIGH judgment output)/White (LOW judgment output)/ Gray (GO judgment output)/Green (edge check output)

Analog Output Circuit

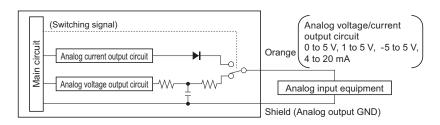


5-4 IL-E

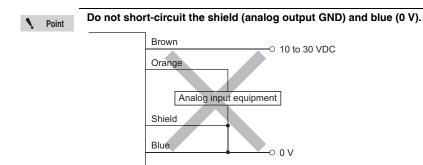


Input Circuit Diagram

When NPN output is selected

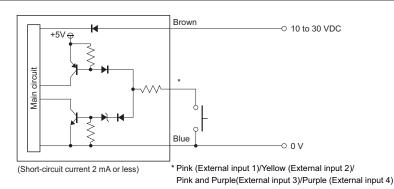

When PNP output is selected

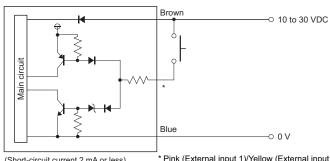


(Short-circuit current 2 mA or less)

* Pink (External input 1)/Yellow (External input 2)/ Pink and Purple(External input 3)/Purple (External input 4)


IL-E 5-5

- Amplifier
- IL-1000/IL-1050

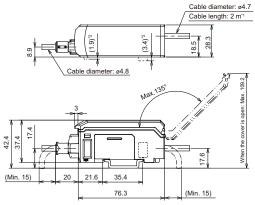

- *1 Cable specification: IL-1000 12 cores, Nominal cross-section area brown/blue: 0.20 mm², others 0.15 mm² : IL-1050 8 cores, Nominal cross-section area: 0.15 mm²
- *2 Not mounted on the IL-1000.


IL-1500/IL-1550

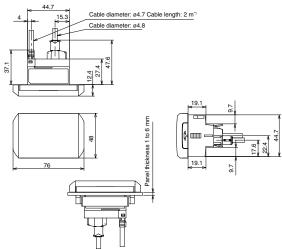


*1 Cable specification: IL-1000 12 cores, Nominal cross-section area brown/blue: 0.20 mm², others 0.15 mm² : IL-1550 8 cores, Nominal cross-section area: 0.15 mm²

5-6 IL-E

- Sensor Head
- IL-030

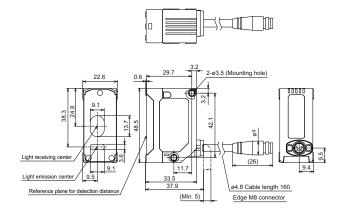


Mounting bracket

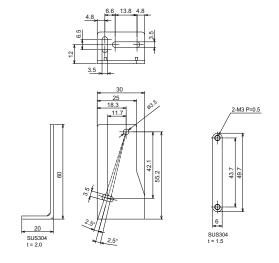


IL-E

• IL-065/IL-100

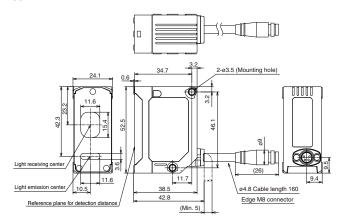


Mounting bracket

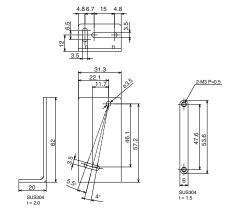


IL-E 5-8

• IL-300/IL-600

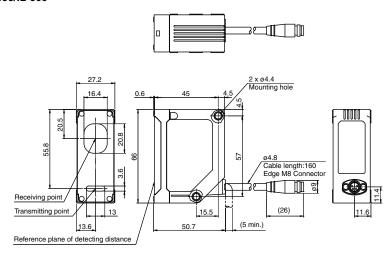

Mounting bracket

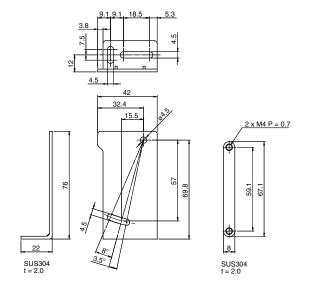


IL-E


5 Specifications

IL-2000

When using the straight connector

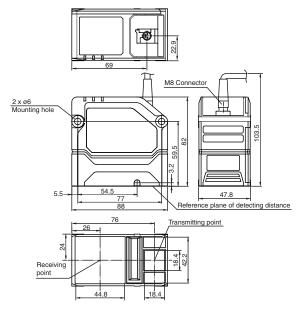


When using the L-shaped connector

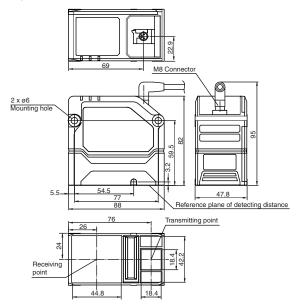

IL-E 5-10


Mounting bracket (OP-87606)

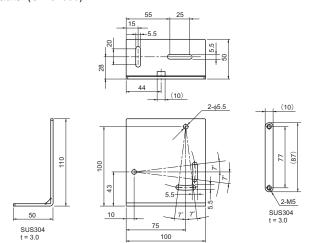


IL-E

Mutual-interference


• IL-030

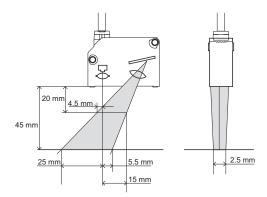


● IL-065/IL-100

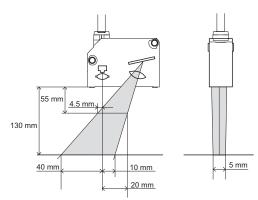


• IL-300

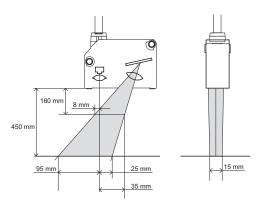

• IL-600

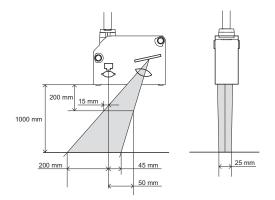

• IL-2000

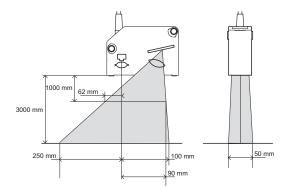


This drawing shows the interference area when the optical axis is perpendicular to the target surface.

The optical axis may vary by approximately $\pm 1.5^{\circ}$ (IL-2000), or $\pm 2.0^{\circ}$ (IL-030/IL-065/IL-100/IL-300/IL-600).


IL-E

Spot Diameter


• IL-030

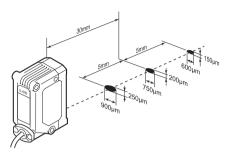


IL-065

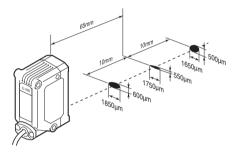

• IL-100

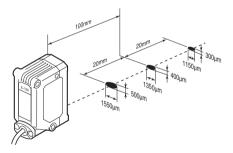


• IL-300

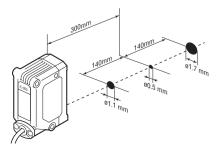


5-14 IL-E

• IL-600

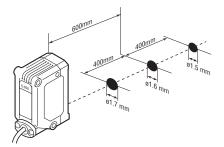

• IL-2000

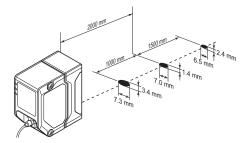

The optical axis may vary by approximately $\pm 1.5^{\circ}$ (IL-2000), or $\pm 2.0^{\circ}$ (IL-030/IL-065/IL-100/ IL-300/IL-600).

IL-E

Response Time

■ Response time

Response time means the following time range: from sensor recognition for the target object changes to output.

Response time of judgment output (Maximum value)

[ms]

Compling rate	Averaging							
Sampling rate	1	2	4	8	16	32	64	
0.33 ms	4	4	5	6	9	14	25	
1 ms	11	12	14	18	26	41	72	
2 ms	21	23	27	35	50	81	143	
5 ms	52	57	66	86	125	202	357	

Sampling rate	Averaging						
Sampling rate	128	256	512	1024	2048	4096	
0.33 ms	46	88	172	341	678	1351	
1 ms	134	258	506	1002	1995	3979	
2 ms	267	516	1012	2004	3988	7957	
5 ms	667	1287	2528	5008	9970	19892	

Response time of analog output

Response time of judgment output +0.3 ms

■ Response time when the calculation function is used

When the calculation function is used, since the calculation process is added, the response time delays. Add the following times based on the response time which is calculated by the sampling rate and averaging, and the number of additional expansion units.

Number of additional units (including the main unit)	No DL Series onnection	With DL Series connection
2 units	6 ms	11 ms
3 units	7 ms	14 ms
4 units	12 ms	18 ms
5 units	14 ms	20 ms
6 units	19 ms	24 ms
7 units	20 ms	27 ms
8 units	26 ms	31 ms

5-16 IL-E

Appendix

1	Iroubleshooting	A-2
2	Display Screen and Output	A-8
3	Factory Setting (Default Value) List	A-9
4	Index	Δ-10

IL-E A-1

Troubleshooting

This section describes corrective actions when errors occur.

Frequently Asked Questions

Problem	Check points	Corrective actions	
Nothing is	Is the power cable connected correctly?	Connect the power cable correctly. "Sensor Amplifier Wiring" (page 2-6)	
displayed on the amplifier control	Is the sensor amplifier correctly added?	Add the sensor amplifier correctly. "Mounting the Sensor Amplifier" (page 2-2)	
unit.	The power saving function may be on.	Cancel the power saving function. "16. Power Saving Function" (page 4-40)	
	Is the object within the detection range?	Adjust the object to correctly fall within the measurement range.	
	Is there an obstacle within the measurement range?	Remove the obstacle.	
	Is the hold function being used?	Check the hold function setting. Input the timing input according to the setting. "6. Hold Function" (page 4-15)	
Values are not	The laser emission may be stopped.	Check whether the laser emission stop input is ON or not. "11. External Input" (page 4-30)	
displayed.	Is there strong ambient light such as a photoelectronic sensor and inverter fluorescent light?	Shield the ambient light to prevent it from entering the laser receiver.	
	Is there mutual-interference?	Shield the other transmitter laser light to prevent it from entering the laser receiver. Use the mutual-interference prevention function. "14. Interference Prevention Function (Only for IL-1000/1500)" (page 4-38)	
	Are the output wire and input wire short-circuited?	Check the wiring. "Sensor Amplifier Wiring" (page 2-6)	
	Is the averaging set to small (response time set too fast)?	Increase the averaging. "3. Averaging rate, Step count filter, High-pass filter" (page 4-9)	
	Is the object or sensor head vibrating?	Take adequate measures to prevent vibration.	
	Is dirt or dust stuck to the laser transmitter/receiver?	Remove the dirt or dust. "Influence of dirt" (page 5)	
The value fluctuates.	Is dust, dirt, water or oil stuck to the target?	Remove the dust, dirt, water, oil, etc. "Influence of dirt" (page 5)	
	Are there airborne droplets of dust, water or oil during use?	Remove the droplets with air purge, etc.	
	Is the mounting position deviated?	Correctly mount the sensor head. "Mounting the Sensor Head" (page 2-8)	
	Are the output wire and input wire short-circuited?	Check the wiring. "Sensor Amplifier Wiring" (page 2-6)	

A-2 IL-E

Problem	Check points	Corrective actions			
	Is the object tilted or located in an incorrect position?	Adjust the object to correctly fall within the measurement range.			
	Is the mounting position deviated?	Correctly mount the sensor head. "Mounting the Sensor Head" (page 2-8)			
	Is dirt or dust stuck to the laser transmitter/receiver?	Remove the dirt or dust. Influence of dirt" (page 5)			
	Is dust, dirt, water or oil stuck to the object?	Remove the dust, dirt, water, oil, etc. "Influence of dirt" (page 5)			
The values are incorrect.	Does the ambient operating temperature significantly change?	Keep the ambient operating temperature constant.			
	Is the zero shift function correctly set?				
	Is the shift target value set correctly?	Configure the settings correctly. "Zero Shift Function (Shifting the Internal Measurement Value (R.V.))" (page 3-18)			
	Is the zero shift input wire connected correctly?	modelia value (1.1.1./) (page 2.10)			
	Is the calibration complete correctly?	Redo the calibration. "Calibration Function" (page 4-45)			
	Are the output wire and input wire short-circuited?	Check the wiring. "Sensor Amplifier Wiring" (page 2-6)			
Button operations are ignored.	Is the key lock function being used?	Cancel the key lock function. "Key Lock Function" (page 3-21) The connected communication unit <dl-rs1a> read/ write setting switch is set to RW. Set the read/write setting switch to R. "RS-232C Communication Unit DL-RS1A User's Manual"</dl-rs1a>			
	Is the output polarity set correctly?	Make the settings for NPN output and PNP output. "Initial Reset (Initialize)" (page 3-8)			
The judgment output cannot	Is the unit properly wired?	Wire the unit correctly. "Output Circuit Diagram" (page 5-4)			
be output properly.	Is the tolerance setting value set correctly?	Set the tolerance setting value. "Setting the Tolerance Setting Value" (page 3-10)			
	Is the output state (N.O./ N.C.) set correctly?	Set the output state. "5. Output State" (page 4-14)			
The analog output	Is the unit properly wired?	Wire the unit correctly. "Output Circuit Diagram" (page 5-4)			
cannot be output properly.	Is the type of analog output (current/voltage) set correctly?	Set the type of analog output. "Initial Reset (Initialize)" (page 3-8)			
The bank cannot be switched by the external input	Is the bank switching method set correctly?	Set the bank switching method. "12. Bank Switching Method" (page 4-35)			
The sensor head indicator	Is the power voltage used within the specification range?	Use the power voltage within the specification range. "Specifications" (page 5-2)			
does not change.	Is there an error message on the sensor amplifier?	Take adequate measures according to the error messages. "Error Displays and Corrective Actions" (page A-4)			

IL-E A-3

Error Displays and Corrective Actions

When an error occurs, an error message appears on the sensor amplifier.



- If an error occurs, the judgment output changes to the error status and the alarm output turns OFF.
- III "5. Output State" (page 4-14)
- When [E-L] is displayed, all judgment outputs and alarm outputs turn OFF to
 protect the outputs.
- When the error display is other than [ErE] or [ErE], the analog voltage output is 5.5 V and the analog output current is 3.0 mA.

Error displays	Error contents	Corrective actions	
Head error	The sensor head is not connected. The head cable is damaged. The sensor head is damaged. A sensor head is connected that is incompatible with this amplifier.	Check the sensor head connection. Check whether the head cable is damaged. Check the connection of the head cable to the connector. After checking the above matters, turn the power ON again. Check the models of the sensor head and sensor amplifier.	
ErH LASEr Transmitter laser error	Laser inside head is damaged.	Replace the head.	
REYENE BOAT TO BE THE STATE OF	A head incompatible with this amplifier is connected.	Check the head and amplifier models.	
Overcurrent error	Overcurrent beyond specification is flowing through the judgment output and alarm output.	Wire the unit correctly. "Output Circuit Diagram" (page 5-4) Check the load and reduce the current to be within the specification range. Check that the output wire is not touching other wires or the frame.	
FIGURE HARTINGS CONSTRUCTIONS	Reading/writing the nonvolatile memory (EEPROM) storage data failed.	Turn the power on again. Perform the initial reset. "Initial Reset (Initialize)" (page 3-8)	
EEPROM error	Data has been written in the nonvolatile memory (EEPROM) over 1 million times and malfunction occurred.	To save the setting values when the power is turned OFF, replace the sensor amplifier.	
	zero shift value is	tero shift function frequently, make sure that the not saved in the nonvolatile memory (EEPROM). ift Value Memory Function" (page 4-38)	
Communication error	Communication cannot be established between the added sensor amplifiers.	Make the setting for the added sensor amplifiers again after the power is turned OFF. "Mounting the Sensor Amplifier" (page 2-2)	

A-4 IL-E

Error displays	Error contents	Corrective actions	
Additional setting error	When using the calculation function, a model other than IL-1050 or IL-1550 is mounted next to the main unit, or there is no expansion unit.	Check the type of sensor amplifier after the power is turned OFF. Turn the power OFF and then connect the expansion unit.	
Er_[AL]	While using the calculation function, an error is found on the expansion unit (expansion unit 1) added next to the main unit.	Solve the error on the expansion unit 1.	

Non-Error Displays and Corrective Actions

When the judgment value (P.V.) is "----" the judgment output becomes all OFF (When Normally Open is set), and the analog voltage output is 5.5 V and the analog output current is 3.0 mA.

- 5. Output State" (page 4-14)
- 10. Analog Output Scaling" (page 4-27)

In cases other than the above, the judgment output and analog output keeps the output status immediately before the output.



If the internal measurement value (R.V.) becomes [----] because the target is out of the measurement range, the internal measurement value (R.V.) retains the value immediately before the target disappears for the period the response time elapses. After the response time elapses, the internal measurement value (R.V.) becomes [----].

"3. Averaging rate, Step count filter, High-pass filter" (page 4-9)

Display	Description	Corrective actions	
REYENCE HAS CHOOLED	A target is not in the measurement range. A target cannot be measured.	Adjust the target to correctly fall within the measurement range.	
The internal measurement value (R.V.) is displayed as [].	The laser emission stop input is ON.	Set the laser emission stop input to OFF. Check the wiring of the laser emission stop input. input. "11. External Input" (page 4-30)	
The judgment value (P.V.) is displayed as [].	The hold function is used and the judgment value (P.V.) is held.	Check the hold function setting. Input the timing input according to the setting. "6. Hold Function" (page 4-15)	

IL-E A-5

Display	Description	Corrective actions		
The internal measurement value (R.V.) is displayed as [-FFFF].	The internal measurement value (R.V.) falls below the lower limit (-99.999) of display range.	Check the setting for shift target value and shif the display again. "3-5 Zero Shift Function (Shifting the		
The internal measurement value (R.V.) is displayed as [FFFF].	The internal measurement value (R.V.) goes beyond the upper limit (99.999) of display range.	Internal Measurement Value (R.V.))" (page 3-18) Redo the calibration. "Calibration Function" (page 4-45)		
PREVENCE DESCRIPTION OF THE PROPERTY OF THE PR	The bank switching method is set to external input.	To switch the banks with button operations, set "12. Bank switching method" to [bɛn].		
POLICE PO	When the R.V. (Internal Measurement Value) is [], the tolerance tuning and the 2 point tuning will occur, and, when the P.V. (Judgment Value) is [] 1 point tuning will occur.	When the internal measurement value (R.V.) and judgment value (P.V.) is a number value, conduct tuning by the condition of the measured measurement object. "Setting the Tolerance Setting Value" (page 3-10)		
SH IFE	When the R.V. is [], the zero shift function was used. When the "3.AVE" is [HPF], the zero-shift was used.	Shift the display when the internal measurement value (R.V.) is displayed (with the object measured). "Zero Shift Function (Shifting the Internal Measurement Value (R.V.))" (page 3-18) Make sure the "3.AVE" is not [HPF]. "3. Averaging rate, Step count filter, High-pass filter" (page 4-9)		
REVENE SELVENT	The SET1, SET2, or SET3 value is incorrect and the correction using the calibration function could not be performed.	Perform the calibration within the possible correction range. "Calibration Function" (page 4-45)		
PREVENCE COLORS	The button operation is disabled.	The connected communication unit <dl-rs1a> read/write setting switch is set to RW. Set the read/write setting switch to R. "RS-232C Communication Unit DL-RS1A User's Manual"</dl-rs1a>		
REVENE HAS CIDACOMERCIA OF THE CONTROL OF THE CONT	The light amount is saturated.	Tilt the sensor head so that regular reflectance beam is not received.		

A-6 IL-E

Display	Description	Corrective actions	
REVENUE COM / SEL	The calculation mode was changed or the mutual-interference prevention function was changed with the main unit while the setting screen was displayed on the expansion unit.		
EALC	The main device delivered from December 22th, 2010, and the extension device delivered before December 21th, will have the calculation function setting included when the "3.AVE" is [HPF]. When "3.AVE" is [d IFF] The calculation setting is included.	Please use the extension device shipped after December 22th, 2010. Use a setting other than [d ,FF] for "3.AVE". "3. Averaging rate, Step count filter, High-pass filter" (page 4-9)	

IL-E A-7

Display Screen and Output

Normally, the judgment value (P.V.) is displayed on the main display (upper level). This section describes the judgment output and analog output status when displays other than numbers appear on the main display.

Reference

The judgment indicator on the sensor amplifier operates in the same way as Normally Open regardless of the output state setting.

"Setting the Tolerance Setting Value" (page 3-10)

	Am	plifier	Control input		Control output		Analog output	
Status	Upper level main display	Judgment indicator*1	Timing /Reset	Bank switching/ emission stop	Zero-shift	Judgment output*1	Alarm	Voltage (current) value
Measuring	Judgment value (P.V)	Measurement results	Yes	Yes	Yes	Measurement results	Output: ON Display: OFF	Voltage (current) for measured value
Out of measurement range		All off	Yes	Yes	No	All OFF	Output: OFF Display: ON	Analog voltage output: 5.5 V fixed Analog current output: 3.0 mA fixed
Out of display range	FFFF	Only HI lights	Yes	Yes	Yes	Only HIGH output ON	Output: ON Display: OFF	Fixed to upper limit of analog output range (For 1-5 V, fixed to 1 V) (When upper limit < lower limit: 1 V)
Out of display range	-FFFF	Only LO lights	Yes	Yes	Yes	Only LOW output ON	Output: ON Display: OFF	Fixed to lower limit of analog output range (For 1-5 V, fixed to 1 V) (When upper limit < lower limit: 5 V)
Setting	Setting item	Follows setting details	During error: No Other than error: Yes	Yes	Outside measurement range, mid-error, mid-high-pass filter: No	Follows setting details	Output: ON Display: OFF	Follows setting details
Other than [Erc], [Ere] errors "Error Displays and Corrective Actions" (page 4)	Error display	HI/LO simulta- neously light	No	Yes	No	HIGH/ LOW output simulta- neously ON	Output: ON Display: OFF	Analog voltage output: 5.5 V fixed Analog current output: 3.0 mA fixed
Overcurrent error	ErC	All off	Yes	Yes	Yes	All OFF	Measurement in progress, or same as out of measurement range	Voltage (current) for measured value
EEPROM error FEYENCE E E E LICE TEMPORAL TO SHOW THE SH	ErE	Measurement results	Yes	Yes	Yes	Measurement results	Measurement in progress, or same as out of measurement range	Voltage (current) for measured value

^{*1} The output state of judgment output can be set to N.O. (Normally Open) or N.C. (Normally Close).

A-8

[&]quot;5. Output State" (page 4-14)

3

Factory Setting (Default Value) List

This section describes the factory settings (default values).

If the initial reset is performed, the default values will be restored as below except for the calibration function.

"Initial Reset (Initialize)" (page 3-8)

Values set on the main screen

The bank 0 to 3 have the same value.

Setting items	Default value
HIGH side setting value	5.000 (5000)((5000))
LOW side setting value	-5.000 (-5000)((-5000))
Shift target value	0.000 (0.00)((0.0))

Basic Settings and Advanced Settings

Setting items	Default value	Description
Measurement direction	חפר	The display value increments when the object approaches the sensor head.
2. Sampling rate	dEFLE	Default setting
3. Averaging rate, Step count filter, High-pass filter	16	Averaging:16
4. Alarm setting	dEFLE	Default setting
5. Output state	no	Normally Open
6. Hold function	5-H	Sample hold
7. Timing input	LEUEL	Level
8. Delay timer	oFF	The delay timer is not used.
9. Hysteresis	0.000 (0.00)((0.0))	0.000 mm (0.00 mm)((0.0 mm))
10. Analog output scaling	dEFLE	Default setting
11. External Input	dEFLE	Default setting
12. Bank switching method	bŁn	Button operation
13. Zero shift value memory function	ñ-oFF	Not save on the nonvolatile memory (EEPROM)
14. Interference prevention function	oFF	Mutual-interference prevention function OFF
15. Display digit	dEFLE	Default setting
16. Power saving function	oFF	Not display the power saving (Normally ON)
17. Head display mode	dEFLE	Normal
18. Display color	<u> ն</u> օնrո	GO green

Other functions

Setting items	Default value	Description
Calculation Function	oFF	The calculation function is not used.
Calibration Function	dEFLt	Default setting
Calculation calibration function	dEFLE	Default setting
Tolerance for tolerance tuning	(200)((200))	0.200 mm (2.00 mm)((20.0 mm))

The values for the IL300/600 are written in parentheses. The values for the IL-2000 are written in double parentheses.

IL-E

A	F
Addition Mode4-43 Analog Output Circuit5-4	Factory Setting (Default Value) List A-9
Analog Output Scaling4-27	Н
Attaching the sensor head cable connector (OP-84338:)2-11 Auto bottom hold4-22 Auto peak hold4-21	Hold Function4-15 Hysteresis4-26
Automatic Setting (When other than	1
step count filter)	Initial Reset (Initialize)
filter)3-16 1 point tuning3-17	Internal measurement value (R.V.)3-3
2 point tuning3-16	J
В	Judgment output3-10
Bank A input/Bank B input4-34	Judgment value (P.V.)3-3
Bank Function (Registering Multiple Tolerance Setting Values)3-20	K
How to Switch the Bank3-20 Settings Registered with the bank .3-20	Keylock Function3-21
Basic Settings and Advanced Settings 4-4	L
External Input4-30 Bottom hold4-18	Laser emission stop input4-35 List of Setting Items4-4
С	M
Calculation Function4-42	
Calculation Value (CALC value)4-42 Calibration Function4-45	Main Display (Upper Level)3-3
Checking the Package Contents1-2	N
Circuit Diagram5-4	Normally open/Normally closed4-14
D	0
Delay Timer 4-23 Dimensions 5-6 Display color 4-41 Display Digit 4-39 Display Screen and Output A-8	Operation When the Power is Turned on for the First Time

A-10

Р
Peak hold
R
R.V. (Internal Measurement Value) and P.V. (Judgment Value)3-3 Reset input4-31 Response Time5-16
S
Sample hold
Т
Timing Input4-23, 4-32 TroubleshootingA-2
Z
Zero Shift Function (Shifting the Internal Measurement Value (R.V.))

IL-E A-11

Revision History

Districtor.		
Print date	Revision no.	Description
March, 2010	Initial release	
April, 2010	Second edition	IL-065 added
May, 2010	Revised first edition	Correspondence with CSA
June, 2010	Re-revised first edition	IL-300/IL-600 added
July, 2010	Re-revised second edition	Clerical error corrected
December, 2010	Revision 3, first edition	Step count filter function, High-pass filter
		function added
April, 2011	Revision 3, second edition	Clerical error corrected
August, 2012	5th revision 1st edition	IL-2000 added
September, 2012	5th revision 2nd edition	
August, 2015	5th revision 3rd edition	

WARRANTIES AND DISCLAIMERS

- (1) KEYENCE warrants the Products to be free of defects in materials and workmanship for a period of one (1) year from the date of shipment. If any models or samples were shown to Buyer, such models or samples were used merely to illustrate the general type and quality of the Products and not to represent that the Products would necessarily conform to said models or samples. Any Products found to be defective must be shipped to KEYENCE with all shipping costs paid by Buyer or offered to KEYENCE for inspection and examination. Upon examination by KEYENCE, KEYENCE, at its sole option, will refund the purchase price of, or repair or replace at no charge any Products found to be defective. This warranty does not apply to any defects resulting from any action of Buyer, including but not limited to improper installation, improper interfacing, improper repair, unauthorized modification, misapplication and mishandling, such as exposure to excessive current, heat, coldness, moisture, vibration or outdoors air. Components which wear are not warranted.
- (2) KEYENCE is pleased to offer suggestions on the use of its various Products. They are only suggestions, and it is Buyer's responsibility to ascertain the fitness of the Products for Buyer's intended use. KEYENCE will not be responsible for any damages that may result from the use of the Products.
- (3) The Products and any samples ("Products/Samples") supplied to Buyer are not to be used internally in humans, for human transportation, as safety devices or fail-safe systems, unless their written specifications state otherwise. Should any Products/Samples be used in such a manner or misused in any way, KEYENCE assumes no responsibility, and additionally Buyer will indemnify KEYENCE and hold KEYENCE harmless from any liability or damage whatsoever arising out of any misuse of the Products/ Samples.
- (4) OTHER THAN AS STATED HEREIN, THE PRODUCTS/SAMPLES ARE PROVIDED WITH NO OTHER WARRANTIES WHATSOEVER. ALL EXPRESS, IMPLIED, AND STATUTORY WARRANTIES, INCLUDING, WITHOUT LIMITATION, THE WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, AND NON-INFRINGEMENT OF PROPRIETARY RIGHTS, ARE EXPRESSLY DISCLAIMED. IN NO EVENT SHALL KEYENCE AND ITS AFFILIATED ENTITIES BE LIABLE TO ANY PERSON OR ENTITY FOR ANY DIRECT, INDIRECT, INCIDENTAL, PUNITIVE, SPECIAL OR CONSEQUENTIAL DAMAGES (INCLUDING, WITHOUT LIMITATION, ANY DAMAGES RESULTING FROM LOSS OF USE, BUSINESS INTERRUPTION, LOSS OF INFORMATION, LOSS OR INACCURACY OF DATA, LOSS OF PROFITS, LOSS OF SAVINGS, THE COST OF PROCUREMENT OF SUBSTITUTED GOODS, SERVICES OR TECHNOLOGIES, OR FOR ANY MATTER ARISING OUT OF OR IN CONNECTION WITH THE USE OR INABILITY TO USE THE PRODUCTS, EVEN IF KEYENCE OR ONE OF ITS AFFILIATED ENTITIES WAS ADVISED OF A POSSIBLE THIRD PARTY'S CLAIM FOR DAMAGES OR ANY OTHER CLAIM AGAINST BUYER. In some jurisdictions, some of the foregoing warranty disclaimers or damage limitations may not apply.

BUYER'S TRANSFER OBLIGATIONS:

If the Products/Samples purchased by Buyer are to be resold or delivered to a third party, Buyer must provide such third party with a copy of this document, all specifications, manuals, catalogs, leaflets and written information provided to Buyer pertaining to the Products/Samples.

Specifications are subject to change without notice.

KEYENCE CORPORATION

www.keyence.com/glb

1-3-14, Higashi-Nakajima, Higashi-Yodogawa-ku, Osaka, 533-8555, Japan PHONE: +81-6-6379-2211

AUSTRIA

Phone: +43 (0)2236 378266 0

Phone: +32 (0)15 281 222 **BRAZIL**

Phone: +55-11-3045-4011

CANADA Phone: +1-905-366-7655

CHINA Phone: +86-21-3357-1001

CZECH REPUBLIC Phone: +420 220 184 700

FRANCE

Phone: +33 1 56 37 78 00

GERMANY

Phone: +49-6102-3656-0

HONG KONG

Phone: +852-3104-1010

HUNGARY

Phone: +36 1 802 7360

INDIA

Phone: +91-44-4963-0900

INDONESIA

Phone: +62-21-2966-0120

ITALY

Phone: +39-02-6688220 **KOREA**

Phone: +82-31-789-4300

MALAYSIA Phone: +60-3-7883-2211

Phone: +52-55-8850-0100

NETHERLANDS

Phone: +31 (0)40 206 6100

PHILIPPINES

Phone: +63-(0)2-8981-5000 POLAND

Phone: +48 71 368 61 60

ROMANIA

Phone: +40 (0)269 232 808

SINGAPORE Phone: +65-6392-1011

SLOVAKIA

Phone: +421 (0)2 5939 6461

SLOVENIA

Phone: +386 (0)1 4701 666

SWITZERLAND

Phone: +41 (0)43 455 77 30

TAIWAN

Phone: +886-2-2721-1080

THAILAND

Phone: +66-2-078-1090

UK & IRELAND

Phone: +44 (0)1908-696-900

Phone: +1-201-930-0100

VIFTNAM

Phone: +84-24-3772-5555



Artisan Technology Group is an independent supplier of quality pre-owned equipment

Gold-standard solutions

Extend the life of your critical industrial, commercial, and military systems with our superior service and support.

We buy equipment

Planning to upgrade your current equipment? Have surplus equipment taking up shelf space? We'll give it a new home.

Learn more!

Visit us at artisantg.com for more info on price quotes, drivers, technical specifications, manuals, and documentation.

Artisan Scientific Corporation dba Artisan Technology Group is not an affiliate, representative, or authorized distributor for any manufacturer listed herein.

We're here to make your life easier. How can we help you today? (217) 352-9330 | sales@artisantg.com | artisantg.com

