

Operating Instructions

RI FB PRO/i
RI MOD/i CC Ethernet/IP-2P

DE | Bedienungsanleitung

EN-US | Operating instructions



42,0410,2198

018-17072024

Inhaltsverzeichnis

Allgemeines.....	4
Sicherheit.....	4
Anschlüsse und Anzeigen.....	4
Eigenschaften der Datenübertragung.....	5
Konfigurationsparameter.....	5
IP-Adresse des Busmoduls einstellen	7
IP-Adresse des Busmoduls einstellen	7
Ein- und Ausgangssignale	9
Datentypen.....	9
Verfügbarkeit der Eingangssignale	9
Eingangssignale (vom Roboter zum Schweißgerät)	9
Wertebereich Working mode	15
Wertebereich Documentation mode	16
Wertebereich Process controlled correction.....	16
Wertebereich Processline selection	16
Wertebereich TWIN mode.....	16
Verfügbarkeit der Ausgangssignale	17
Ausgangssignale (vom Schweißgerät zum Roboter).....	17
Zuordnung Sensorstatus 1-4.....	20
Wertebereich Safety status.....	21
Wertebereich Process Bit	21
Wertebereich Function status.....	21

Allgemeines

Sicherheit




WARNUNG!

Gefahr durch Fehlbedienung und fehlerhaft durchgeführte Arbeiten.

Schwere Personen- und Sachschäden können die Folge sein.


- ▶ Alle in diesem Dokument beschriebenen Arbeiten und Funktionen dürfen nur von technisch geschultem Fachpersonal ausgeführt werden.
- ▶ Dieses Dokument vollständig lesen und verstehen.
- ▶ Sämtliche Sicherheitsvorschriften und Benutzerdokumentationen dieses Gerätes und aller Systemkomponenten lesen und verstehen.

Anschlüsse und Anzeigen

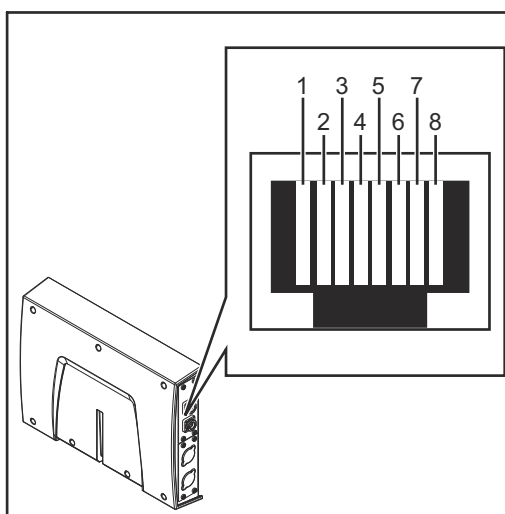

Pin-Belegung RJ 45 ProfiNet Anschluss

1	TX+
2	TX-
3	RX+
6	RX-
4,5,7,8	Normalerweise nicht verwendet; um die Signalfullständigkeit sicherzustellen, sind diese Pins miteinander verbunden und enden über einen Filterkreis am Schutzleiter (PE).

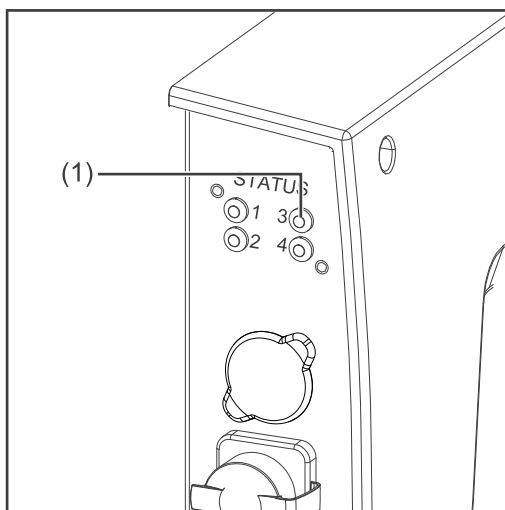

(1) LED MS - Modulstatus

Aus:

keine Versorgungsspannung

Leuchtet grün:

gesteuert durch einen Master

Blinkt grün (einmal):


Master nicht konfiguriert oder im Ruhezustand

Leuchtet rot:

Hauptfehler (Ausnahmezustand, schwerer Fehler, ...)

Blinkt rot:

behebbarer Fehler

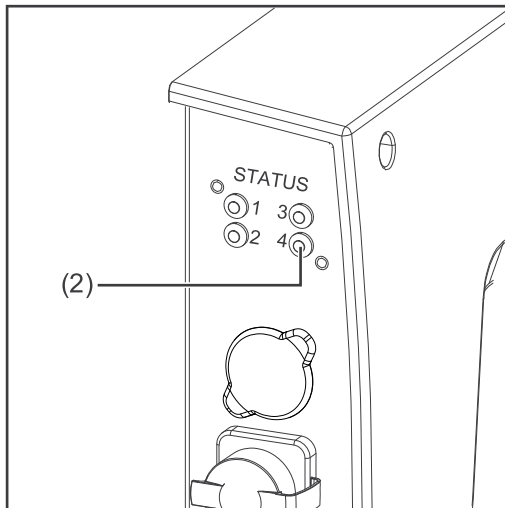

(2) LED NS - Netzwerkstatus

Aus:

keine Versorgungsspannung oder keine IP-Adresse

Leuchtet grün:

Online; eine oder mehrere Verbindungen hergestellt (CIP Kategorie 1 oder 3)

Blinkt grün:

Online; keine Verbindung hergestellt

Leuchtet rot:

doppelte IP-Adresse, schwerer Fehler

Blinkt rot:

Zeitüberlauf bei einer oder mehreren Verbindungen (CIP Kategorie 1 oder 3)

Eigenschaften der Datenübertragung

Übertragungstechnik

Ethernet

Medium

Bei der Auswahl der Kabel und Stecker ist die ODVA Empfehlung für die Planung und Installation von EtherNet/IP Systemen zu beachten.

Seitens Hersteller wurden die EMV-Tests mit dem Kabel IE-C5ES8VG0030-M40M40-F durchgeführt.

Übertragungs-Geschwindigkeit

10 Mbit/s or 100 Mbit/s

Busanschluss

RJ-45 Ethernet / M12

Konfigurationsparameter


Bei einigen Robotersteuerungen kann es erforderlich sein die hier beschriebenen Konfigurationsparameter anzugeben, damit das Busmodul mit dem Roboter kommunizieren kann.

Parameter	Wert	Beschreibung
Vendor ID	0534 _{hex} (1332 _{dez})	Fronius International GmbH
Device Type	000C _{hex} (12 _{dez})	Communication adapter
Product Code	0320 _{hex} (800 _{dez})	Fronius FB Pro Ethernet/IP-2-Port
Product Name	Fronius-FB-Pro-EtherNetIP(TM)	

Image Type	Instance Type	Instance Name	Instance Description	Instance Number	Size [Byte]
Standard Image	Producing Instance	Input Data Standard	Data from power source to robot	100	40
	Consuming Instance	Output Data Standard	Data from robot to power source	150	40
Economy Image	Producing Instance	Input Data Standard	Data from power source to robot	101	16
	Consuming Instance	Output Data Standard	Data from robot to power source	151	16

IP-Adresse des Busmoduls einstellen

IP-Adresse des Busmoduls einstellen

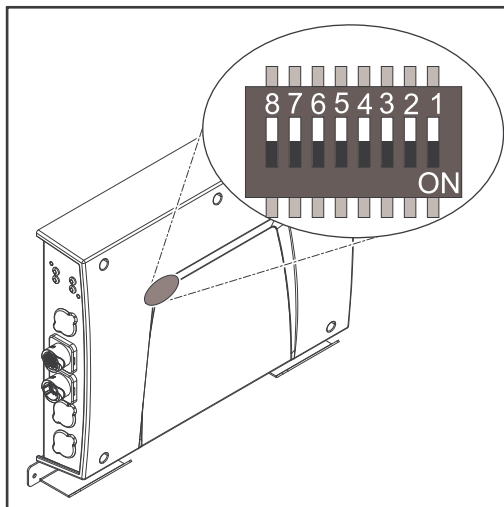

Die IP-Adresse des Busmoduls kann eingestellt werden:

1. mit dem DIP-Schalter im Interface im Bereich 192.168.0.xx (xx = DIP-Schalterstellung = 1 bis 63)
 - Werksseitig sind alle Positionen in Stellung OFF geschaltet. In diesem Fall muss die IP-Adresse auf der Website des Schweißgerätes eingestellt werden
2. auf der Website des Schweißgerätes (wenn alle Positionen des DIP-Schalters in Stellung OFF geschaltet sind)

Die IP-Adresse wird mit den Positionen 1 bis 6 des DIP-Schalters eingestellt. Die Einstellung erfolgt im Binärformat. Das ergibt einen Einstellbereich von 1 bis 63 im Dezimalformat.

Beispiel für das Einstellen der IP-Adresse des Busmoduls mit dem DIP-Schalter im Interface:

DIP-Schalter								IP-Adresse
8	7	6	5	4	3	2	1	
-	-	OFF	OFF	OFF	OFF	OFF	ON	1
-	-	OFF	OFF	OFF	OFF	ON	OFF	2
-	-	OFF	OFF	OFF	OFF	ON	ON	3
-	-	ON	ON	ON	ON	ON	OFF	62
-	-	ON	ON	ON	ON	ON	ON	63

Anleitung für das Einstellen der IP-Adresse auf der Website des Schweißgerätes:

IP-Adresse des verwendeten Schweißgerätes notieren:

- 1 Am Bedienpanel des Schweißgerätes „Voreinstellungen“ auswählen
- 2 Am Bedienpanel des Schweißgerätes „System“ auswählen
- 3 Am Bedienpanel des Schweißgerätes „Information“ auswählen
- 4 Angezeigte IP-Adresse notieren (Beispiel: 10.5.72.13)

Website des Schweißgerätes im Internetbrowser aufrufen:

- 5 Computer mit dem Netzwerk des Schweißgerätes verbinden
- 6 IP-Adresse des Schweißgerätes in die Suchleiste des Internetbrowsers eingeben und bestätigen
- 7 Standard-Benutzernamen (admin) und Passwort (admin) eingeben
 - Website des Schweißgerätes wird angezeigt

IP-Adresse des Busmoduls einstellen:

- 8 Auf der Website des Schweißgerätes den Reiter „RI FB PRO/i“ auswählen

- 9** Bei Punkt „Feldbus Konfiguration“ die gewünschte IP-Adresse für das Interface eingeben
Beispielsweise: 192.168.0.12
- 10** „Konfiguration setzen“ auswählen
- 11** „Feldbus-Modul neu starten“ auswählen
 - die eingestellte IP-Adresse wird übernommen

Ein- und Ausgangssignale

Datentypen

Folgende Datentypen werden verwendet:

- **UINT16** (Unsigned Integer)
Ganzzahl im Bereich von 0 bis 65535
- **SINT16** (Signed Integer)
Ganzzahl im Bereich von -32768 bis 32767

Umrechnungsbeispiele:

- für positiven Wert (SINT16)
z.B. gewünschter Drahtvorschub x Faktor
 $12.3 \text{ m/min} \times 100 = 1230_{\text{dez}} = 04\text{CE}_{\text{hex}}$
- für negativen Wert (SINT16)
z.B. gewünschte Lichtbogen-Korrektur x Faktor
 $-6.4 \times 10 = -64_{\text{dez}} = \text{FFC0}_{\text{hex}}$

Verfügbarkeit der Eingangssi- gnale

Die nachfolgend angeführten Eingangssignale sind ab Firmware V2.0.0 des RI FB PRO/i verfügbar.

Eingangssignale (vom Roboter zum Schweißgerät)

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ			absolut					Standard	Economy
WORD	BYTE	BIT	BIT						
0	0	0	0	Welding Start	steigend			✓	✓
		1	1	Robot ready	High				
		2	2	Working mode Bit 0	High	Siehe Tabelle Wertebereich Working mode auf Seite 15			
		3	3	Working mode Bit 1	High				
		4	4	Working mode Bit 2	High				
		5	5	Working mode Bit 3	High				
		6	6	Working mode Bit 4	High				
		7	7	—					
	1	0	8	Gas on	steigend				
		1	9	Wire forward	steigend				
		2	10	Wire backward	steigend				
		3	11	Error quit	steigend				
		4	12	Touch sensing	High				
		5	13	Torch blow out	steigend				
		6	14	Processline selection Bit 0	High	Siehe Tabelle Wertebereich Processline selection auf Seite 16			
		7	15	Processline selection Bit 1	High				

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ			absolut					Standard	Economy
WORD	BYTE	BIT	BIT						
1	2	0	16	Welding simulation	High			✓	✓
		1	17	<i>Beim Schweißverfahren MIG/MAG: ¹⁾</i>	High				
				Synchro pulse on					
				<i>Beim Schweißverfahren WIG: ²⁾</i>	High				
				TAC on					
		2	18	<i>Beim Schweißverfahren WIG: ²⁾</i>	High				
				Cap shaping					
		3	19	—					
		4	20	—					
	3	5	21	Booster manual	High				
		6	22	Wire brake on	High				
		7	23	Torchbody Xchange	High				
		0	24	—					
		1	25	Teach mode	High				
		2	26	—					
		3	27	—					
		4	28	—					
		5	29	Wire sense start	steigend				
		6	30	Wire sense break	steigend				
		7	31	—					

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ			absolut					Standard	Economy
WORD	BYTE	BIT	BIT						
2	4	0	32	TWIN mode Bit 0	High	Siehe Tabelle Wertebereich TWIN mode auf Seite 16		✓	✓
		1	33	TWIN mode Bit 1	High				
		2	34	—					
		3	35	—					
		4	36	—					
		5	37	Documentation mode	High	Siehe Tabelle Wertebereich Documentation mode auf Seite 16			
		6	38	—					
		7	39	—					
	5	0	40	—					
		1	41	—					
		2	42	—					
		3	43	—					
		4	44	—					
		5	45	—					
		6	46	—					
		7	47	Disable process controlled correction	High				

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ			absolut					Standard	Economy
WORD	BYTE	BIT	BIT						
3	6	0	48	—				✓	✓
		1	49	—					
		2	50	—					
		3	51	—					
		4	52	—					
		5	53	—					
		6	54	—					
		7	55	—					
	7	0	56	ExtInput1 => OPT_Output 1	High				
		1	57	ExtInput2 => OPT_Output 2	High				
		2	58	ExtInput3 => OPT_Output 3	High				
		3	59	ExtInput4 => OPT_Output 4	High				
		4	60	ExtInput5 => OPT_Output 5	High				
		5	61	ExtInput6 => OPT_Output 6	High				
		6	62	ExtInput7 => OPT_Output 7	High				
		7	63	ExtInput8 => OPT_Output 8	High				
4	8-9	0-7	64-79	Welding characteristic- / Job number	UINT16	0 bis 1000	1	✓	✓
5	10 - 11	0-7	80-95	<i>Beim Schweißverfahren MIG/MAG: ¹⁾</i> <i>Constant Wire:</i> Wire feed speed command value	SINT16	-327,68 bis 327,67 [m/min]	100	✓	✓
				<i>Beim Schweißverfahren WIG: ²⁾</i> Main- / Hotwire current command value	UINT16	0 bis 6553,5 [A]	10		
				<i>Beim Job-Betrieb:</i> Power correction	SINT16	-20,00 bis 20,00 [%]	100		

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ			absolut					Standard	Economy
WORD	BYTE	BIT	BIT						
6	12 - 13	0-7	96-111	Beim Schweißverfahren MIG/MAG: ¹⁾ Arclength correction	SINT16	-10,0 bis 10,0 [Schritte]	10	✓	✓
				Beim Schweißverfahren MIG/MAG Standard-Manuell: Welding voltage	UINT16	0,0 bis 6553,5 [V]	10		
				Beim Schweißverfahren WIG: ²⁾ Wire feed speed command value	SINT16	-327,68 bis 327,67 [m/min]	100		
				Beim Job-Betrieb: Arclength correction	SINT16	-10,0 bis 10,0 [Schritte]	10		
				Beim Schweißverfahren Constant Wire: Hotwire current	UINT16	0,0 bis 6553,5 [A]	10		
7	14 - 15	0-7	112-127	Beim Schweißverfahren MIG/MAG: ¹⁾ Pulse-/dynamic correction	SINT16	-10,0 bis 10,0 [Schritte]	10	✓	✓
				Beim Schweißverfahren MIG/MAG Standard-Manuell: Dynamic	UINT16	0,0 bis 10,0 [Schritte]	10		
				Beim Schweißverfahren WIG: ²⁾ Wire correction	SINT16	-10,0 bis 10,0 [Schritte]	10		
8	16 - 17	0-7	128-143	Beim Schweißverfahren MIG/MAG: ¹⁾ Wire retract correction	UINT16	0,0 bis 10,0 [Schritte]	10	ü	
				Beim Schweißverfahren WIG: ²⁾ Wire retract end	UINT16	OFF, 1 TO 50 [mm]	1		
9	18 - 19	0-7	144-159	Welding speed	UINT16	0,0 bis 1000,0 [cm/min]	10	✓	

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ			absolut					Standard	Economy
WORD	BYTE	BIT	BIT						
10	20 - 21	0-7	160-175	Process controlled correction		Siehe Tabelle Wertebereich Process control- led correction auf Seite 16		✓	
11	22 - 23	0-7	176-191	<i>Beim Schweißverfahren WIG: 2)</i> Wire positioning start				✓	
12	24 - 25	0-7	192-207	—				✓	
13	26 - 27	0-7	208-223	—				✓	
14	28 - 29	0-7	224-239	—				✓	
15	30 - 31	0-7	240-255	Wire forward / backward length	UINT16	OFF / 1 bis 65535 [mm]	1	✓	
16	32 - 33	0-7	256-271	Wire sense edge detection	UINT16	OFF / 0,5 bis 20,0 [mm]	10	✓	
17	34 - 35	0-7	272-287	—				✓	
18	36 - 37	0-7	288-303	—				✓	
19	38 - 39	0-7	304-319	Seam number	UINT16	0 bis 65535	1	✓	

- 1) MIG/MAG Puls-Synergic, MIG/MAG Standard-Synergic, MIG/MAG Standard-Manuell, MIG/MAG PMC, MIG/MAG, LSC
2) WIG Kaltdraht, WIG Heißdraht

Wertebereich Working mode

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Beschreibung
0	0	0	0	0	Parameteranwahl intern
0	0	0	0	1	Kennlinien Betrieb Sonder 2-Takt
0	0	0	1	0	Job-Betrieb
0	1	0	0	0	Kennlinien Betrieb 2-Takt

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Beschreibung
0	1	0	0	1	MIG/MAG Standard-Manuell 2-Takt
1	0	0	0	0	Idle Mode
1	0	0	0	1	Kühlmittel-Pumpe stoppen
1	1	0	0	1	R/L-Measurement

Wertebereich Betriebsart

Wertebereich Documentation mode

Bit 0	Beschreibung
0	Nahtnummer von Schweißgerät (intern)
1	Nahtnummer von Roboter (Word 19)

Wertebereich Dokumentationsmodus

Wertebereich Process controlled correction

Prozess	Signal	Aktivität / Datentyp	Wertebereich Einstellbereich	Einheit	Faktor
PMC	Arc length stabilizer	SINT16	-327,8 bis +327,7 0,0 bis +5,0	Volt	10

Wertebereich prozessabhängige Korrektur

Wertebereich Processline selection

Bit 1	Bit 0	Beschreibung
0	0	Prozesslinie 1 (default)
0	1	Prozesslinie 2
1	0	Prozesslinie 3
1	1	Reserviert

Wertebereich Prozesslinien-Auswahl

Wertebereich TWIN mode

Bit 1	Bit 0	Beschreibung
0	0	TWIN Single mode
0	1	TWIN Lead mode
1	0	TWIN Trail mode
1	1	Reserve

Wertebereich TWIN-Betriebsart

**Verfügbarkeit
der Ausgangssi-
gnale**

Die nachfolgend angeführten Ausgangssignale sind ab Firmware V2.0.0 des RI
FB PRO/i verfügbar.

**Ausgangssignale
(vom
Schweißgerät
zum Roboter)**

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess- Image	
relativ			absolut					Standard	Economy
WORD	BYTE	BIT	BIT						
0	0	0	0	Heartbeat Powersource	High/Low	1 Hz		✓	✓
		1	1	Power source ready	High				
		2	2	Warning	High				
		3	3	Process active	High				
		4	4	Current flow	High				
		5	5	Arc stable- / touch signal	High				
		6	6	Main current signal	High				
		7	7	Touch signal	High				
	1	0	8	Collisionbox active	High	0 = Kollisi- on oder Kabel- bruch			
		1	9	Robot motion Release	High				
		2	10	Wire stick workpiece	High				
		3	11	<i>Beim Schweißverfahren WIG: 2)</i> Electrode overload	High				
		4	12	Short circuit contact tip	High				
		5	13	Parameter selection in- ternally	High				
		6	14	Characteristic number valid	High				
		7	15	Torch body gripped	High				

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ			absolut					Standard	Economy
WORD	BYTE	BIT	BIT						
1	2	0	16	Command value out of range	High			✓	✓
		1	17	Correction out of range	High				
		2	18	—					
		3	19	Limitsignal	High				
		4	20	—					
		5	21	Standby active	High				
		6	22	Main supply status	Low				
		7	23	—					
	3	0	24	Sensor status 1	High	Siehe Tabelle Zuordnung Sensorstatus 1-4 auf Seite 20			
		1	25	Sensor status 2	High				
		2	26	Sensor status 3	High				
		3	27	Sensor status 4	High				
		4	28	—					
		5	29	—					
		6	30	—					
		7	31	—					
2	4	0	32	Function status Bit 0	High	Siehe Tabelle Wertebereich Function status auf Seite 21			
		1	33	Function status Bit 1	High				
		2	34	—					
		3	35	Safety status Bit 0	High	Siehe Tabelle Wertebereich Safety status auf Seite 21			
		4	36	Safety status Bit 1	High				
		5	37	—					
		6	38	Notification	High				
		7	39	System not ready	High				
	5	0	40	—					
		1	41	—					
		2	42	<i>Beim Schweißverfahren WIG: 2)</i> Pulse current active	High				
		3	43	—					
		4	44	Process run	High				
		5	45	—					
		6	46	Active processline Bit 0	High				
		7	47	Active processline Bit 1	High				

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ			absolut					Standard	Economy
WORD	BYTE	BIT	BIT						
3	6	0	48	Process Bit 0	High	Siehe Tabelle Wertebereich Process Bit auf Seite 21		✓	✓
		1	49	Process Bit 1	High				
		2	50	Process Bit 2	High				
		3	51	Process Bit 3	High				
		4	52	Process Bit 4	High				
		5	53	—					
		6	54	Touch signal gas nozzle	High				
		7	55	TWIN synchronization active	High				
	7	0	56	ExtOutput1 <= OPT_Input1	High				
		1	57	ExtOutput2 <= OPT_Input2	High				
		2	58	ExtOutput3 <= OPT_Input3	High				
		3	59	ExtOutput4 <= OPT_Input4	High				
		4	60	ExtOutput5 <= OPT_Input5	High				
		5	61	ExtOutput6 <= OPT_Input6	High				
		6	62	ExtOutput7 <= OPT_Input7	High				
		7	63	ExtOutput8 <= OPT_Input8	High				
4	8-9	0-7	64-79	Welding voltage	UINT16	0,0 bis 655,35 [V]	100	✓	✓
5	10 - 11	0-7	80-95	Welding current	UINT16	0,0 bis 6553,5 [A]	10	✓	✓
6	12 - 13	0-7	96-111	Wire feed speed	SINT16	-327,68 bis 327,67 [m/min]	100	✓	✓
7	14 - 15	0-7	112-27	Actual real value for seam tracking	UINT16	0 bis 6,5535	10000	✓	✓
8	16 - 17	0-7	128-143	Error number	UINT16	0 bis 65535	1	✓	
9	18 - 19	0-7	144-159	Warning number	UINT16	0 bis 65535	1	✓	

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ			absolut					Standard	Economy
WORD	BYTE	BIT	BIT						
10	20 - 21	0-7	160-175	Motor current M1	SINT16	-327,68 bis 327,67 [A]	100	✓	
11	22 - 23	0-7	176-191	Motor current M2	SINT16	-327,68 bis 327,67 [A]	100	✓	
12	24 - 25	0-7	192-207	Motor current M3	SINT16	-327,68 bis 327,67 [A]	100	✓	
13	26 - 27	0-7	208-223	Beim Schweißverfahren WIG: ²⁾ Actual real value AVC	UINT16	0 to 655,35 [V]	100	✓	
14	28 - 29	0-7	224-239	—				✓	
15	30 - 31	0-7	240-255	Resistance	UINT16	0,0 to +400,0 [mOhm]	10	✓	
16	32 - 33	0-7	256-271	Wire position	SINT16	-327,68 bis 327,67 [mm]	100	✓	
17	34 - 35	0-7	272-287	Wire buffer level (nur RI FB PRO/i)	SINT16	-100 bis 100 [%]	1	✓	
18	36 - 37	0-7	288-303	—				✓	
19	38 - 39	0-7	304-319	—				✓	

- 1) MIG/MAG Puls-Synergic, MIG/MAG Standard-Synergic, MIG/MAG Standard-Manuell, MIG/MAG PMC, MIG/MAG, LSC
- 2) WIG Kaltdraht, WIG Heißdraht

Zuordnung Sensorstatus 1-4

Signal	Beschreibung
Sensor status 1	OPT/i WF R Drahtende (4,100,869)
Sensor status 2	OPT/i WF R Drahtfass (4,100,879)
Sensor status 3	OPT/i WF R Ringsensor (4,100,878)
Sensor status 4	Drahtpufferset CMT TPS/i (4,001,763)

Zuordnung Sensorstatus

**Wertebereich
Safety status**

Bit 1	Bit 0	Beschreibung
0	0	Reserve
0	1	Halt
1	0	Stopp
1	1	Nicht eingebaut / aktiv

Wertebereich Safety status

**Wertebereich
Process Bit**

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Beschreibung
0	0	0	0	0	kein Prozess oder Parameteranwahl intern
0	0	0	0	1	MIG/MAG Puls-Synergic
0	0	0	1	0	MIG/MAG Standard-Synergic
0	0	0	1	1	MIG/MAG PMC
0	0	1	0	0	MIG/MAG LSC
0	0	1	0	1	MIG/MAG Standard-Manuell
0	0	1	1	0	Elektrode
0	0	1	1	1	WIG
0	1	0	0	0	CMT
0	1	0	0	1	ConstantWire
0	1	0	1	0	ColdWire
0	1	0	1	1	DynamicWire

Wertebereich Process Bit

**Wertebereich
Function status**

Bit 1	Bit 0	Beschreibung
0	0	Inactive
0	1	Idle
1	0	Finished
1	1	Error

Wertebereich Funktionsstatus

Table of contents

General.....	24
Safety.....	24
Connections and Displays.....	24
Data Transfer Properties.....	25
Configuration Parameters.....	25
Setting the Bus Module IP Address.....	27
Setting the Bus Module IP Address.....	27
Input and output signals.....	29
Data types.....	29
Availability of input signals.....	29
Input signals (from robot to power source).....	29
Value Range for Working Mode.....	35
Value Range for Documentation Mode.....	36
Value range for Process controlled correction.....	36
Value range Process line selection.....	36
Value Range for TWIN Mode.....	36
Availability of the output signals.....	37
Output Signals (from Power Source to Robot).....	37
Assignment of Sensor Statuses 1–4.....	40
Value range Safety status.....	41
Value Range for Process Bit.....	41
Value Range for Function status.....	41

General

Safety




WARNING!

Danger from incorrect operation and work that is not carried out properly.

This can result in serious personal injury and damage to property.


- ▶ All the work and functions described in this document must only be carried out by technically trained and qualified personnel.
- ▶ Read and understand this document in full.
- ▶ Read and understand all safety rules and user documentation for this equipment and all system components.

Connections and Displays

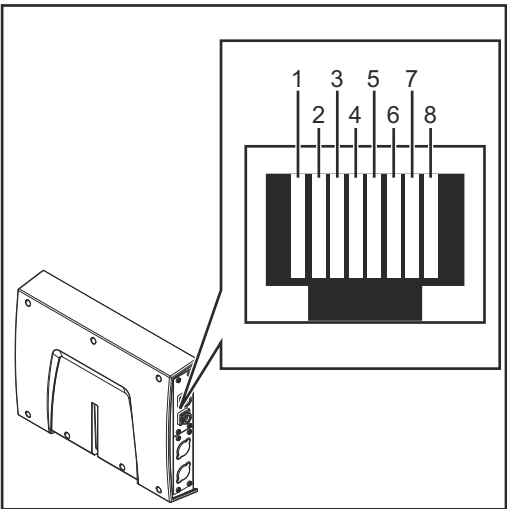


RJ45 connection

1	TX+
2	TX-
3	RX+
6	RX-
4,5,7,8	Not normally used; to ensure signal completeness, these pins must be interconnected and, after passing through a filter circuit, must terminate at the ground conductor (PE).

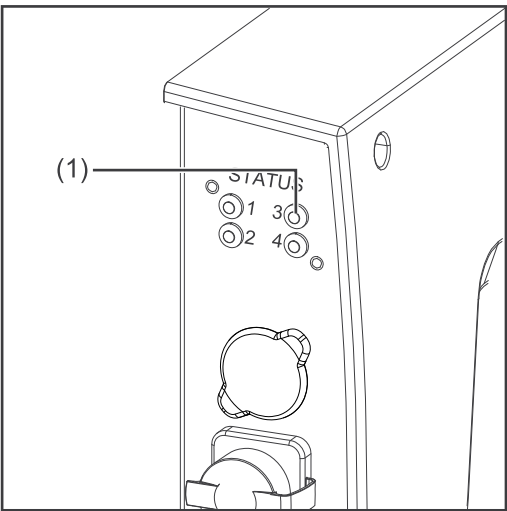

(1) LED MS - Module status	
Off:	No supply voltage
Lights up green:	Controlled by a master
Flashes green (once):	Master not configured or master idle
Lights up red:	Major error (exception state, serious fault, ...)
Flashes red:	Correctable error

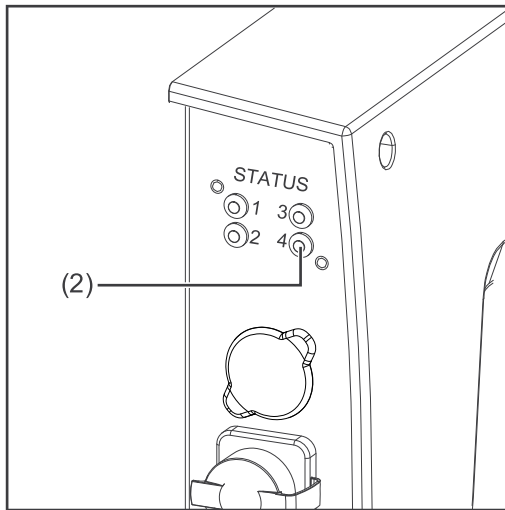

(2) LED NS - Network status

Off:

No supply voltage or no IP address

Lights up green:

Online, one or more connections established (CIP category 1 or 3)

Flashes green:

Online, no connection established

Lights up red:

Double IP address, serious error

Flashes red:

Overrun of time for one or more connections (CIP category 1 or 3)

Data Transfer Properties

Transfer technology
Ethernet

Medium

When selecting the cables and plugs, the ODVA recommendation for the planning and installation of EtherNet/IP systems must be observed.

The EMC tests were carried out by the manufacturer with the cable IE-C5ES8VG0030M40M40-F.

Transmission speed

10 Mbit/s or 100 Mbit/s

Bus connection

RJ-45 Ethernet / M12

Configuration Parameters

In some robot control systems, it may be necessary to state the configuration parameters described here so that the bus module can communicate with the robot.


Parameter	Value	Description
Vendor ID	0534 _{hex} (1332 _{dec})	Fronius International GmbH
Device Type	000C _{hex} (12 _{dec})	Communication adapter
Product Code	0320 _{hex} (800 _{dec})	Fronius FB Pro Ethernet/IP-2-Port
Product Name	Fronius-FB-Pro-EtherNetIP(TM)	

Image Type	Instance Type	Instance Name	Instance Description	Instance Number	Size [Byte]
Standard Image	Producing Instance	Input Data Standard	Data from power source to robot	100	40

Image Type	Instance Type	Instance Name	Instance Description	Instance Number	Size [Byte]
	Consuming Instance	Output Data Standard	Data from robot to power source	150	40
Economy Image	Producing Instance	Input Data Standard	Data from power source to robot	101	16
	Consuming Instance	Output Data Standard	Data from robot to power source	151	16

Setting the Bus Module IP Address

Setting the Bus Module IP Address

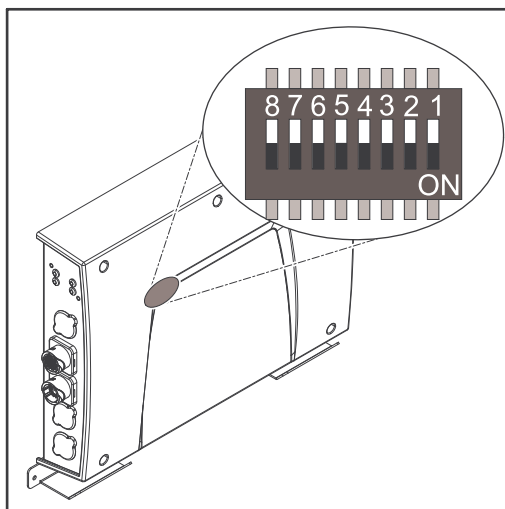

You can set the bus module IP address as follows:

- Using the DIP switch in the interface within the range defined by 192.168.0.xx (xx = DIP switch setting = 1 to 63)
 - All positions are set to the OFF position at the factory. In this case, the IP address must be set on the website of the welding machine
- On the website of the welding machine (if all positions of the DIP switch are set to the OFF position)

The IP address is set using DIP switch positions 1 to 6. The configuration is carried out in binary format. This results in a configuration range of 1 to 63 in decimal format.

Example for setting the IP address of the bus module using the DIP switch in the interface:

Dip switch								IP address
8	7	6	5	4	3	2	1	
-	-	OFF	OFF	OFF	OFF	OFF	ON	1
-	-	OFF	OFF	OFF	OFF	ON	OFF	2
-	-	OFF	OFF	OFF	OFF	ON	ON	3
-	-	ON	ON	ON	ON	ON	OFF	62
-	-	ON	ON	ON	ON	ON	ON	63

Instructions for setting the IP address on the website of the welding machine:

Note down the IP address of the welding machine used:

- On the welding machine control panel, select "Defaults"
- On the welding machine control panel, select "System"
- On the welding machine control panel, select "Information"
- Note down the displayed IP address (example: 10.5.72.13)

Access website of the welding machine in the internet browser:

- Connect the computer to the network of the welding machine
- Enter the IP address of the welding machine in the search bar of the internet browser and confirm
- Enter the standard user name (admin) and password (admin)
 - The website of the power source is displayed

Set the bus module IP address:

- On the power welding machine, select the "RI FB PRO/i" tab

- 9** Enter the desired IP address for the interface under "Module configuration".
For example: 192.168.0.12
- 10** Select "Set configuration"
- 11** Select "Restart module"
 - The set IP address is applied

Input and output signals

Data types

The following data types are used:

- **UINT16** (Unsigned Integer)
Whole number in the range from 0 to 65535
- **SINT16** (Signed Integer)
Whole number in the range from -32768 to 32767

Conversion examples:

- for a positive value (SINT16)
e.g. desired wire speed x factor
 $12.3 \text{ m/min} \times 100 = 1230_{\text{dec}} = 04\text{CE}_{\text{hex}}$
- for a negative value (SINT16)
e.g. arc correction x factor
 $-6.4 \times 10 = -64_{\text{dec}} = \text{FFC0}_{\text{hex}}$

Availability of input signals

The input signals listed below are available from firmware V2.0.0 of the RI FB PRO/i onwards.

Input signals (from robot to power source)

Address				Signal	Activity / data type	Range	Factor	Process image	
Relative			Absolu- te					Standard	Economy
WORD	BYTE	BIT	BIT						
0	0	0	0	Welding Start	Increa- sing			✓	✓
		1	1	Robot ready	High				
		2	2	Working mode Bit 0	High	See table Value Range for Working Mode on page 35			
		3	3	Working mode Bit 1	High				
		4	4	Working mode Bit 2	High				
		5	5	Working mode Bit 3	High				
		6	6	Working mode Bit 4	High				
		7	7	—					
	1	0	8	Gas on	Increa- sing				
		1	9	Wire forward	Increa- sing				
		2	10	Wire backward	Increa- sing				
		3	11	Error quit	Increa- sing				
		4	12	Touch sensing	High				
		5	13	Torch blow out	Increa- sing				
		6	14	Processline selection Bit 0	High	See table Value range Process li- ne selection on page 36			
		7	15	Processline selection Bit 1	High				

Address				Signal	Activity / data type	Range	Factor	Process image	
Relative			Absolu- te					Standard	Economy
WORD	BYTE	BIT	BIT						
1	2	0	16	Welding simulation	High			✓	✓
		1	17	Welding process MIG/MAG: ¹⁾	High				
				Synchro pulse on					
				Welding process WIG: ²⁾	High				
				TAC on					
		2	18	Welding process WIG: ²⁾	High				
				Cap shaping					
		3	19	—					
		4	20	—					
	3	5	21	Booster manual	High				
		6	22	Wire brake on	High				
		7	23	Torchbody Xchange	High				
		0	24	—					
		1	25	Teach mode	High				
		2	26	—					
		3	27	—					
		4	28	—					
		5	29	Wire sense start	Increa- sing				
		6	30	Wire sense break	Increa- sing				
		7	31	—					

Address				Signal	Activity / data type	Range	Factor	Process image	
Relative			Absolu- te					Standard	Economy
WORD	BYTE	BIT	BIT						
2	4	0	32	TWIN mode Bit 0	High	See table Value Range for TWIN Mode on page 36		✓	✓
		1	33	TWIN mode Bit 1	High				
		2	34	—					
		3	35	—					
		4	36	—					
		5	37	Documentation mode	High	See table Value Range for Documentation Mode on page 36			
		6	38	—					
		7	39	—					
	5	0	40	—					
		1	41	—					
		2	42	—					
		3	43	—					
		4	44	—					
		5	45	—					
		6	46	—					
		7	47	Disable process controlled correction	High				

Address				Signal	Activity / data type	Range	Factor	Process image	
Relative			Absolute					Standard	Economy
WORD	BYTE	BIT	BIT						
3	6	0	48	—				✓	✓
		1	49	—					
		2	50	—					
		3	51	—					
		4	52	—					
		5	53	—					
		6	54	—					
		7	55	—					
	7	0	56	ExtInput1 => OPT_Output 1	High				
		1	57	ExtInput2 => OPT_Output 2	High				
		2	58	ExtInput3 => OPT_Output 3	High				
		3	59	ExtInput4 => OPT_Output 4	High				
		4	60	ExtInput5 => OPT_Output 5	High				
		5	61	ExtInput6 => OPT_Output 6	High				
		6	62	ExtInput7 => OPT_Output 7	High				
		7	63	ExtInput8 => OPT_Output 8	High				
4	8-9	0-7	64-79	Welding characteristic- / Job number	UINT16	0 to 1000	1	✓	✓
5	10 - 11	0-7	80-95	<i>Welding process MIG/MAG: ¹⁾</i> <i>Constant Wire:</i> Wire feed speed command value	SINT16	-327,68 to 327,67 [m/min]	100	✓	✓
				<i>Welding process WIG: ²⁾</i> Main- / Hotwire current command value	UINT16	0 to 6553,5 [A]	10		
				<i>For job-mode:</i> Power correction	SINT16	-20,00 to 20,00 [%]	100		

Address				Signal	Activity / data type	Range	Factor	Process image	
Relative			Absolute					Standard	Economy
WORD	BYTE	BIT	BIT						
6	12 - 13	0-7	96-111	Welding process MIG/MAG: ¹⁾ Arclength correction	SINT16	-10,0 to 10,0 [Schritte]	10	✓	✓
				Welding process MIG/MAG Standard-Manuel: Welding voltage	UINT16	0,0 to 6553,5 [V]	10		
				Welding process WIG: ²⁾ Wire feed speed command value	SINT16	-327,68 to 327,67 [m/min]	100		
				For job-mode: Arclength correction	SINT16	-10,0 to 10,0 [Schritte]	10		
				Welding process Constant Wire: Hotwire current	UINT16	0,0 to 6553,5 [A]	10		
7	14 - 15	0-7	112-127	Welding process MIG/MAG: ¹⁾ Pulse-/dynamic correction	SINT16	-10,0 to 10,0 [steps]	10	✓	✓
				Welding process MIG/MAG Standard-Manuel: Dynamic	UINT16	0,0 to 10,0 [steps]	10		
				Welding process WIG: ²⁾ Wire correction	SINT16	-10,0 to 10,0 [steps]	10		
8	16 - 17	0-7	128-143	Welding process MIG/MAG: ¹⁾ Wire retract correction	UINT16	0,0 to 10,0 [steps]	10	ü	
				Welding process WIG: ²⁾ Wire retract end	UINT16	OFF, 1 to 50 [mm]	1		
9	18 - 19	0-7	144-159	Welding speed	UINT16	0,0 to 1000,0 [cm/min]	10	✓	

Address				Signal	Activity / data type	Range	Factor	Process image	
Relative			Absolu- te					Standard	Economy
WORD	BYTE	BIT	BIT						
10	20 - 21	0-7	160-175	Process controlled correction		See table Value range for Process controlled correction on page 36		✓	
11	22 - 23	0-7	176-191	Welding process WIG: ²⁾ Wire positioning start				✓	
12	24 - 25	0-7	192-207	—				✓	
13	26 - 27	0-7	208-223	—				✓	
14	28 - 29	0-7	224-239	—				✓	
15	30 - 31	0-7	240-255	Wire forward / backward length	UINT16	OFF / 1 to 65535 [mm]	1	✓	
16	32 - 33	0-7	256-271	Wire sense edge detection	UINT16	OFF / 0,5 to 20,0 [mm]	10	✓	
17	34 - 35	0-7	272-287	—				✓	
18	36 - 37	0-7	288-303	—				✓	
19	38 - 39	0-7	304-319	Seam number	UINT16	0 to 65535	1	✓	

- 1) MIG/MAG Puls-Synergic, MIG/MAG Standard-Synergic, MIG/MAG Standard-Manuel, MIG/MAG PMC, MIG/MAG, LSC
- 2) WIG coldwire, WIG hotwire

Value Range for Working Mode

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Description
0	0	0	0	0	Internal parameter selection
0	0	0	0	1	Special 2-step mode characteristics
0	0	0	1	0	Job mode

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Description
0	1	0	0	0	2-step mode characteristics
0	1	0	0	1	2-step MIG/MAG standard manual
1	0	0	0	0	Idle Mode
1	0	0	0	1	Stop coolant pump
1	1	0	0	1	R/L-Measurement

Value range for operating mode

Value Range for Documentation Mode

Bit 0	Description
0	Seam number of welding machine (internal)
1	Seam number of robot (Word 19)

Value range for documentation mode

Value range for Process controlled correction

Process	Signal	Activity / data type	Value range configuration range	Unit	Factor
PMC	Arc length stabilizer	SINT16	-327.8 to +327.7 0.0 to +5.0	Volts	10

Value range for process-dependent correction

Value range Process line selection

Bit 1	Bit 0	Description
0	0	Process line 1 (default)
0	1	Process line 2
1	0	Process line 3
1	1	Reserved

Value range for process line selection

Value Range for TWIN Mode

Bit 1	Bit 0	Description
0	0	TWIN Single mode
0	1	TWIN Lead mode
1	0	TWIN Trail mode
1	1	Reserved

Value range for TWIN mode

Availability of the output signals

The output signals listed below are available from firmware V2.0.0 of the RI FB PRO/i onwards.

**Output Signals
(from Power Source to Robot)**

Address				Signal	Activity / data type	Range	Factor	Process image	
relative			absolute					Standard	Economy
WORD	BYTE	BIT	BIT						
0	0	0	0	Heartbeat Powersource	High/Low	1 Hz		✓	✓
		1	1	Power source ready	High				
		2	2	Warning	High				
		3	3	Process active	High				
		4	4	Current flow	High				
		5	5	Arc stable- / touch signal	High				
		6	6	Main current signal	High				
		7	7	Touch signal	High				
	1	0	8	Collisionbox active	High	0 = collision or cable break			
		1	9	Robot Motion Release	High				
		2	10	Wire stick workpiece	High				
		3	11	—					
		4	12	Short circuit contact tip	High				
		5	13	Parameter selection internally	High				
		6	14	Characteristic number valid	High				
		7	15	Torch body gripped	High				

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute	Standard					Economy	
WORD	BYTE	BIT							BIT
1	2	0	16	Command value out of range	High			✓	✓
		1	17	Correction out of range	High				
		2	18	—					
		3	19	Limitsignal	High				
		4	20	—					
		5	21	—					
		6	22	Main supply status	Low				
		7	23	—					
	3	0	24	Sensor status 1	High	See table Assign- ment of Sensor Sta- tuses 1–4 on page 40			
		1	25	Sensor status 2	High				
		2	26	Sensor status 3	High				
		3	27	Sensor status 4	High				
		4	28	—					
		5	29	—					
		6	30	—					
7		31	—						
2	4	0	32	—				✓	✓
		1	33	—					
		2	34	—					
		3	35	Safety status Bit 0	High	See table Value ran- ge Safety status on page 41			
		4	36	Safety status Bit 1	High				
		5	37	—					
		6	38	Notification	High				
		7	39	System not ready	High				
	5	0	40	—					
		1	41	—					
		2	42	—					
		3	43	—					
		4	44	—					
		5	45	—					
		6	46	—					
		7	47	—					

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute	Standard					Economy	
WORD	BYTE	BIT							BIT
3	6	0	48	Process Bit 0	High	See table Value Range for Process Bit on page 41		✓	✓
		1	49	Process Bit 1	High				
		2	50	Process Bit 2	High				
		3	51	Process Bit 3	High				
		4	52	Process Bit 4	High				
		5	53	—					
		6	54	Touch signal gas nozzle	High				
		7	55	TWIN synchronization active	High				
	7	0	56	ExtOutput1 <= OPT_Input1	High				
		1	57	ExtOutput2 <= OPT_Input2	High				
		2	58	ExtOutput3 <= OPT_Input3	High				
		3	59	ExtOutput4 <= OPT_Input4	High				
		4	60	ExtOutput5 <= OPT_Input5	High				
		5	61	ExtOutput6 <= OPT_Input6	High				
		6	62	ExtOutput7 <= OPT_Input7	High				
		7	63	ExtOutput8 <= OPT_Input8	High				
4	8-9	0-7	64-79	Welding voltage	UINT16	0.0 to 655.35 [V]	100	✓	✓
5	10 - 11	0-7	80-95	Welding current	UINT16	0.0 to 6553.5 [A]	10	✓	✓
6	12 - 13	0-7	96-111	Wire feed speed	SINT16	-327.68 to 327.67 [m/min]	100	✓	✓
7	14 - 15	0-7	112-127	Actual real value for seam tracking	UINT16	0 to 6.5535	10000	✓	✓
8	16 - 17	0-7	128-143	Error number	UINT16	0 to 65535	1	✓	
9	18 - 19	0-7	144-159	Warning number	UINT16	0 to 65535	1	✓	

Address				Signal	Activity / data type	Range	Factor	Process image	
relative			absolute					Standard	Economy
WORD	BYTE	BIT	BIT						
10	20 - 21	0-7	160-175	Motor current M1	SINT16	-327.68 to 327.67 [A]	100	✓	
11	22 - 23	0-7	176-191	Motor current M2	SINT16	-327.68 to 327.67 [A]	100	✓	
12	24 - 25	0-7	192-207	Motor current M3	SINT16	-327.68 to 327.67 [A]	100	✓	
13	26 - 27	0-7	208-223	—				✓	
14	28 - 29	0-7	224-239	—				✓	
15	30 - 31	0-7	240-255	—				✓	
16	32 - 33	0-7	256-271	Wire position	SINT16	-327.68 to 327.67 [mm]	100	✓	
17	34 - 35	0-7	272-287	—				✓	
18	36 - 37	0-7	288-303	—				✓	
19	38 - 39	0-7	304-319	—				✓	

Assignment of Sensor Statuses 1–4

Signal	Description
Sensor status 1	OPT/i WF R wire end (4,100,869)
Sensor status 2	OPT/i WF R wire drum (4,100,879)
Sensor status 3	OPT/i WF R ring sensor (4,100,878)
Sensor status 4	Wire buffer set CMT TPS/i (4,001,763)

Assignment of sensor statuses

**Value range
Safety status**

Bit 1	Bit 0	Description
0	0	Reserve
0	1	Hold
1	0	Stop
1	1	Not installed / active

Value range Safety status

**Value Range for
Process Bit**

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Description
0	0	0	0	0	No internal parameter selection or process
0	0	0	0	1	MIG/MAG pulse synergic
0	0	0	1	0	MIG/MAG standard synergic
0	0	0	1	1	MIG/MAG PMC
0	0	1	0	0	MIG/MAG LSC
0	0	1	0	1	MIG/MAG standard manual
0	0	1	1	0	Electrode
0	0	1	1	1	TIG
0	1	0	0	0	CMT
0	1	0	0	1	ConstantWire
0	1	0	1	0	ColdWire
0	1	0	1	1	DynamicWire

Value Range for Process Bit

**Value Range for
Function status**

Bit 1	Bit 0	Description
0	0	Inactive
0	1	Idle
1	0	Finished
1	1	Error

Value range for function status



Fronius International GmbH

Froniusstraße 1
4643 Pettenbach
Austria
contact@fronius.com
www.fronius.com

At www.fronius.com/contact you will find the contact details
of all Fronius subsidiaries and Sales & Service Partners.