

Instruction Sheet

318-865-1711 800-551-8633 WWW.FRYMASTER.COM

EMAIL: FRYSERVICE@FRYMASTER.COM

Subject: UHCTHD Software Update Instructions Models affected: UHCTHD Holding Cabinets 9.16.2025

Follow these instructions to update the software.

- 1. With the cabinet powered up and fully booted up, press the button. Press the button. Swipe one (1) time to the right to **Utilities**.
- 2. With **Utilities** displayed at the top of the screen, press the button in the lower left corner of the screen.
- 3. Enter **159357**. The lock icon will change to unlocked **.**.
- 4. Press the **Platform Info** button in the bottom left corner.
- 5. The **BSP Package** version should be **v 6.05**; **03-04-2020**. If the BSP version is v 6.05 or higher, proceed to the next step. If the BSP version is less than v 6.05, new SD cards <u>MUST</u> be ordered and installed in both touch screen controllers. If new SD cards are not available, <u>STOP and DO NOT PROCEED!</u> Order the kit that corresponds to the cabinet type.

6-row Double Sided cabinets - PN 8263680 6-row Single Sided cabinets - PN 8263707 3-row Double Sided cabinets - PN 8263705 3-row Single Sided cabinets - PN 8263706

- 6. Press Close.
- 7. Press the button.

Press

- 8. Press the *Go button.
- 9. With the cabinet powered up and fully booted up, slide the USB cover open and insert the USB drive in the front of the

cabinet (see Figure 1).

- 10. After a few minutes the software update will start (see Figure 2).
- 11. During the software update, the rear controller will show a secondary communication error. This is normal during the software update.
- 12. When the software update is complete the controller displays **Software update successful. Unplug USB and reboot the unit** when complete (see Figure 3).
- 13. Remove the USB from the front of the cabinet.
- 14. Power cycle the entire cabinet.



Figure 1

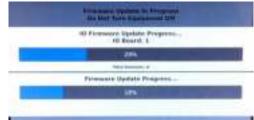


Figure 2

Software update successful.
Unplug USB and reboot the unit

Figure 3





- 15. Press the button. Press the button. Swipe two times to the right to **System Information**. Verify the UI software version is **UX-2605** and the IO software version should be **0.5.0** (see Figure 4) on both displays.
- 16. Press the button.
- Press
 17. Press the *Go button.
- 18. After loading the software, it may be necessary to load country specific menus.

| Board | Version |
|--------------|---------|
| UI (Primary) | UX-2605 |
| I/O board | 0.5.0 |

Figure 4

- 19. Press the fine button.
- 20. Press the button.
- 21. Press the button in bottom left corner.
- 22. Enter 159357 and press the

 ✓ button.
- 23. Press and hold button for three (3) seconds.
- 24. Scroll to the desired country menu and with it highlighted, press the

 ✓ button.
- 25. When the menu file is imported, press the button.
- 26. Press the button to exit.