


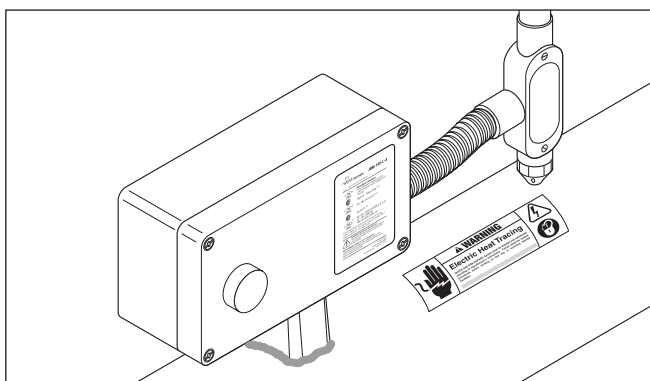

RAYCHEM

JBM-100-L-A

Installation Instructions



APPROVALS

Hazardous Locations



Class I, Div. 2, Groups A, B, C, D
Class II, Div. 2, Groups E, F, G
Class III
CL I, ZN1, AEx em II T* (1)



(JBM-100-L-A only) Ex eb mb IIC T* Gb (2)

IECEx

JBM-100-L-A is IECEx certified for use with:
BTVC-CR/BTV-CT: IECEx BAS 20.0011X
QTVR-CT: IECEx BAS 20.0013X
XTV-CT: IECEx BAS 20.0012X
KTV-CT: IECEx BAS 20.0014X
HTV-CT: IECEx PTB 21.0007X
VPL-CT: IECEx BAS 20.0008X



Class I Division 2 (Zone 2**), Groups A, B, C, D
Class I Zone 2 IIC

Ex eb mb IIC T* Gb; Class I Zone 1 AEx eb mb IIC T* Gb
Ex mb tb IIIC T**C Db; Zone 21 AEx mb tb IIIC T**C Db

* For system Temperature Code, see heating cable or design documentation

(1) Except VPL, HTV (FM approval only)

(2) Except KTV-CT

(3) For HTV-CT only ** Per CE Code Table 18

KIT CONTENTS

Item	Qty	Description
A	1	Stand assembly
B	2	Grommet plugs
C	1	Box plug, o-ring, and locknut
D	1	Cable lubricant
E	3	Core sealers
F	3	Green/yellow tubes
G	1	Box with terminal blocks
H	1	Lid
I	1	Spanner
J	1	Strain relief
K	1	JBL-100-R Plug-in module

Power Connection, Powered Splice, Powered Tee, Dual Power Connection, Splice or Tee with Junction Box and Light

DESCRIPTION

The nVent RAYCHEM JBM-100-L-A is a Type 4X-rated connection kit. It is designed for use with nVent RAYCHEM BTVC-CR, BTV-CT, QTVR-CT, XTV-CT, KTV-CT, HTV-CT and VPL-CT industrial parallel heating cables. The kit can be used to connect one, two, or three heating cables to power, to connect two separate heat-trace circuits, or to splice or tee up to three heating cables. The kit includes a plug-in light module that indicates when power is supplied to the heating cable circuit.

Note: For two or more heating cables powered by a single circuit, the length of each heating cable should not exceed the maximum allowable circuit length published in the nVent RAYCHEM self-regulating cables design guide and the total current of all heating cables on the circuit should equal no more than 80% of the circuit breaker current rating.

This kit may be installed at temperatures as low as -40°F (-40°C). For easier installation store above freezing until just before installation.

For technical support call nVent at (800) 545-6258.

TOOLS REQUIRED


- Wire cutters
- Adjustable pliers
- Needle nose pliers
- Utility knife
- 1/4 in or smaller slotted screwdriver
- Marking pen
- Wire stripper (for VPL-CT)
- Large slotted screwdriver
- 3/8 in hex key (required for splice and tee connections)

ADDITIONAL MATERIALS REQUIRED

- Pipe strap
- GT-66 or GS-54 glass cloth tape

OPTIONAL MATERIALS

- Recommended conduit drain: JB-DRAIN-PLUG-3/4IN P/N 278621-000
- Small pipe adapter for 1 in (25 mm) and smaller pipes: Catalog number JBM-SPA P/N D55673-000

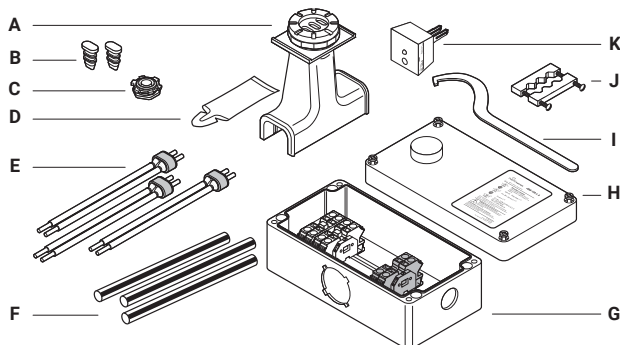

⚠ WARNING:

This component is an electrical device that must be installed correctly to ensure proper operation and to prevent shock or fire. Read these important warnings and carefully follow all of the installation instructions.

- To minimize the danger of fire from sustained electrical arcing if the heating cable is damaged or improperly installed, and to comply with the requirements of nVent, agency certifications, and national electrical codes, ground-fault equipment protection must be used. Arcing may not be stopped by conventional circuit breakers.
- The power connection may be powered by more than one circuit. Be sure all power sources are de-energized before opening box.

- Component approvals and performance are based on the use of nVent-specified parts only. Do not use substitute parts or vinyl electrical tape.
- The black heating cable core and fibers are conductive and can short. They must be properly insulated and kept dry.
- Damaged bus wires can overheat or short. Do not break bus wire strands when scoring the jacket or core.
- Keep components and heating cable ends dry before and during installation.
- Use only fire-resistant insulation materials, such as fiberglass wrap or flame-retardant foam.

⚠ AVERTISSEMENT :

Ce composant électrique doit être installé correctement pour éviter les risques d'incendie ou de chocs électriques. Lire ces avertissements importants et suivre attentivement toutes les instructions d'installation.

- Pour réduire le danger d'incendie causé par un arc électrique entretenu, si le câble chauffant est endommagé ou mal installé, et pour respecter les exigences de nVent et celles des codes applicables, il est impératif d'utiliser une protection par disjoncteur différentiel. Les disjoncteurs ordinaires ne sont pas toujours capables de supprimer les arcs électriques.
- Les approbations et les performances des composants sont basées sur l'utilisation des pièces nVent spécifiées seulement. N'utilisez pas de pièces de rechange ou de ruban isolant en vinyle.

- Le noyau et les fibres du câble chauffant noir sont conducteurs et peuvent provoquer un court-circuit. Ils doivent être correctement isolés et gardés à sec.
- Les fils omnibus endommagés peuvent surchauffer ou subir un court-circuit.
- Ne brisez jamais les fils omnibus lorsque vous incisez la gaine ou le noyau.
- Maintenez les composants et les extrémités des câbles chauffants secs avant et pendant l'installation.
- Les fils omnibus peuvent provoquer un court-circuit s'ils se touchent. Les garder à l'écart les uns des autres
- N'utilisez que des matériaux isolants ininflammables, par exemple une gaine de fibre de verre ou de la mousse ignifuge.
- Laissez ces instructions d'installation à l'utilisateur pour qu'il puisse les consulter.

⚠ CAUTION:

HEALTH HAZARD: Prolonged or repeated contact with the sealant in the core sealer may cause skin irritation. Wash hands thoroughly. Overheating or burning the sealant will produce fumes that may cause polymer fume fever. Avoid contamination of cigarettes or tobacco. Consult MSDS VEN 0058 for further information.

CHEMTREC 24-hour emergency telephone: (800) 424-9300
Non-emergency health and safety information: (800) 545-6258.

⚠ MISE EN GARDE :


Danger pour la santé : Le contact prolongé ou répété avec le produit d'étanchéité du noyau peut provoquer une irritation de la peau. Lavez-vous les mains soigneusement. La surchauffe et la combustion du produit d'étanchéité produira des vapeurs qui peuvent causer la fièvre des vapeurs de polymères. Évitez la contamination des cigarettes ou du tabac. Consultez la fiche technique santé-sécurité (FTSS) VEN 0058 pour obtenir de plus amples informations.

Téléphone en cas d'urgence 24 heures sur 24 de CHEMTREC : (800) 424-9300


Renseignements non urgents en matière de santé et de sécurité : (800) 545-6258

HEATING CABLE TYPES


- Determine heating cable type and continue as shown.

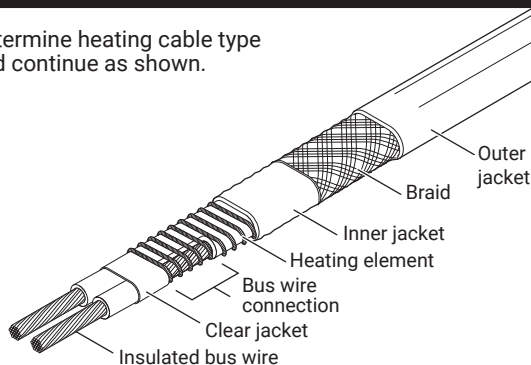


VPL
Go to Step 1A

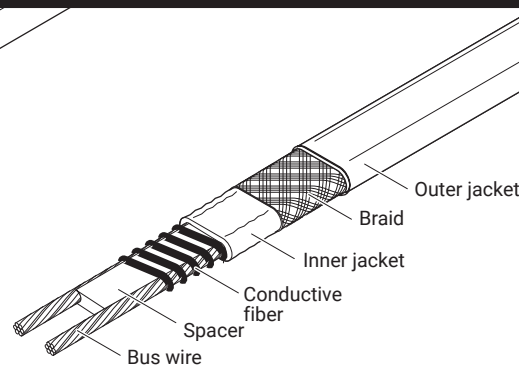

XTV-CT, KTV-CT
Go to Step 1B

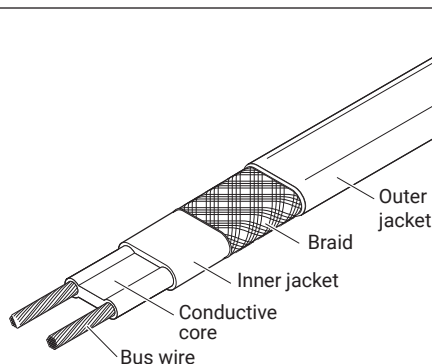

BTV-CR, BTV-CT, QTVR-CT
Go to Step 1B

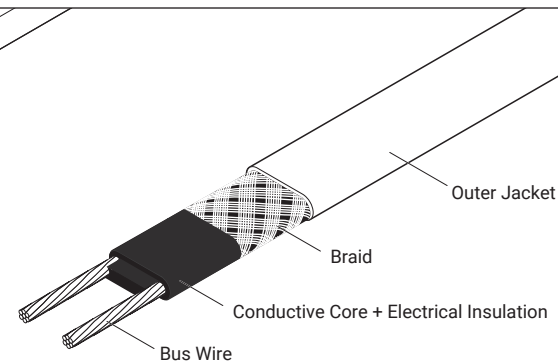


HTV-CT
Go to Step 1B


1A

VPL

- Cut each heating cable 12 in (30 cm) from the center of the first indentation, cut at a 45° angle.

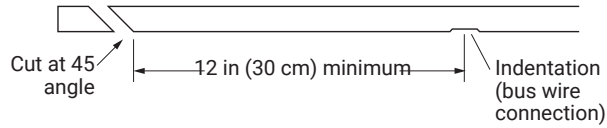


- After heating cable has been cut, align indentations. Allow approximately 24 in (60 cm) of heating cable for installation.

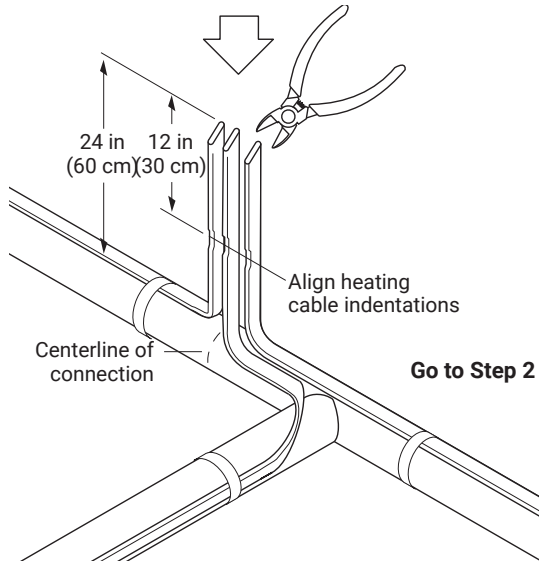


3

- Lightly score outer jacket around and down as shown.
- Bend heating cable to break jacket at score, then peel off jacket.

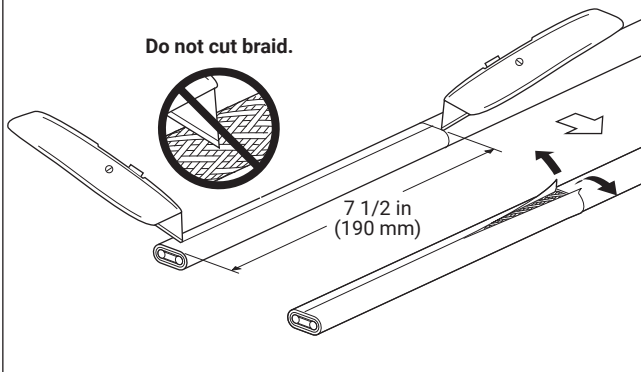


1B

BTV, QTVR, XTV, KTV, HTV

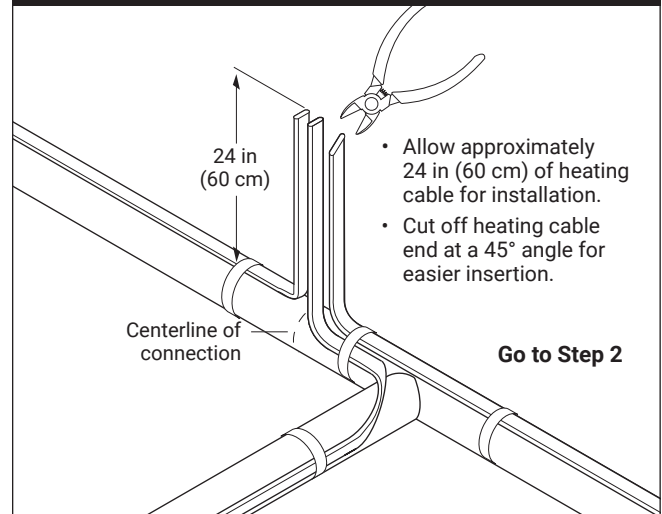

2

Complete steps 2 through 6 for each heating cable before going on to the next length of heating cable.

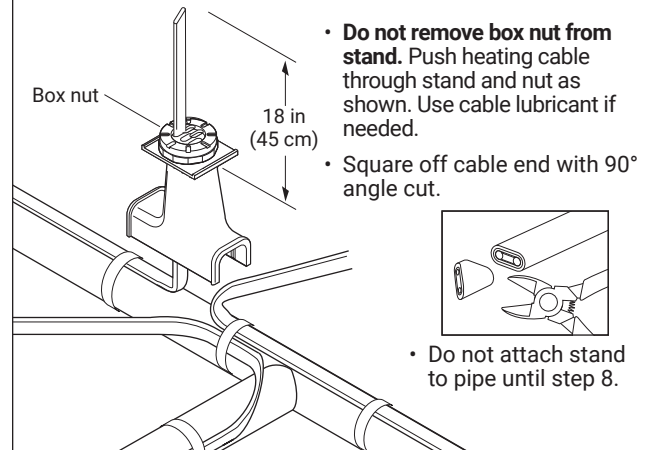

4

- Determine heating cable type and continue as shown.



Go to Step 5A



Go to Step 5B



Go to Step 5C



Go to Step 5D

5A

VPL

- Push braid back and bunch as tight as possible.

Lightly score inner jacket around and down as shown.

- Peel off inner jacket.

- Unwind heating element, cut and remove as shown.


- Lightly score clear jacket around and down as shown.

- Bend heating cable to break jacket at the score then peel off jacket.

- Push braid forward. Use a screwdriver to open braid.

- Bend heating cable and work it through opening in braid.

- Remove insulation from ends of bus wires.
- Pull braid tight to make pigtail.

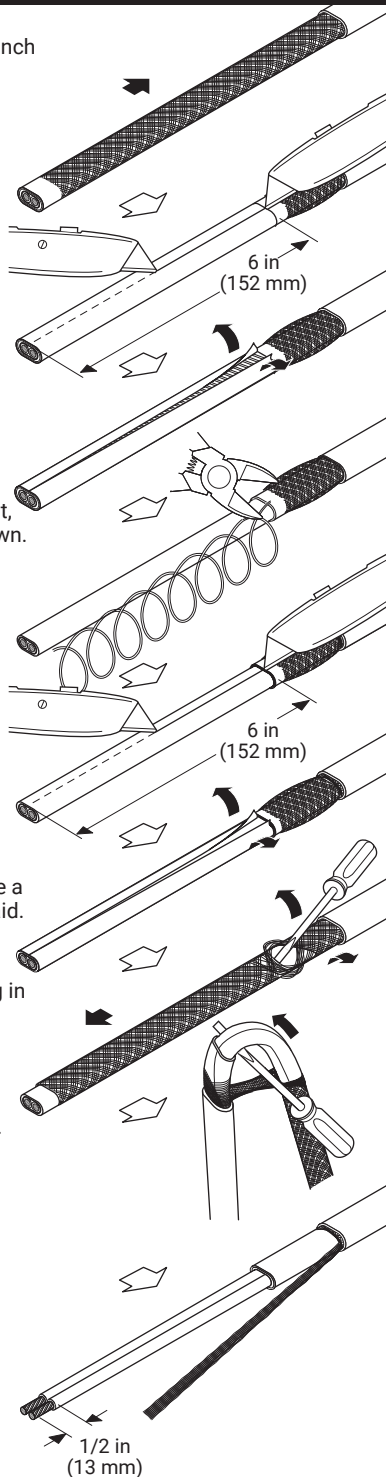

Go to Step 6

5B

XTV, KTV

- Push braid back to create a pucker.

- At pucker use a screwdriver to open braid.
- Bend heating cable and work it through opening in braid.


- Lightly score inner jacket around and down as shown.

- Peel off inner jacket.

- Cut and remove all fiber strands.

- Score and remove center spacer.

- Remove any remaining fiber material from bus wires.
- Pull braid tight to make pigtail.

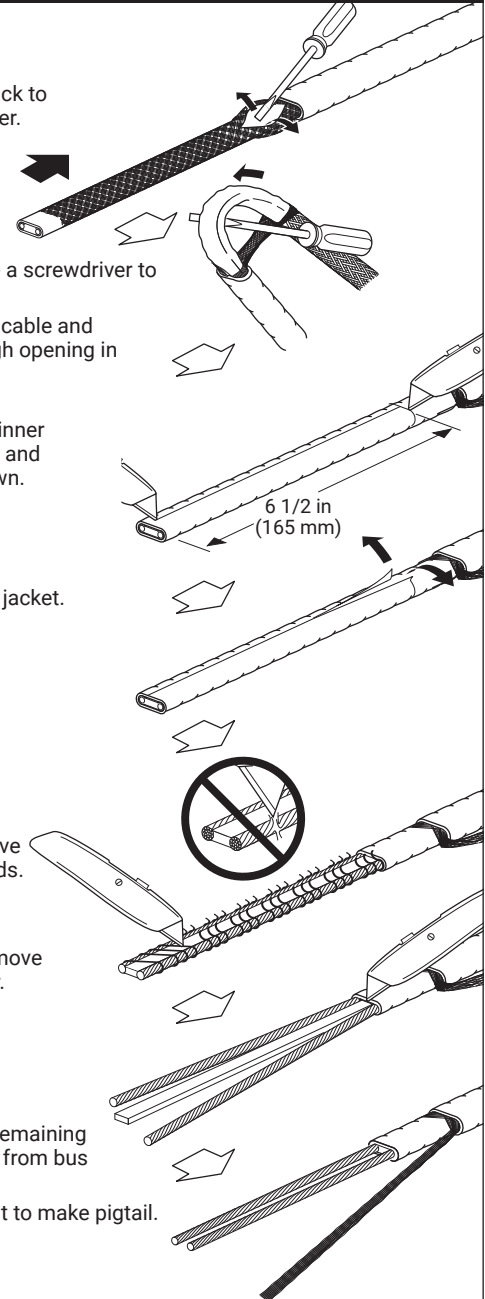

Go to Step 6

5C

BTV, QTVR

- Push braid back to create a pucker.
- At pucker use a screwdriver to open braid.
- Bend heating cable and work it through opening in braid.
- Lightly score inner jacket around and down as shown.
- Peel off inner jacket.
- Notch core.
- Peel bus wire from core.
- Score core between bus wires at inner jacket.
- Bend and snap core.
- Peel core from bus wire.
- Remove any remaining core material from bus wires.
- Pull braid tight to make pigtail.

Go to Step 6

5D


HTV

- Push braid back to create a pucker.
- At pucker use a screwdriver to open braid.
- Bend heating cable and work it through opening in braid.
- Score inner jacket and conductive core around and down as shown.
- Peel off inner jacket.
- Flip the cable 180°C and score the other side of inner jacket and conductive core.
- Remove the inner jacket, conductive core by using needle-nose pliers as shown.
- Score and remove center insulation.
- Remove any remaining material from bus wires.
- Pull braid tight to make pigtail.

Go to Step 6


6

- Mark the jacket as shown.

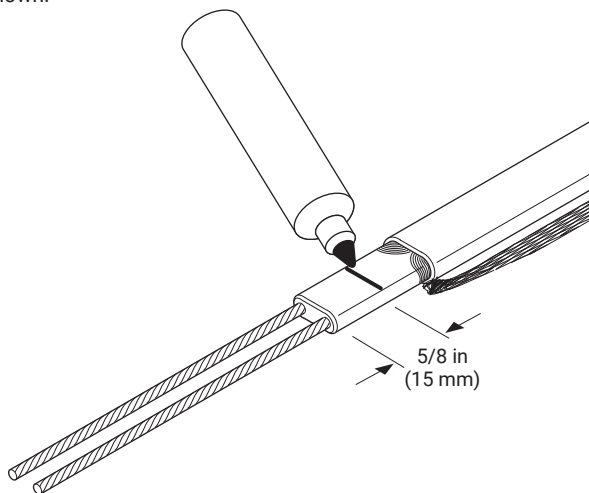

7



- Pull heating cable back into stand as shown. Use cable lubricant if needed.

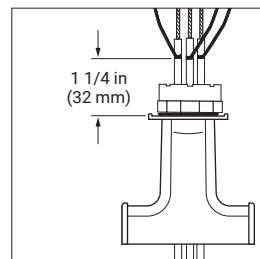

- Repeat steps 2 through 7 for other heating cables before continuing to step 8.

8


- Fasten stand to pipe. Do not pinch heating cables.
- Loop and tape extra heating cable to pipe.

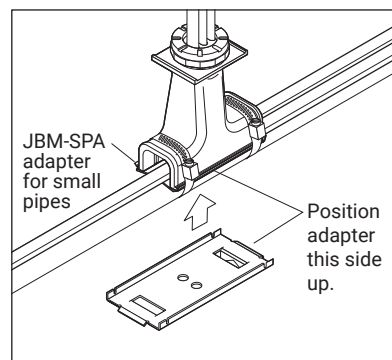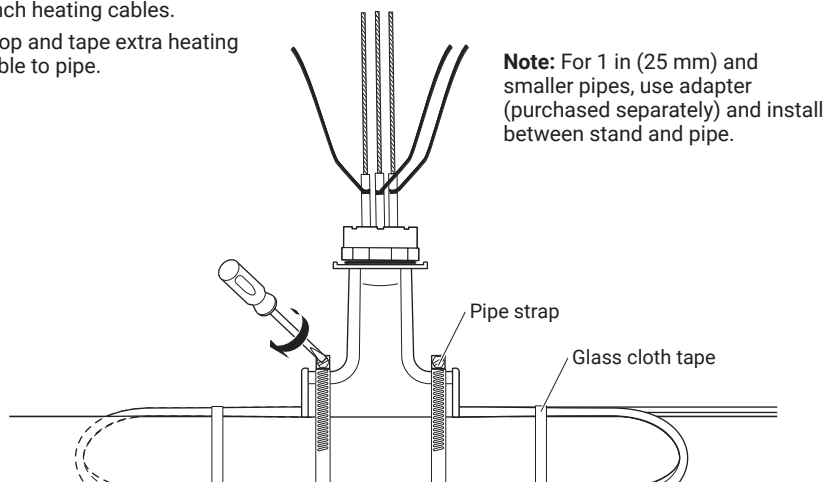

9

- Remove box nut.


- Install grommet plugs in unused openings.

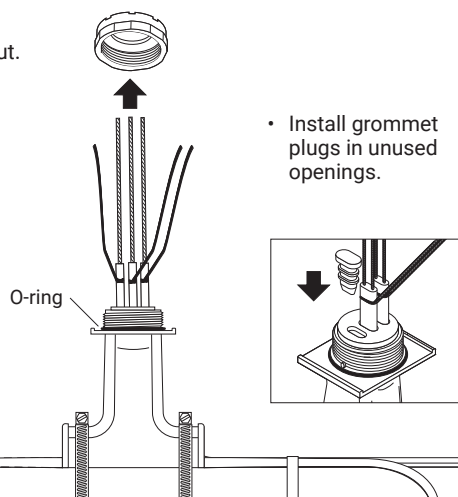


10

- Place junction box onto stand. Align key ways in large box hole with alignment feature on stand.
- Put box nut back onto stand.
- Tighten box nut with spanner.

Torque = 22 +/- 2 Nm

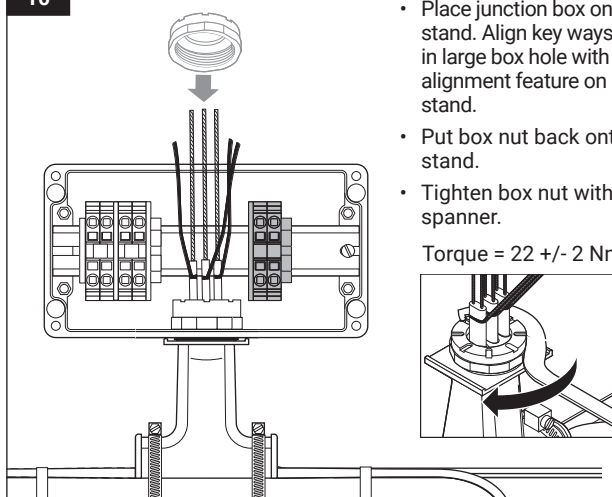

11

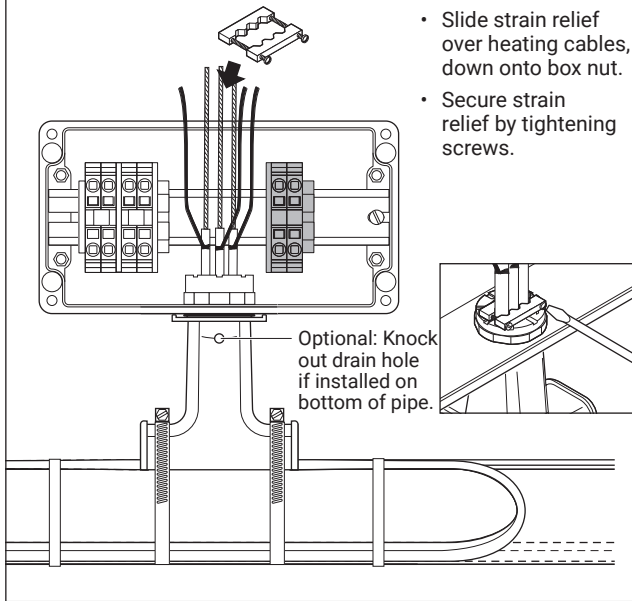

12

**CAUTION: Health Hazard.**


Wash hands after contact with sealant. Consult material safety data sheet VEN 0058.



Avertissement: risque pour la santé. Se laver les mains après tout contact avec le produit d'étanchéité. Consulter la fiche de données de sécurité VEN 0058.

- If needed, re-twist and straighten bus wires, then insert bus wires into guide tubes as shown.


Make sure all strands go into the tubes.

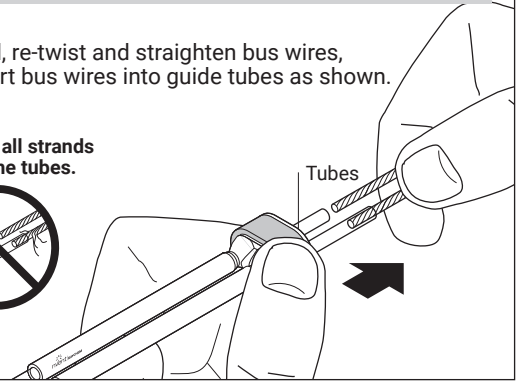

13

- Push core sealer onto the heating cable to the mark made in step 6.


Note: Extra force may be required for larger cables or at lower temperatures.

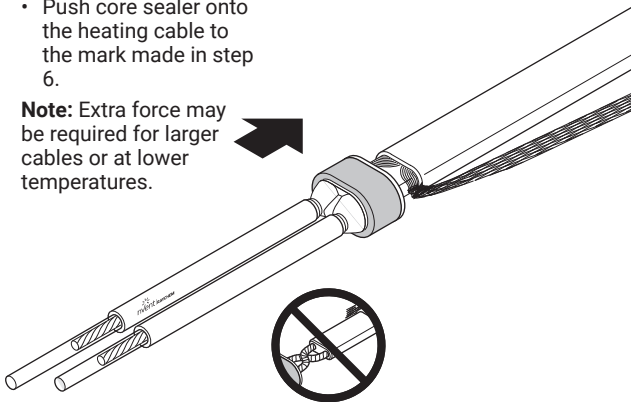

Make sure the bus wires do not kink, bunch, or crossover.


14

- Remove the guide tubes and dispose of them in a plastic bag.
- Slip the green/yellow tube onto the braid. Heat-shrinking is not required.

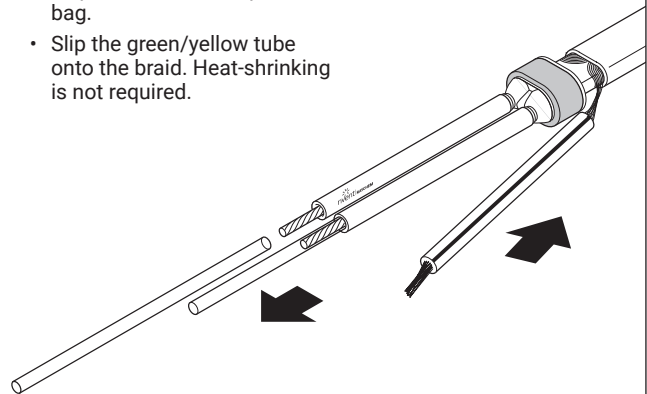


15

- Trim bus wires and braid.
- Repeat steps 12 through 15 for all heating cables.

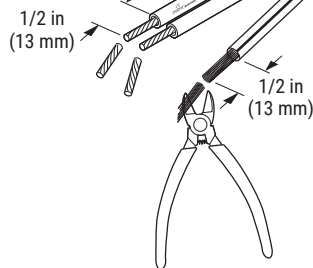

16


Finished view of installed core sealers.

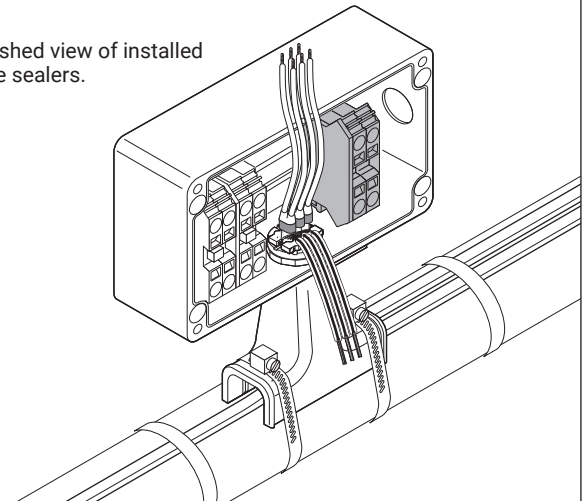


This kit uses spring clamp style terminals.

Terminals use a steel spring to clamp the wire to provide improved vibration resistance, reduced maintenance and faster installation.

To connect wires, firmly insert a slotted screwdriver into the square hole (①) to open the spring. When fully inserted, the screwdriver will lock into place, allowing you to remove your hand and insert the wire into the round hole (②). Remove the screwdriver to clamp the wire. The wire is held securely against the bus bar for low contact resistance over time without the need to periodically retighten screws.


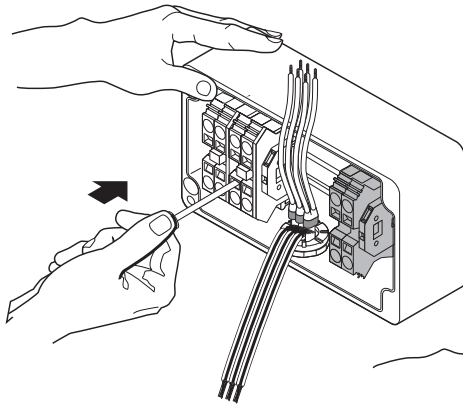


- Refer to wiring diagram, step 18A, 18B, or 18C.
- Push screwdriver **FIRMLY** into square hole.

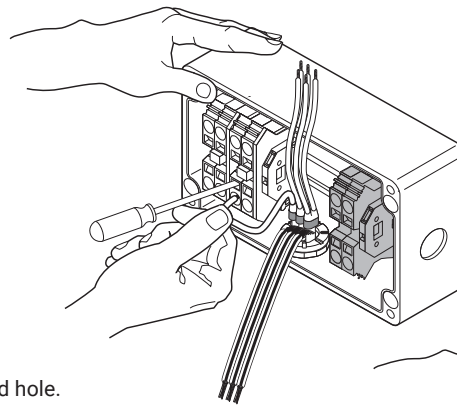


- Insert wire into round hole.
- Use green terminal for braid and ground wires.


- Remove screwdriver.
- Repeat for all connections.

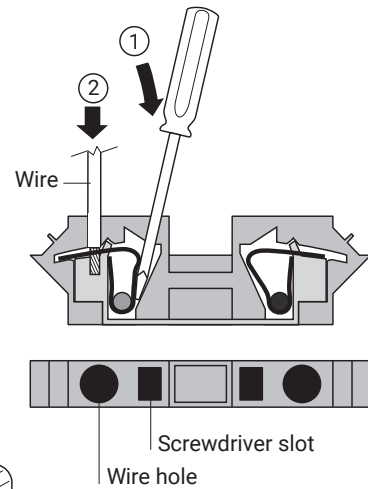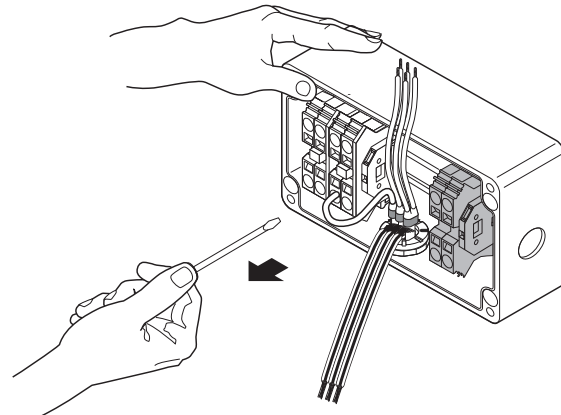

18A Splice Wiring

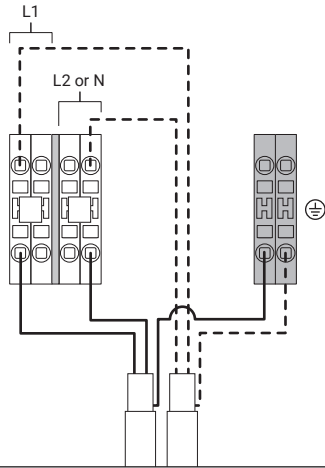

18B Tee Wiring

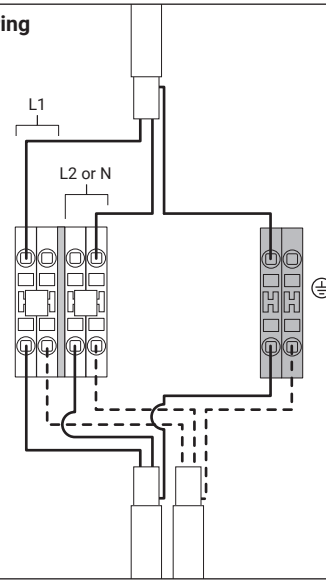




18C Power Connection Wiring



WARNING: Shock or fire hazard. When the power connection is energized by two circuits, the L1 and L2 jumpers must be removed to prevent an electrical short.





AVERTISSEMENT: risque d'électrocution et d'incendie. Lorsque le raccordement électrique est alimenté par deux circuits, les cavaliers L1 et L2 doivent être enlevés afin d'éviter un court-circuit.

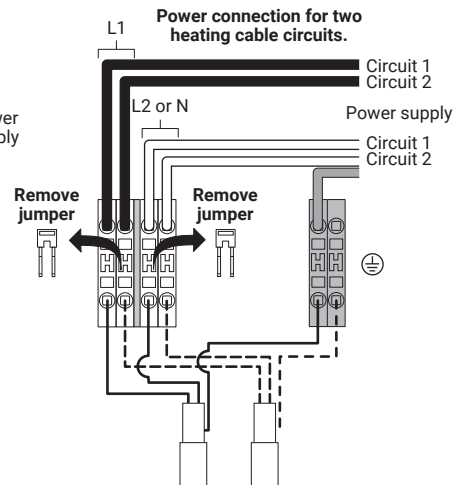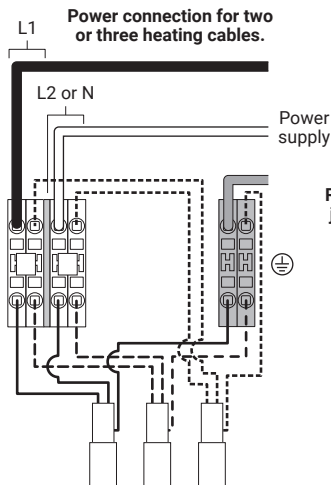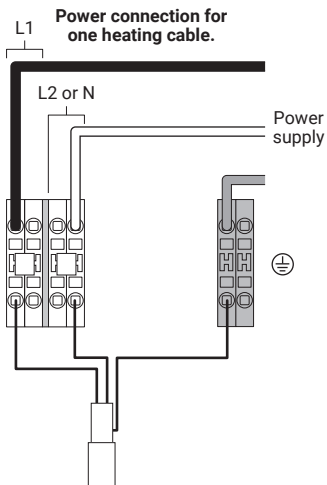

19A If used as a power connection


- Install conduit and fittings as shown. To minimize loosening due to vibration, use flexible conduit.
- Pull in power and ground wires, strip off 1/2 in (13 mm) of insulation, and terminate.

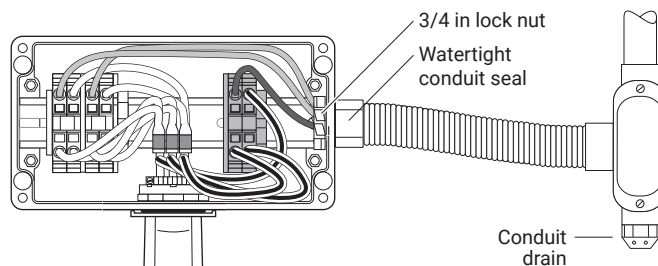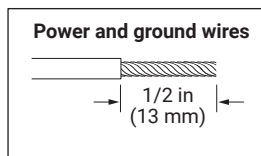

- nVent recommends the use of a conduit drain to prevent water condensation build-up.


19B If used as a splice or tee connection

- Install box plug using 3/8 in hex key.

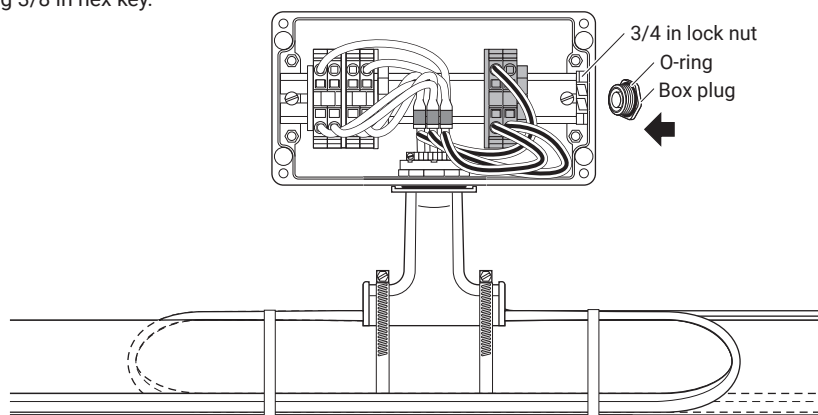


20

- Plug in the light module in the terminal blocks marked L and N as shown here.
(For simplicity the connected wires in the terminal blocks are not shown in this step.)

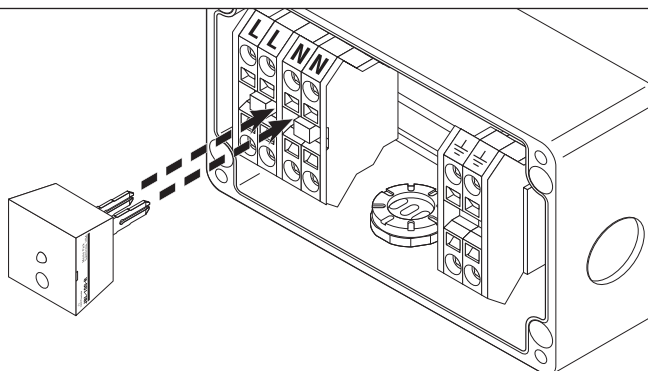

- Install lid. Torque = 1.02 to 1.47 Nm
- Apply insulation and cladding.
- Weather-seal the stand entry.
- Leave these instructions with the end user for future reference.

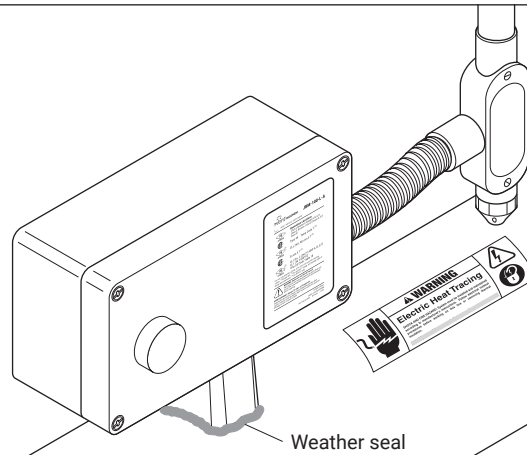

⚠ WARNING: Explosion Hazard- Substitution of Components May Impair Suitability for Class I Division 2 (Zone 2)

⚠ AVERTISSEMENT- Risque d'explosion. La substitution de composants peut rendre ce matériel inacceptable pour les emplacements de classe i, division 2 (zone 2).

⚠ WARNING: Explosion Hazard- Do not disconnect equipment unless power has been switched off or the area is known to be Non-Hazardous.

⚠ AVERTISSEMENT - Risque d'explosion. Ne pas débrancher l'appareil à moins d'avoir coupé l'alimentation électrique ou à moins qu'il ne s'agisse d'un emplacement non dangereux

North America

Tel +1.800.545.6258
Fax +1.800.527.5703
thermal.info@nVent.com

Europe, Middle East, Africa

Tel +32.16.213.511
Fax +32.16.213.604
thermal.info@nVent.com

Asia Pacific

Tel +86.21.2412.1688
Fax +86.21.5426.3167
cn.thermal.info@nVent.com

Latin America

Tel +1.713.868.4800
Fax +1.713.868.2333
thermal.info@nVent.com



nVent.com/RAYCHEM

©2021 nVent. All nVent marks and logos are owned or licensed by nVent Services GmbH or its affiliates. All other trademarks are the property of their respective owners.
nVent reserves the right to change specifications without notice.

RAYCHEM-IM-H59056-JBM100LA-EN-2111

PN P000001644