



microsonic hps+25-DD-TC-E-G1 hps+ Ultrasonic Sensors User Manual

[Home](#) » [microsonic](#) » microsonic hps+25-DD-TC-E-G1 hps+ Ultrasonic Sensors User Manual 

microsonic



Operating Manual

hps+ Ultrasonic Sensors for application in overpressure with two switching outputs

hps+25/DD/TC/E/G1

hps+35/DD/TC/E/G1

hps+130/DD/TC/E/G1

hps+340/DD/TC/E/G2


Contents

- [1 Product description](#)
- [2 Safety Notes](#)
- [3 Diagram 2: Set sensor parameters via Teach-in procedure](#)
- [4 Diagram 3: Key lock and factory setting](#)
- [5 Technical data](#)
- [6 Documents / Resources](#)
- [7 Related Posts](#)

Product description

- The hps+ sensor measures the level in a vessel in up to 6 bar overpressure contactless. The G1 and G2 threaded pipe end permits the mounting and sealing of the sensor in a flange of the vessel. The pnp switching outputs are set according to the adjusted detect distances.
- The surfaces of the ultrasonic transducers of the hps+ sensors are protected by a PTFE film and sealed with a FFKM O-ring against the sensor housing.
Therefore the surface of the ultrasonic transducer can be cleaned from cakings or spots.
- All settings are done with two pushbuttons and a three-digit LED display (TouchControl).
- Light emitting diodes (three-colour LEDs) indicate the switching status.
- The output functions are changeable from NOC to NCC.
- The sensors are adjustable manually using the numerical LED display or may be trained via Teach-in processes.
- Useful additional functions are set in the Add-on-menu.
- Using the LinkControl adapter (optional accessory) all TouchControl and additional sensor parameter settings can be adjusted by a Windows® Software.

Diagram 1: Set sensor parameters numerically using LED display

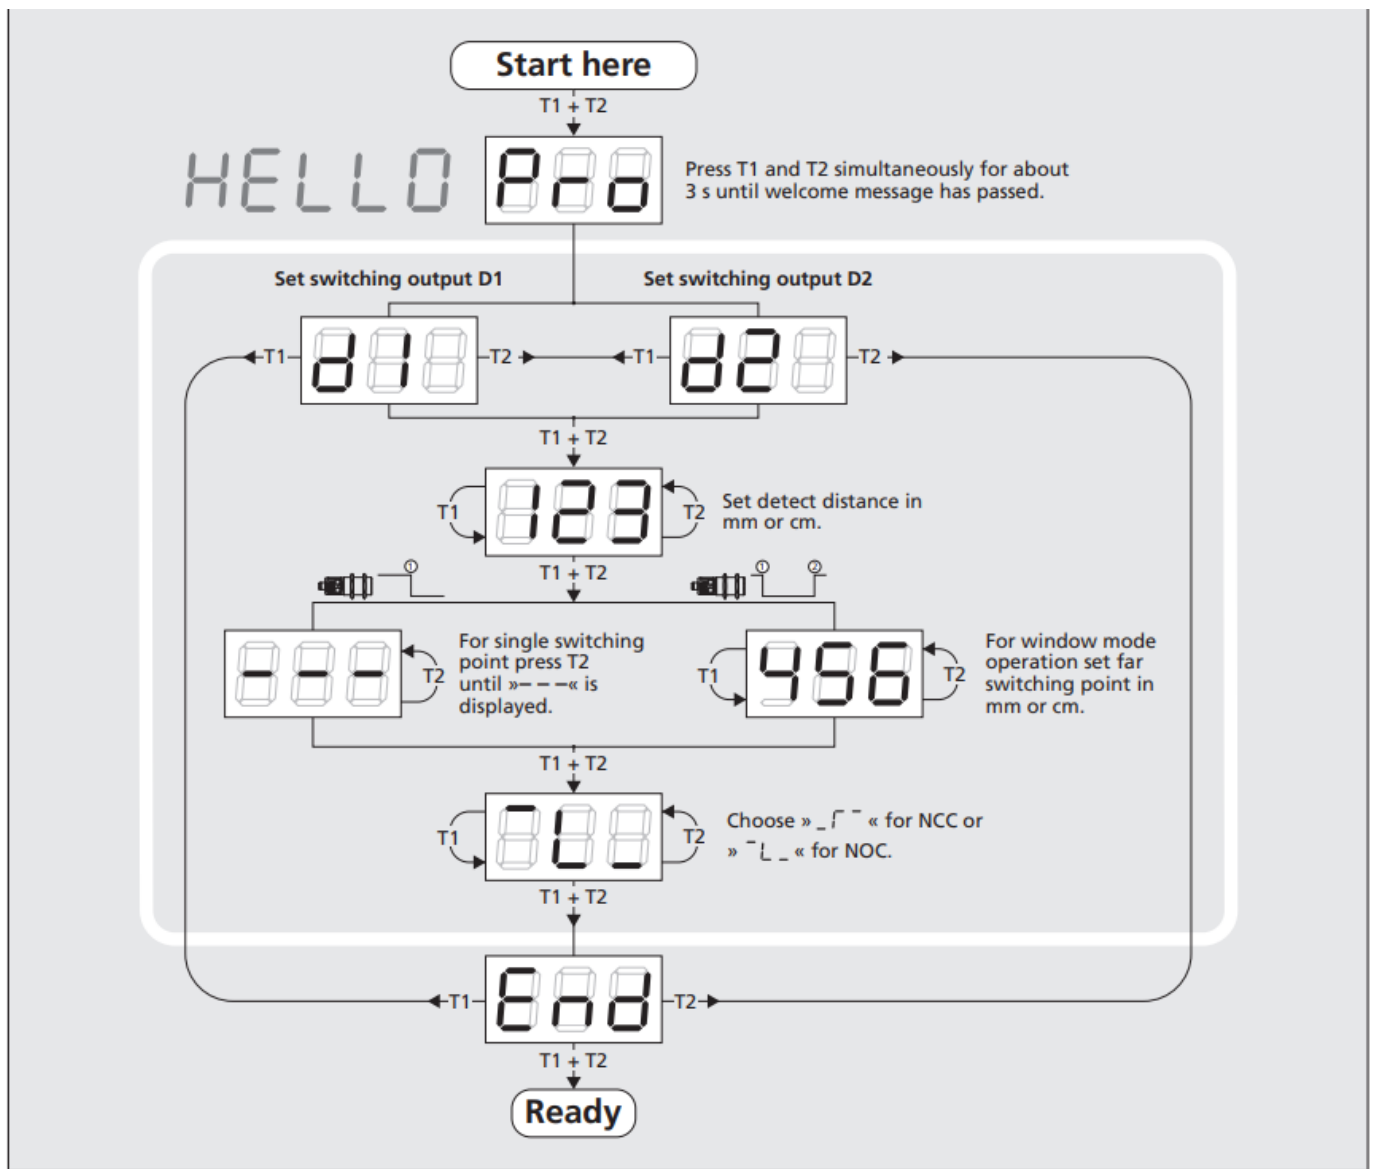

Safety Notes

- Read the operating instructions prior to start-up.
- Connection, installation and adjustment works may only be carried out by expert personnel.
- No safety component in accordance with the EU Machine Directive, use in the area of personal and machine protection not permitted

Proper Use

hps+ ultrasonic sensors are used for non-contact detection of objects. The hps+ sensors indicate a blind zone, in which the distance cannot be measured. The operating range indicates the distance of the sensor that can be applied in normal atmospheric pressure with sufficient function reserve.

Installation

- ➔ Assemble the sensor at the installation location.
- ➔ If necessary seal the sensor with the enclosed Viton® -O-ring (34 x 2,5 mm or 60 x 4 mm) against the flange.
- ➔ Plug in the connector cable to the M12 connector, see Fig. 1.

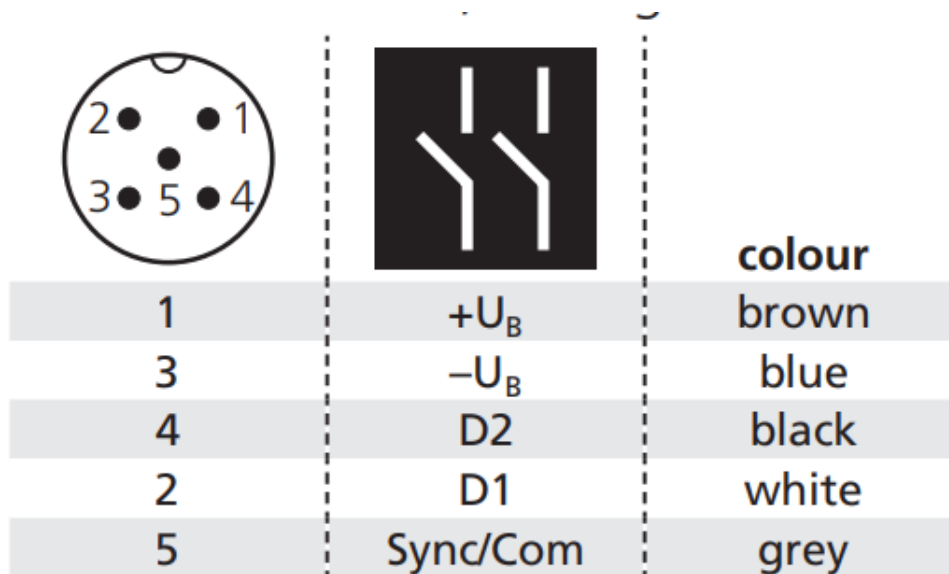


Fig. 1: Pin assignment with view onto sensor plug and colour coding of the microsonic connection cable

- ➔ Connect the power supply.
- ➔ Set the parameters of the sensor manually via TouchControl (see Fig. 2 and Diagram 1)
- ➔ or use the Teach-in procedure to adjust the detect points (see Diagram 2).

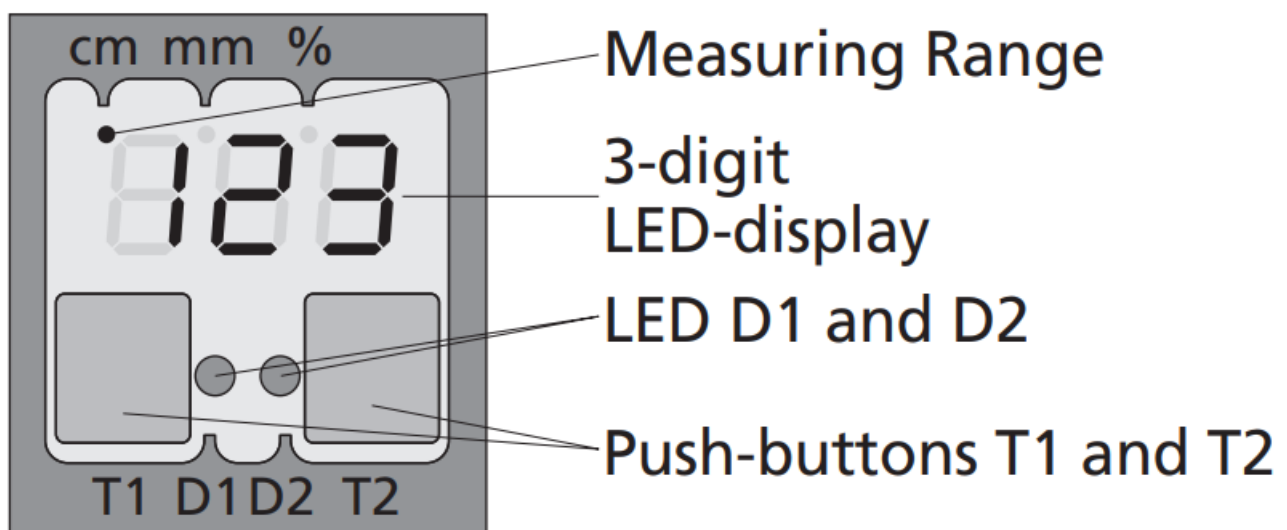


Fig. 2: TouchControl/LED display

Factory setting

hps+ sensors are delivered factory made with the following settings:

- Switching outputs on NOC
- Detecting distances at operating range and half operating range
- Measurement range set to maximum range at ≥ 2 bar overpressure
- Sensitivity at normal pressure Maintenance hps+ sensors work maintenance free. Small amounts of dirt on the surface do not influence function. Thick layers of dirt and caked-on dirt affect the sensor function and therefore must be removed.

Notes

- In operation in overpressure it is recommended to adjust the sensitivity of the hps+ sensor: choose the parameter A14 in the Add-on menu and set it to sensitivity E2 for atmospheric pressure from 1 to 3 bar or to sensitivity E3 for atmospheric pressure >3 bar.
- hps+ sensors have internal temperature compensation. Because the sensors heat up on their own, the temperature compensation reaches its optimum working point after approx. 30 minutes of operation.
- During normal operating mode, a yellow LED signals that the corresponding switching output is set.
- During normal operating mode, the measured distance value is displayed on the LED display in mm (up to 999 mm) or cm (from 100 cm). Scale switches automatically and is indicated by a point on top of the digits.
- During Teach-in mode, the hysteresis value is set back to factory settings.
- If no objects are placed within the detection zone the LED display shows »— — —«.
- If no push-buttons are pressed for 20 seconds during parameter setting mode, the parameter changes are saved and the sensor returns to normal operating mode.
- The sensor can be reset to its factory setting, see »Key lock and factory setting«, Diagram 3.

Show parameters



In normal operating mode shortly push T1. The LED display shows »PAr.« Each time you tap push-button T1 the actual settings of the analogue output are shown.

Diagram 2: Set sensor parameters via Teach-in procedure

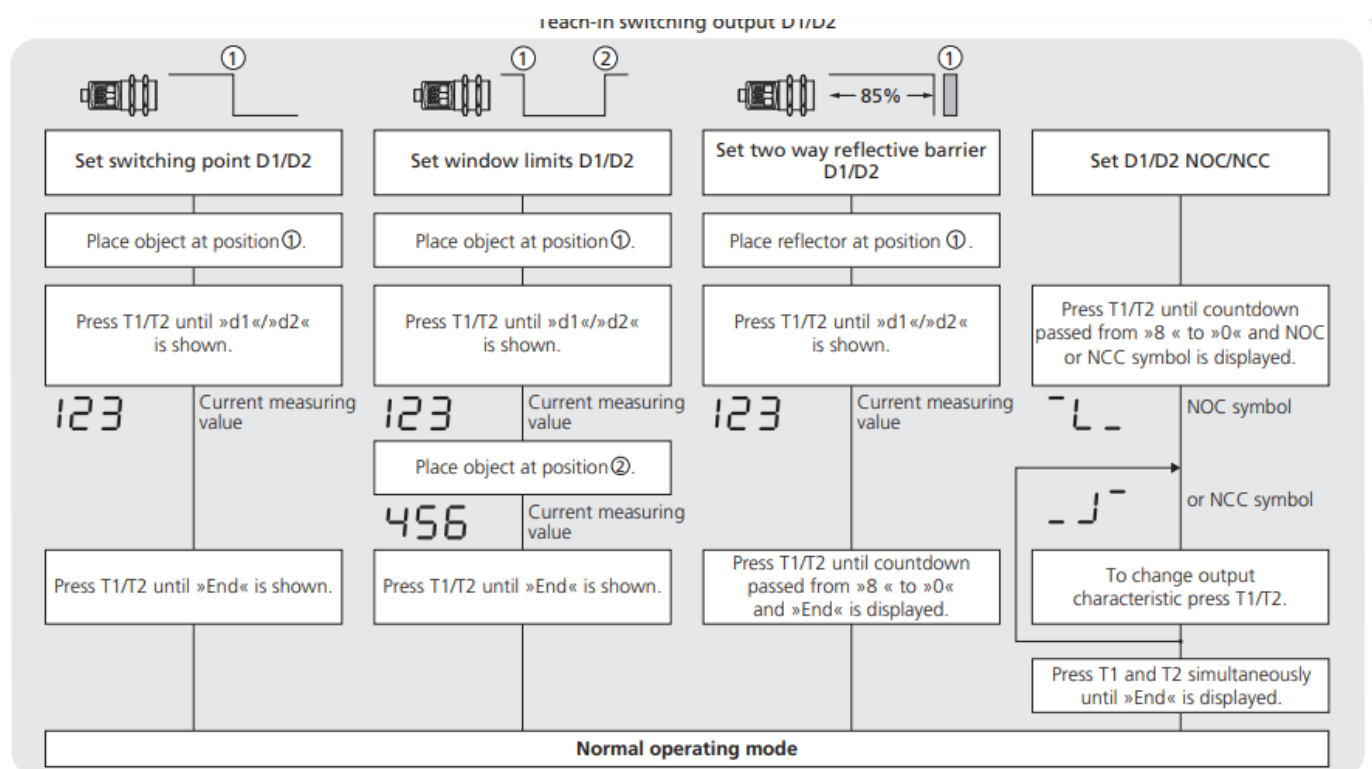


Diagram 3: Key lock and factory setting








 



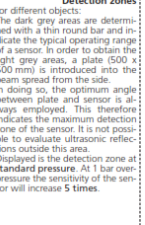
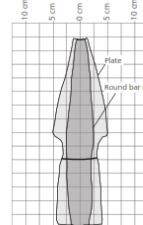
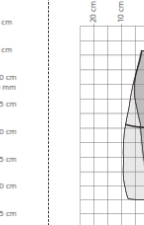
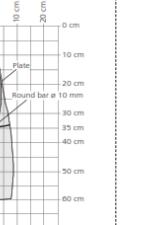
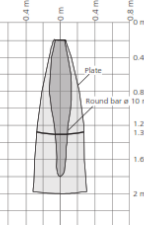
Diagram 4: Useful additional functions in Add-on menu (for experienced users only, settings not required for standard applications)

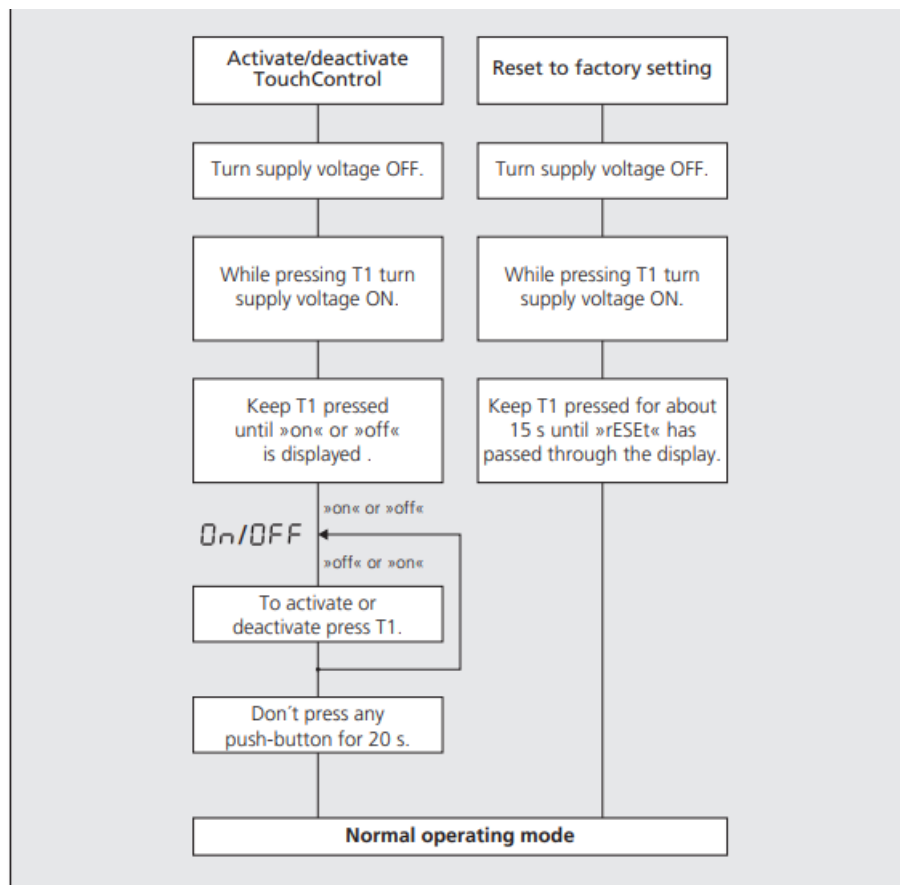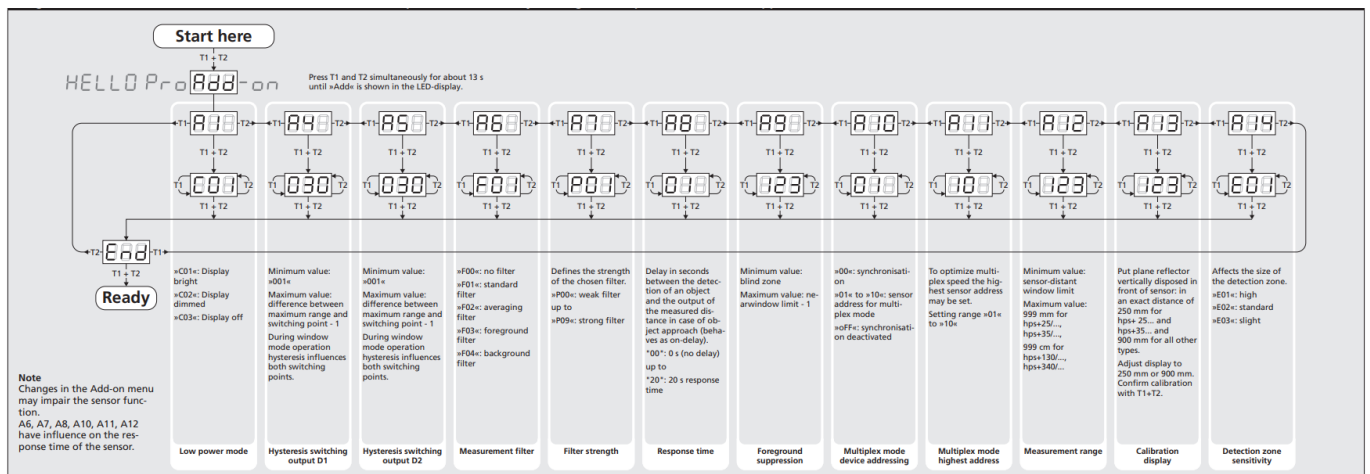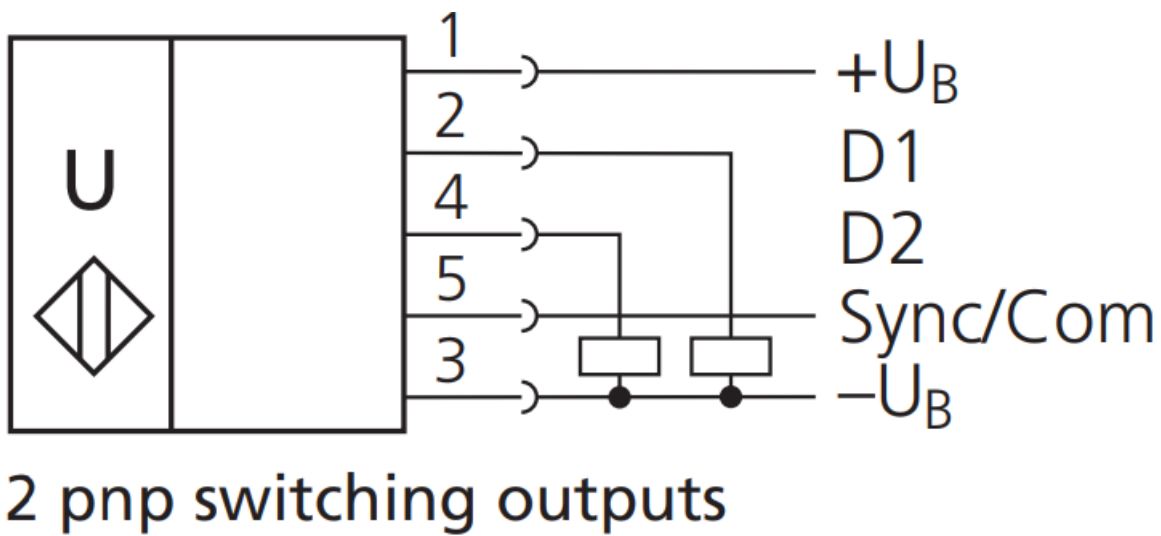

Technical data



blind zone operating range maximum range at normal pressure maximum range at ≥ 2 bar overpressure angle of beam spread transducer frequency resolution reproducibility accuracy Detection zones for different objects: The dark grey areas are determined with a thin round bar and indicate the typical operating range of a sensor. In order to obtain the light grey areas, a plate (500 x 500 mm) is introduced into the beam spread from the side. In doing so, the optimum angle between plate and sensor is always employed. This therefore indicates the maximum detection zone of the sensor. It is not possible to evaluate ultrasonic reflections outside this area. Displayed is the detection zone at standard pressure. At 1 bar overpressure the sensitivity of the sensor will increase 5 times.

	hps+25...	hps+35...	hps+130...	hps+340...	hps+340...
					
blind zone	0 to 30 mm	0 to 85 mm	0 to 200 mm	0 to 350 mm	0 to 350 mm
operating range	250 mm	350 mm	1,300 mm	3,400 mm	3,400 mm
maximum range at normal pressure	350 mm	600 mm	2,000 mm	5,000 mm	5,000 mm
maximum range at ≥ 2 bar overpressure	990 mm	1,500 mm	5,000 mm	8,000 mm	8,000 mm
angle of beam spread	see detection zone	see detection zone	see detection zone	see detection zone	see detection zone
transducer frequency	320 kHz	320 kHz	180 kHz	120 kHz	120 kHz
resolution	0.025 mm	0.18 mm	0.18 mm	0.18 mm	0.18 mm
reproducibility	$\pm 0.15\%$	$\pm 0.15\%$	$\pm 0.15\%$	$\pm 0.15\%$	$\pm 0.15\%$
accuracy	$\pm 1\%$ (temperature drift internally compensated)	$\pm 1\%$ (temperature drift internally compensated)	$\pm 1\%$ (temperature drift internally compensated)	$\pm 1\%$ (temperature drift internally compensated)	$\pm 1\%$ (temperature drift internally compensated)
Detection zones for different objects: The dark grey areas are determined with a thin round bar and indicate the typical operating range of a sensor. In order to obtain the light grey areas, a plate (500 x 500 mm) is introduced into the beam spread from the side. In doing so, the optimum angle between plate and sensor is always employed. This therefore indicates the maximum detection zone of the sensor. It is not possible to evaluate ultrasonic reflections outside this area. Displayed is the detection zone at standard pressure. At 1 bar overpressure the sensitivity of the sensor will increase 5 times.					
operating voltage	9 to 30 V DC, short-circuit-proof	9 to 30 V DC, short-circuit-proof	9 to 30 V DC, short-circuit-proof	9 to 30 V DC, short-circuit-proof	9 to 30 V DC, short-circuit-proof
voltage ripple	$\pm 10\%$	$\pm 10\%$	$\pm 10\%$	$\pm 10\%$	$\pm 10\%$
no-load supply current	≤ 80 mA	≤ 80 mA	≤ 80 mA	≤ 80 mA	≤ 80 mA
ambient pressure	up to 6.0 bar	up to 6.0 bar	up to 6.0 bar	up to 6.0 bar	up to 6.0 bar
housing	Stainless steel 1.4571, plastic parts: PBT, TPU; Ultrasonic transducer: PTFE film, FFKM O-ring	Stainless steel 1.4571, plastic parts: PBT, TPU; Ultrasonic transducer: PTFE film, FFKM O-ring	Stainless steel 1.4571, plastic parts: PBT, TPU; Ultrasonic transducer: PTFE film, FFKM O-ring	Stainless steel 1.4571, plastic parts: PBT, TPU; Ultrasonic transducer: PTFE film, FFKM O-ring	Plastic parts: PVDF, PBT, TPU; Ultrasonic transducer: PTFE film, FFKM O-ring
process connection	G1	G1	G1	G2	G2
class of protection to EN 60529	IP 67	IP 67	IP 67	IP 67	IP 67
norm conformity	EN 60947-5-2	EN 60947-5-2	EN 60947-5-2	EN 60947-5-2	EN 60947-5-2
type of connection	5-pin initiator plug, PBT	5-pin initiator plug, PBT	5-pin initiator plug, PBT	5-pin initiator plug, PBT	5-pin initiator plug, PBT
controls	2 push-buttons (TouchControl)	2 push-buttons (TouchControl)	2 push-buttons (TouchControl)	2 push-buttons (TouchControl)	2 push-buttons (TouchControl)
indicators	3-digit LED display, 2 three-colour LEDs	3-digit LED display, 2 three-colour LEDs	3-digit LED display, 2 three-colour LEDs	3-digit LED display, 2 three-colour LEDs	3-digit LED display, 2 three-colour LEDs
programmable	TouchControl and LinkControl	TouchControl and LinkControl	TouchControl and LinkControl	TouchControl and LinkControl	TouchControl and LinkControl
operating temperature	-25 to +70 °C	-25 to +70 °C	-25 to +70 °C	-25 to +70 °C	-25 to +70 °C
storage temperature	-40 to +85 °C	-40 to +85 °C	-40 to +85 °C	-40 to +85 °C	-40 to +85 °C
weight	210 g	210 g	210 g	1,200 g	350 g
switching hysteresis	3 mm	5 mm	20 mm	50 mm	50 mm
switching frequency	11 Hz	9 Hz	5 Hz	3 Hz	3 Hz
response time	168 ms	84 ms	160 ms	240 ms	240 ms
time delay before availability	<300 ms	<300 ms	<300 ms	<380 ms	<380 ms
order no.	hps+25/DD/TC/E/G1	hps+35/DD/TC/E/G1	hps+130/DD/TC/E/G1	hps+340/DD/TC/E/G2	hps+340/DD/TC/G2
switching outputs	2 x pnp, $U_B = 2$ V, $I_{max} = 2$ x 200 mA switchable NOC/NCC, short-circuit-proof	2 x pnp, $U_B = 2$ V, $I_{max} = 2$ x 200 mA switchable NOC/NCC, short-circuit-proof	2 x pnp, $U_B = 2$ V, $I_{max} = 2$ x 200 mA switchable NOC/NCC, short-circuit-proof	2 x pnp, $U_B = 2$ V, $I_{max} = 2$ x 200 mA switchable NOC/NCC, short-circuit-proof	2 x pnp, $U_B = 2$ V, $I_{max} = 2$ x 200 mA switchable NOC/NCC, short-circuit-proof

¹Can be programmed via TouchControl and LinkControl.

²With TouchControl and LinkControl, the selected filter setting and the maximum range influence the switching frequency and the response time.

microsonic GmbH / Phoenixseestraße 7 / 44263 Dortmund / Germany / T +49 231 975151-0 / F +49 231 975151-51 / E info@microsonic.de / W microsonic.de

The content of this document is subject to technical changes. Specifications in this document are presented in a descriptive way only. They do not warrant any product features.



Registration
no. 75330-19
Approved on
June 25th, 2019



UK
CA



2014/30/EU



Documents / Resources



[microsonic hps+25-DD-TC-E-G1 hps+ Ultrasonic Sensors](#) [pdf] User Manual
hps 25-DD-TC-E-G1 hps Ultrasonic Sensors, hps 25-DD-TC-E-G1, hps Ultrasonic Sensors, Ultrasonic Sensors, Sensors

[Manuals+](#)