



Rhopoint Instruments Ltd Novo-Curve Gloss Meter Instructions

[Home](#) » [Rhopoint Instruments Ltd](#) » Rhopoint Instruments Ltd Novo-Curve Gloss Meter Instructions 

Contents

- 1 Rhopoint Instruments Ltd Novo-Curve Gloss Meter
- 2 Product Information
- 3 Product Usage Instructions
- 4 Accessories
- 5 The Control Panel
 - 5.1 Read/Select Key
 - 5.2 Scroll Up/Scroll Down
 - 5.3 Calibrate/Cancel
- 6 Measuring Gloss
 - 6.1 Check the Calibration
 - 6.2 Take a single reading
 - 6.3 Using the move and read feature
- 7 Inspection and tile care
 - 7.1 Inspecting and cleaning the instrument optics
 - 7.2 Inspecting and cleaning the calibration tile
 - 7.3 Scratched or damaged tiles
- 8 Calibration
 - 8.1 Automatic calibration check
 - 8.2 Measuring a Curved Surface
- 9 Analysing Statistics
 - 9.1 Definitions of terms used in statistical mode
- 10 Preferences
- 11 CONNECTING TO A PC
 - 11.1 Install the software
 - 11.2 Installing the drivers
 - 11.3 Connect the instrument
- 12 Documents / Resources
 - 12.1 References
- 13 Related Posts



Product Information

The Novo-Curve is a gloss meter manufactured by Rhopoint Instruments Ltd. It comes with a range of accessories including a traceable calibration tile, mini-CD containing Novo-Soft software and instrument manuals, USB data cable, footswitch, jiggling posts, power supply unit, and mains cables. The product has options for replacement BAM Traceable calibration tile, supplementary calibration/checking tiles, UKAS (ISO17025) BAM traceable calibration/checking tiles, and Novo-Curve Cylinder Measurement Jig. The product is powered using an external low voltage power supply.

Product Usage Instructions

To use the Novo-Curve gloss meter, follow the below instructions:

1. Check the calibration of the instrument before use by placing the high gloss calibration tile on the instrument aligning the arrows with the alignment marks on the sole plate. Take a reading by pressing the READ/SELECT key. Compare the measured value with the assigned value for the tile. If it matches the value on the tile holder, the instrument is within calibration and ready for use.
2. Position the sample on the Novo-Curve and take a single reading by pressing the READ/SELECT key.
3. Use the move and read feature to take readings on different areas of the sample.
4. To calibrate a single angle, press and hold the C key for 2 seconds in measurement mode. To calibrate all angles, use the setup menu. Automatic calibration check is also available.
5. To view statistics for the selected angle, press the UP key. To enter delete mode, press the DOWN key. In the

hidden set up menu, use the UP/DOWN keys to scroll through the available options. In Set Calibration Mode, press the UP/DOWN keys to adjust the calibration value.

6. Inspect and clean the optics and calibration tile regularly. Scratched or damaged tiles should be replaced.
7. The product can be connected to a PC by installing the software and drivers. Results can be downloaded, saved, and manipulated using the Novo-Soft software.

Accessories

- Novo-Curve instrument
- Traceable calibration tile in protective case
- Traceability certificate for calibration tile
- Printed user manual
- Mini-CD containing Novo-Soft software and instrument manuals
- USB data cable
- Footswitch
- 4 x jiggling posts
- Power supply unit
- Mains cables (UK, EU and USA)

Options

- Replacement BAM Traceable calibration tile
- Supplementary calibration/checking tiles
- UKAS (ISO17025) BAM traceable calibration/checking tiles
- Novo-Curve Cylinder Measurement Jig

Power

- The Novo-Curve is powered using an external low voltage power supply.

The Control Panel

Read/Select Key

The “READ” key has four functions;

Power- Press this key to turn the instrument on.

Read- In measurement mode press this key to initiate a measurement.

Continuous Read- In measurement mode press and hold this key to take a continuous measurement.

Select- When navigating through the setup menu use this key to select an item or confirms a previous selection.



The “READ” key

Scroll Up/Scroll Down

The “UP/DOWN” key has four functions;

View Statistics- Press the UP key to view the statistics for the selected angle.

Delete- Press the DOWN key to enter the delete mode. Scroll Up/Down- In the hidden set up menu use the UP/DOWN keys to scroll through the available options. Set Calibration value- In Set Calibration Mode press the UP/DOWN keys to adjust the calibration value.



The “UP/DOWN” key

Calibrate/Cancel

The “C” key has two functions;

Calibrate- In measurement mode press the “C” key for 2 seconds to initiate the calibration process.

Cancel- During calibration use this key to cancel the process and revert to previously stored calibration constants.



The “C” key

Measuring Gloss

Check the Calibration

If the instrument has not been used for some time it is advisable to check the calibration.

Place the high gloss calibration tile on the instrument aligning the arrows with the alignment marks on the sole plate. Take a reading by pressing the READ/SELECT key. Compare the measured value with the assigned value for the tile.

If it matches the value on the tile holder, the instrument is within calibration and ready for use.

If the measured value does not match the assigned value, follow the calibration procedure.

Positioning the sample on the Novo-Curve

When a sample is placed on the instrument the aperture is hidden, the centre of the measurement area can be pinpointed by the intersection of the white lines marked on the sole plate.

Take a single reading

Press and release the READ/SELECT key in measurement mode to take a single reading.

The value shown in the display is the gloss value for the section of the sample covered by the aperture. This value has been stored in the memory and the number of stored readings increased by one.

Using the move and read feature

The Novo-Curve has a unique feature to quickly assess large surfaces for gloss variation.

To use this feature PRESS and HOLD the READ/SELECT key whilst in read mode. The unit will take a reading. A value will be shown in the display; this is the gloss value for the part of the sample currently covered by the measurement aperture.

To assess the rest of the sample continue to HOLD the READ/SELECT key and carefully slide the sample to the area to be inspected.

The value in the display will update IN REAL TIME to reflect the gloss value of the surface over the aperture at that time.

As soon as the READ/SELECT button is released the last value measured will be displayed. This is also the value stored in the memory.

Inspection and tile care

It is necessary to inspect the condition of the calibration tile and instrument optics before each calibration.

Inspecting and cleaning the instrument optics

Any dust or debris on the optic should be blown from the lenses using dry clean air- the optics must not be touched without wearing suitable cotton gloves.

If there are any permanent marks or scratches on the lenses, the instrument is no longer suitable for measuring gloss and should be returned to an authorised Rhopoint service center.

Inspecting and cleaning the calibration tile

The calibration tile must be perfectly clean from smears and scratches before attempting calibration. Fingerprints and dust can be removed with the supplied optic cleaning cloth.

Scratched or damaged tiles

Scratched or damaged tiles are not suitable for gloss calibration. The instrument and tile must be returned to an approved Rhopoint service center for tile replacement and re-calibration.

Calibration

Press and hold the "C" key to begin the calibration procedure. An on screen instruction will prompt the user to "Sample the zero ref".

The calibration tile should be placed on the platen with the foam side face down, press the "Read Key" to complete this part of the calibration procedure.

The instrument will then prompt "Sample High Ref"; the calibration tile should be turned over so that the glass surface faces down. Align the arrows on the tile with the alignment lines on the sole plate. There is also a read direction arrow on the tile this should point from left to right.

Press the read key to complete the calibration process, Pressing the "C" key at any point during calibration will

cancel the procedure and revert to the last calibration values.



Automatic calibration check

During calibration the instrument automatically checks for changes in the condition of the calibration tile.

If changes to the expected value are detected the instrument will prompt

“Possible Calibration Error- Check Calibration Tile”

The calibration tile should then be carefully checked for marks or scratches.

If there are smears, marks or dust on the tile, press the “C” key to abort the calibration. Clean the tile using the procedure detailed on page 6 and repeat the calibration process.

If the calibration tile is seen to be completely clean, press the read key to store the calibration data.

The “C” key can be pressed at any time to abort the calibration process.

Measuring a Curved Surface

The Novo-Curve is specifically designed to measure curved surfaces; there are two methods to achieve repeatable results.

Manual Method- Place the sample to be assessed over the measurement orifice.

It is important that the sample is absolutely flush with the plane of the sole plate, this is the focal point for the measurement beam.

The instrument should then be used in “continuous read mode”, this can be achieved by pressing and holding the “read” key or continuously depressing the foot switch.

The sample must then be manipulated until a peak gloss reading is observed. This peak reading is only observed when the sample is in the correct measurement position.

To store this reading in memory, stop depressing the read button or the foot switch.

Jig Method- Bespoke jigs can be manufactured which hold a sample in the correct position. They can be accurately located using the grooves around the measurement platen.

Analysing Statistics

To examine the statistics for the stored values, whilst in Read mode -press the up arrow.

Definitions of terms used in statistical mode

For this purpose the individual readings are defined as values x_1 , x_2 , x_n , and x_i is any data point:

- Statistical sample population, n - the current number of stored readings on which the statistical analysis is based.

Standard deviation (SD)

$$s = \frac{s}{\bar{x}} = \sum_{i=1}^{i-x} \frac{n}{x_i} \left(\frac{\bar{x}_i^2 - x^2}{(n-1)} \right)^{1/2}$$

- Maximum (MAX) – the highest reading.
- Minimum (MIN) – the lowest reading.
- Mean (MEAN), – The sum of all readings divided by the total number.
- Standard deviation (SD), s- Square root of the sum of squared –deviations from the mean.
- Coefficient of variation (CV), c- Standard deviation divided by the mean, a measure of data scatter.

Coefficient of variation (CV)

$$s = \sum_{i=1}^{i-x} \left(\frac{x_i^2 - x^2}{(n-1)} \right)^{1/2}$$

Preferences

Changing the calibration value

The instrument is supplied with the assigned values of the standard tile stored in the instrument memory. These values are updated when the instrument is recalibrated by an authorised service center. The stored values can also be changed by the end user if an alternative tile is to be used for calibration.

Calibrate at low, medium or high gloss value

It is often desirable to calibrate using a standard that closely matches the gloss of the samples to be tested. Rhopoint supply a range of gloss, semi-gloss and matt tiles to suit all applications. To calibrate the Novo-Curve using a purchased tile, the calibration value in the instrument memory must be adjusted to match the assigned value of the new tile. Rhopoint also supply mirror tiles for verification of measured values at very high gloss levels. The instrument should not be calibrated on a mirror tile.

Change calibration values in the set up menu

Access the hidden set up menu using the following key press combination;

- First press and hold the DOWN button.
- Press and hold the C button whilst continuing to press the DOWN button.
- Wait until "SYSTEM SET UP" appears in the display.
- Scroll up/down until "SET STD CAL VAL." is shown on the display.
- Press the read key to change this value.
- Use the UP/DOWN arrow to adjust to the assigned value of the calibration tile.
- Press the READ KEY when the value is correct, if required repeat the process for the remaining angles.

Change calibration values via Novo-Soft

It is possible to change the stored values when the instrument is connected to a PC running Novo-Soft. For more details follow the connection instructions on page 11 of this manual. Full instructions are contained in the software

help files.



**Press and HOLD the “C”
and “DOWN” keys to enter
the set up menu.**

Customizing the Novo-Curve via the hidden set up menu

Use the following key combination to access the Novo-Curve set up menu;

Press the DOWN KEY whilst simultaneously pressing the C button.

SYSTEM SET UP will be shown in the instrument display.

Use the UP/DOWN buttons to cycle through the available options.

Language

English, French, German, Spanish, Dutch and Italian are the standard languages available in the Novo-Curve; more languages will be added as they become available, visit www.rhopointinstruments.com for a full list or to request additional language support.

Press read key to enter this menu, use the up/down arrows to locate the required language. Press the read key to select.

Statistical/Non-statistical mode

The instrument can be used with or without statistical analysis. In non-stat mode all functions except read and calibrate are disabled. Press the read key toggle between STATS ON/STATS OFF modes.

CONNECTING TO A PC

Install the software

Place the Novo-Soft mini-CD in the drive of a compatible PC. Depending on the settings of your PC the Novo-Soft Installation program should automatically start, alternatively double click on the Novo-Softinstall.exe icon in the relevant CD drive.

Follow the on screen instructions in the install wizard window to install Novo-Soft.

Once installed, double click on the Novo-Soft icon on the desktop to run the software.

Installing the drivers

With the mini-cd in the drive connect the USB cable to a free port on your PC.


Connect the other end of the cable to the instrument.

Turn on the instrument.

The following will be shown:



Click 'no, not this time' and then click 'next'.
Click 'Install from a list or specific location' then click 'next'.

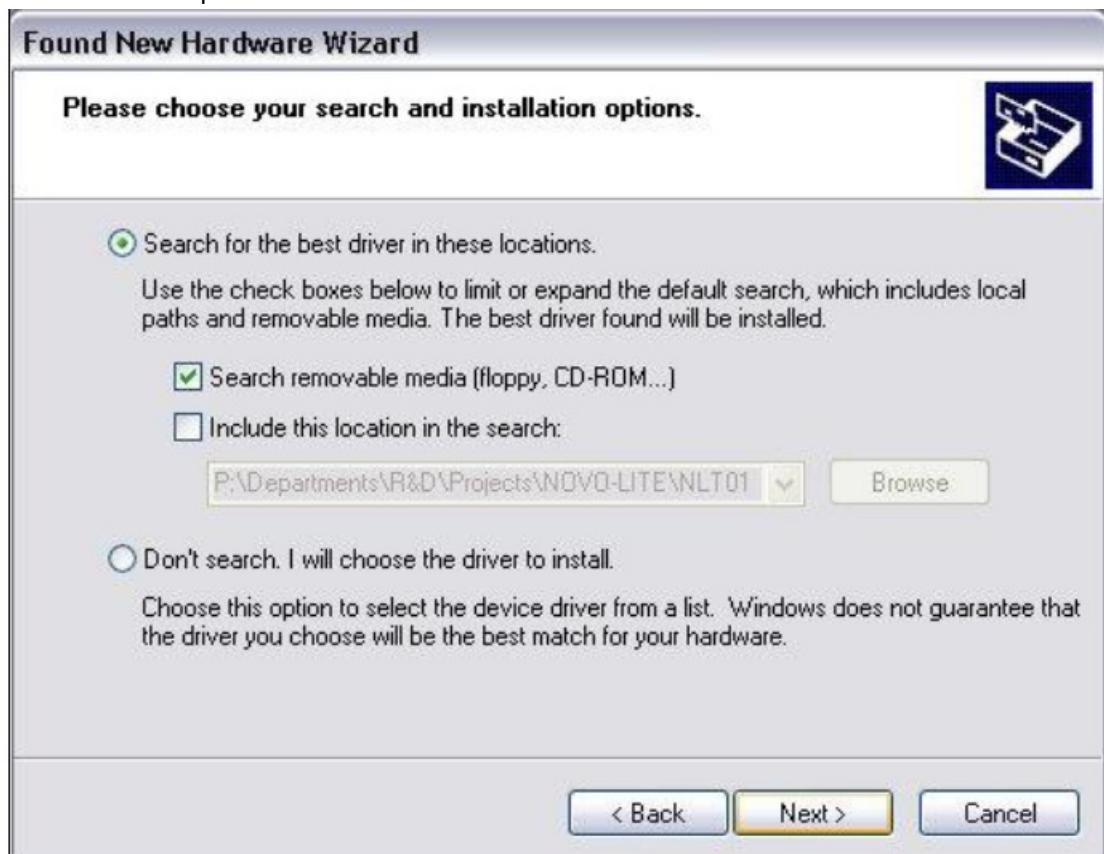

Click 'search removable media' then click 'next'.



The PC should find the driver and install it from the disc.



Click 'finish'.

The PC will detect another new hardware component, follow the above steps again.
Your Novo-Curve is now installed and ready to use.

Connect the instrument

Connect the instrument to a USB port on your PC with the supplied data cable.
In the 'Set-Up' menu ensure that the 'high speed coms' box is ticked.

Click the “CONNECT” icon in the Novo-Soft main menu to open the connection window.
Ensure the instrument is switched on (press the read key).
Press the “CONNECT” button in the connection window to initiate communication.

Downloading results

Use the download buttons to retrieve stored readings from the instrument memory, once downloaded the data can be deleted from the instrument memory using the relevant delete button.

Saving and manipulating data

 
For help using Novo-Soft, click “HELP” in the menu.

CONNECTING

ADVICE

When the instrument has been successfully connected to the PC the auto-power off function is disabled.
Measurements should not be made with the data cable plugged into the instrument as R.F. interference may cause inaccurate readings.

Documents / Resources

	<p>Rhopoint Instruments Ltd Novo-Curve Gloss Meter [pdf] Instructions Novo-Curve Gloss Meter, Novo-Curve, Gloss Meter, Meter</p>
---	--

References

- [Rhopoint Instruments | Appearance & Measurement Experts](#)
- [Rhopoint Instruments | Appearance & Measurement Experts](#)