



SEALEY PP40PLUS.V2 Plasma Inverter 40A with Compressor Instruction Manual

[Home](#) » [SEALEY](#) » SEALEY PP40PLUS.V2 Plasma Inverter 40A with Compressor Instruction Manual 

Contents

- 1 SEALEY PP40PLUS.V2 Plasma Inverter 40A with Compressor
- 2 FAQs
- 3 PRODUCT INFORMATION
- 4 SAFETY
- 5 INTRODUCTION
- 6 SPECIFICATION
- 7 FEATURES
- 8 OPERATION
- 9 TROUBLESHOOTING
- 10 RATING PLATE
- 11 CONTACT INFORMATION
- 12 Documents / Resources
 - 12.1 References



SEALEY PP40PLUS.V2 Plasma Inverter 40A with Compressor




FAQs

- **Q: Can I use the Plasma Inverter without wearing protective gear?**
 - **A:** No, it is essential to wear protective clothing and gloves to ensure safety during operation.
- **Q: What should I do if I notice any damage to the cables or plugs?**
 - **A:** Do not use the product if cables or plugs are damaged. Contact a qualified electrician for repair or replacement immediately.

PRODUCT INFORMATION

- Thank you for purchasing a Sealey product. Manufactured to a high standard, this product will, if used according to these instructions, and properly maintained, give you years of trouble free performance.
- **IMPORTANT:** PLEASE READ THESE INSTRUCTIONS CAREFULLY. NOTE THE SAFE OPERATIONAL REQUIREMENTS, WARNINGS & CAUTIONS. USE THE PRODUCT CORRECTLY AND WITH CARE FOR THE PURPOSE FOR WHICH IT IS INTENDED. FAILURE TO DO SO MAY CAUSE DAMAGE AND/OR PERSONAL INJURY AND WILL INVALIDATE THE WARRANTY. KEEP THESE INSTRUCTIONS SAFE FOR FUTURE USE.

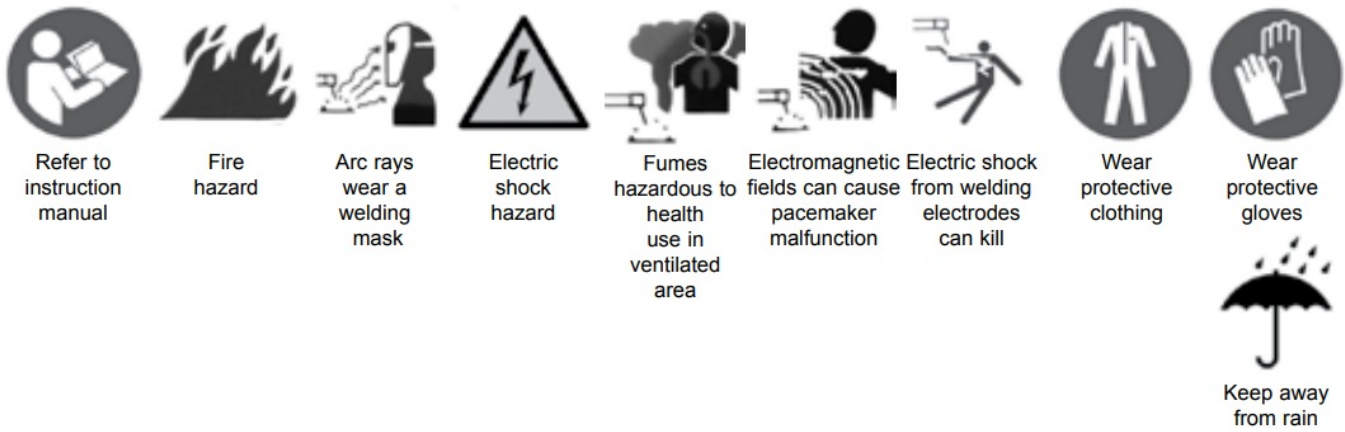

SAFETY

ELECTRICAL SAFETY

- **WARNING!** It is the user's responsibility to check the following:
- Check all electrical equipment and appliances to ensure that they are safe before using. Inspect power supply leads, plugs and all electrical connections for wear and damage. Sealey recommend that an RCD (Residual Current Device) is used with all electrical products.
- If the Plasma cutter is used in the course of business duties, it must be maintained in a safe condition and routinely PAT (Portable Appliance Test) tested.
- For electrical safety information, the following information must be read and understood.
- Ensure that the insulation on all cables and the appliance is safe before connecting it to the power supply. Regularly inspect power supply cables and plugs for wear or damage and check all connections to ensure that they are secure.
- Ensure that the voltage rating on the appliance suits the power supply to be used and that the plug is fitted with the correct fuse see fuse rating in these instructions.
- **DO NOT** pull or carry the appliance by the power cable.
- **DO NOT** pull the plug from the socket by the cable.
- **DO NOT** use worn or damaged cables, plugs, or connectors. Ensure that any faulty item is repaired or replaced immediately by a qualified electrician.
- If the cable or plug is damaged during use, switch the electricity supply and remove it from use. Ensure that repairs are carried out by a qualified electrician.
 - **A)** Connect the GREEN/YELLOW earth wire to the earth terminal 'E'.
 - **B)** Connect the BROWN live wire to the live terminal 'L'.
 - **C)** Connect the BLUE neutral wire to the neutral terminal 'N'.
- Ensure the cable outer sheath extends inside the cable restraint and that the restraint is tight.
- Sealey recommends that repairs be carried out by a qualified electrician.

GENERAL SAFETY

- **WARNING!** Reminder, the electrical installation of the plasma cutting unit must only be carried out by a qualified electrician under relevant national and local regulations.
- **WARNING!** Be very cautious if using a generator to power the inverter. The generator must be self-regulating and stable in voltage, waveform, and frequency. The output must be greater than the power consumption of the

inverter. If any of these requirements is not met the electronics within the inverter may be affected.

- **WARNING** The use of an unregulated generator may be dangerous and will invalidate the warranty.
- **WARNING!** The inverter may produce voltage surges in the main supply which can damage other sensitive equipment (e.g. computers). It is recommended that the inverter is connected to a power supply that does not feed any sensitive equipment.
- DO NOT use an extension lead, because of the voltage drop they produce. This voltage drop can affect the performance of the welder. If you are forced to use an extension lead, check with a qualified electrician.
- **DANGER!** Direct contact with the plasma inverter circuit or torch is dangerous. You **MUST** unplug the inverter from the mains power supply, before connecting or disconnecting cables or performing maintenance or service.
- DO NOT remove the grounding prong or alter the plug in any way.
- DO NOT use any adaptors between the cutter's mains supply and the power source.
- Keep the plasma inverter, cables, and torch in good condition. Take immediate action to repair or replace damaged parts.
- Use recommended parts and accessories only. Unapproved parts may be dangerous and will invalidate the warranty.
- Only use the cutting torch provided and ensure that any replacement is of the same type.
- Use the plasma inverter in a suitable work area. Ensure that the area has adequate ventilation as cutting fumes are harmful.
- For enclosed areas, we recommend the use of an air and smoke extraction system. If you are not able to provide adequate extraction and/or ventilation, wear a respirator suitable for protection against toxic fumes, smoke, and gases.
- Ensure that there are no obstructions to the flow of clean cool air and ensure that there are no conductive dusts, corrosive vapors, or humidity which could enter the unit and cause serious damage.
 - 230V 1ph THE PLASMA INVERTER MUST BE CONNECTED TO A 32AMP SUPPLY FOR MAXIMUM OUTPUT
- **WARNING:** Use a welding head shield to protect your eyes and avoid exposing skin to the ultraviolet rays given off by the electric arc. Always wear protective clothing, insulating gloves, and shoes. Keep all protective items clean and undamaged.
- Remove ill-fitting clothing before wearing protective clothing. Also remove watches, rings, and other loose jewellery that contain long hair.
- Stand correctly, keeping a good footing and balance, and ensure that the floor is not slippery. Wear non-slip shoes.
- Ensure that the workpiece is correctly secured before cutting.
- Avoid unintentional contact with the workpiece. Accidental or uncontrolled switching on of the torch may be dangerous and will wear the nozzle.
- Keep unauthorised persons away from the work area. Any persons working within the area must wear the same protective items as the operator.
- DO NOT use cables and torch if the insulation is worn or connections are loose.
- DO NOT attempt to fit any unauthorized torch or other component to the plasma cutting unit.
- DO NOT cut surfaces that are painted, galvanic coated, oily, or greasy. These surfaces must be cleaned first. Wear a respirator suitable for protection against toxic fumes, smoke and gases.
- DO NOT use cables over 10m in length.
- DO NOT connect the return cable to any structure that is not part of the workpiece (other than a metal work bench supporting the workpiece).

- DANGER! DO NOT cut near flammable materials – solids, liquids, or gases. Remove all flammable materials such as waste rags etc.
- DO NOT cut containers or pipes which have held flammable materials – gases, liquids, or solids. DO NOT cut materials that have been cleaned with chlorinated solvents (or near such solvents) as vapors from the arc action may produce toxic gases.
- DO NOT operate the inverter while under the influence of drugs, alcohol or intoxicating medication, or if tired.
- DO NOT use the plasma inverter for a task it is not designed to perform.
- DO NOT operate the plasma inverter if any parts are damaged or missing as this may cause failure and/or personal injury.
- DO NOT carry, or pull, the inverter by the leads or cables. DO NOT strain or bend the cables, protect them from sharp or abrasive items, and DO NOT stand on them.
- Protect cables from heat. Long lengths of slack must be gathered and neatly coiled. DO NOT place cables where they will endanger others.
- DO NOT hold the unsecured workpiece in your hand.
- DO NOT get the plasma inverter wet or use it in damp locations or areas where there is condensation.
- DO NOT touch the workpiece close to the cut as it will be very hot. Allow to cool. The cut edge of the workpiece will also be very sharp.
- DO NOT touch the torch immediately after use. Allow the torch to cool.
- When not in use store the unit in a safe, dry, childproof area.
- Only operate the equipment on a stable, smooth, and firm surface.

INTRODUCTION

- Features an integral compressor yet weighs only 18.5kg. Inverter power supply fitted with plasma cutter control circuitry.
- With a built-in 4m plasma torch, earth cable, and 4m gas hose.
- Features an LED display for the current output and dial adjustment from 15-40A.
- Three indication lights show voltage input, amps output, and thermal overload.
- Uses air to strike arc making it suitable for use near electrical equipment.
- Ideal for cutting steel, stainless steel, galvanized steel, aluminum, copper, and brass.

SPECIFICATION

- **Model no:**.....PP40PLUS.V2
- **Power Output:**.....15-40A
- **Duty Cycle:**..... 20%@40A, 30%@35A, 60%@25A
- **Maximum Cutting Thickness:**..... 10mm
- **Absorbed power:**.....6.9kW
- **Supply:**.....230V
- **Insulation:**.....F
- **Plug Type:** Bare Wire
- **Protection:**..... IP21S
- **Weight:**..... 18.5kg

Replacement Consumables:

- **Electrode Short (pack Qty.):**..... PP40PLUS.E (5)
- **Nozzle, Short (pack Qty.):**..... PP40PLUS.N (5)
- **Diffuser (pack Qty.):**..... PP40PLUS.D (5)
- **Safety cap (pack Qty.):**.....PP40PLUS.SC (2)

230V 1ph THE PLASMA INVERTER MUST BE CONNECTED TO A 32AMP SUPPLY FOR MAXIMUM OUTPUT

NOTE: IEC 60974-10:2014 specifies applicable standards and test methods for radio-frequency (RF) emissions (refer to DoC).

CONTENTS

Remove contents from the carton and check against the contents list below.

Item	Qty.
Plasma cutter	1
Grounding cable	1
Cutting torch	1
Electrode	3
Tip	3
Instruction manual	1

FEATURES



- **POWER INDICATOR LIGHT fig.1.1**
 - This light will illuminate when the power cord is connected to the mains supply and the power switch, on the rear of the unit, is in the 'ON' position.
- **WORK INDICATOR fig.1.2**
 - When cutting this light will illuminate to show the cutter is in working mode.
- **PROTECTION INDICATOR LIGHT fig.1.3**
 - When the unit is in 'thermal overload', is over-voltage, or lacks voltage, the indicator light will illuminate

and the machine will stop working. When the unit has cooled down and the voltage stabilizes, the unit will return to operation automatically.

- **EARTH CABLE CONNECTION fig.2.5**


- The earth cable connects to the workpiece.

- **CURRENT ADJUSTMENT fig.1.4**

- Varies the output cutting current. Higher output is for thicker metal. The maximum cutting thickness is 10mm for this unit. Maximum cutting thickness varies depending on the material being cut. Refer to Table, fig.3A.

- **TORCH**

- The torch comes fully assembled. Fig.3 below shows how the components are assembled.

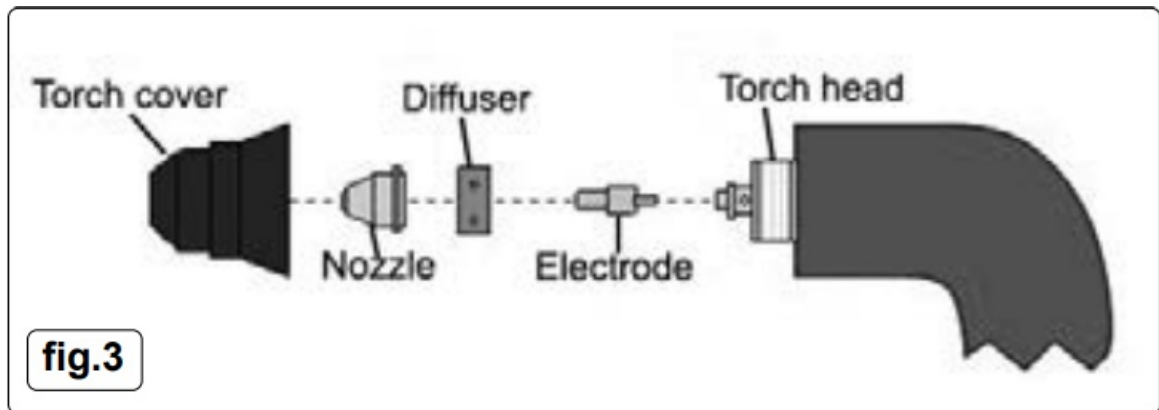

Material	Clean cut
Mild steel	8mm
Stainless steel	6mm
Galvanised	6mm
Aluminium	6mm
Copper	3mm
Brass	3mm

- **fig. 3A**

OPERATION

- **WARNING!** Never allow the torch to be aimed at any part of a body.
- Make sure to wear full PPE, and refer to the Safety section, while operating.
- Work only in well-ventilated areas. If necessary, use exhaust/ventilation fans to keep fumes or emissions away from the breathing zone.
- DO NOT touch the workpiece while cutting.
- Check the unit to see if it has been connected correctly and is in good working condition.
- Follow all safety advice in Section 1 concerning Electrical and General Safety.
- Switch on the unit and observe if the operation is normal: the fan should start up and the power indication light

should be on.

- Pull the trigger: the cutting operation begins after the cutting plasma pilot arc is made.

CUTTING fig.4 Metal sheet cutting


- Connect the earth cable to the workpiece.
- Put the torch's nozzle at the start of the workpiece.
- Turn on the torch switch to ignite the plasma pilot.
- After the work piece is cut through move the torch along the cutting direction uniformly.
- The cutting speed is determined by watching to see if the cut goes all the way through.
- If the speed is too fast the workpiece will not be cut all the way through. If the speed is too slow, the quality of the cut will be affected, excessive warping will occur or the arc could stop.
- When finished turn off the torch, and the plasma pilot arc will stop.

Metal mesh cutting

- Fix the workpiece and connect the earth cable to the workpiece.
- Put the cutting nozzle onto the workpiece, lift the torch slightly, and turn on the switch to cut.

Cutting action

- Unnecessary igniting of the pilot arc in the air will reduce the life span of the torch's electrode and nozzle. Start at the edge of the workpiece unless you are piercing the workpiece.
-

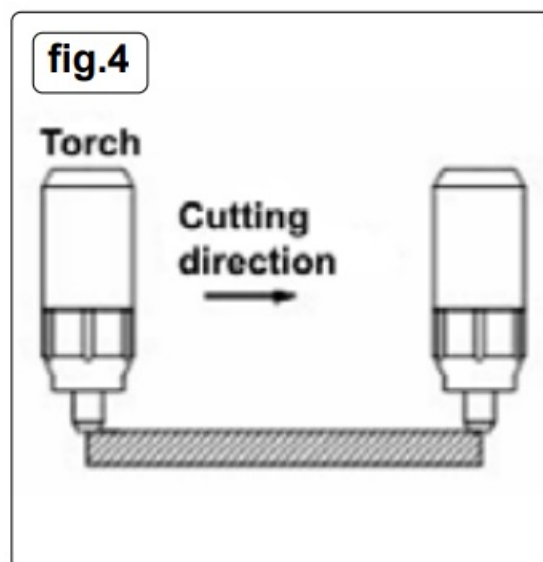

Keep a space between the nozzle and the workpiece. Pressing the nozzle on the workpiece could cause the nozzle to stick, reducing the smoothness of the cutting action.

- Keep the torch vertical against the workpiece and watch to make sure the arc is moving along the cutting line.
- 8 DO NOT rapidly switch the torch trigger on and off this will damage the pilot arc system and the work piece.

TROUBLESHOOTING

Symptom	Possible cause	Corrective action
---------	----------------	-------------------





The power Indicator Light is off after turning on the power supply.	<ol style="list-style-type: none"> 1. The light is broken. 2. The fuse is blown. 3. Not 230V Input Voltage. 4. The power supply switch is broken. 5. The controlling board or cutter is damaged. 	<ol style="list-style-type: none"> 1. Replace. 2. Replace. 3. Connect the 240V Input cable. 4. Replace. 5. Examine and repair.
The fan doesn't work after turning on the power supply.	<ol style="list-style-type: none"> 1. The fan is damaged. 2. The fan's ground lead is broken. 3. The fan's blade is blocked 4. The transformer is damaged. 	<ol style="list-style-type: none"> 1. Replace. 2. Examine and repair. 3. Clean the block. 4. Replace.
Will not cut	<ol style="list-style-type: none"> 1. The discharge gap is too big. 2. The main controlling board is damaged. 3. Ground lead is broken 	<ol style="list-style-type: none"> 1. Adjust to a suitable gap. 2. Replace. 3. Replace. 4. Examine and repair. 5. Examine and repair.
No response after turning on the torch switch.	<ol style="list-style-type: none"> 1. Switch and ground-lead are broken. 2. Switchboard is broken. 3. The main controlling board is damaged. 4. The transformer is damaged. 5. Ground lead is broken. 	<ol style="list-style-type: none"> 1. Examine and repair or replace. 2. Examine and repair or replace. 3. Examine and repair or replace. 4. Replace. 5. Examine and repair.
No response after turning on the power supply.	<ol style="list-style-type: none"> 1. The power cord hooked up wrong. 2. The power supply switch is broken. 3. Fuse is damaged. 4. The transformer is broken. 5. The main controlling board is ruined. 	<ol style="list-style-type: none"> 1. Examine and repair. 2. Replace. 3. Replace. 4. Replace. 5. Examine and repair or replace.

The protection indicator Light comes on.	<ol style="list-style-type: none"> 1. High/low voltage 2. The High/low voltage setting is incorrect. 3. Overheating from exceeding the duty cycle. 4. The bad or broken connection in the thermal relay. 5. The main PCB board is broken. 	<ol style="list-style-type: none"> 1. The tolerant voltage range is 200V ~ 250V. The machine will stop working and indicator will come on if the input power voltage is not between 220V and 240V AC. Please check the voltage with a volt meter. 2. Please open the case to adjust the potentiometer RP3 (for high voltage setting or low voltage setting) on the main control PCB. Note: RP3 should be adjusted clockwise, the RP3 should be adjusted counterclockwise. 3. Wait until the machine cools down. 4. Repaired by the qualified people. 5. Replace.
--	--	---

ELECTROMAGNETIC COMPATIBILITY

 - THIS EQUIPMENT IS IN CONFORMITY WITH THE EUROPEAN STANDARD ON THE ELECTROMAGNETIC COMPATIBILITY OF ARC WELDING EQUIPMENT AND SIMILAR PROCESSES (e.g. ARC AND PLASMA CUTTING)
- PROTECTION AGAINST INTERFERENCE. (E.M.C.) The emission limits in this standard may not, however, provide full protection against interference to radio and television reception when the equipment is used closer than 30m to the receiving antenna. In special cases, when highly susceptible apparatus is being used near, additional mitigation measures may have to be employed to reduce the electromagnetic emissions.
- INSTALLATION AND USE. The user is responsible for installing and using the equipment according to these instructions. If electromagnetic disturbances are detected, then it shall be the responsibility of the user of the equipment to resolve the situation with the technical assistance of the supplier. In some cases, this remedial action may be as simple as earthing the circuit (see Note:). In other cases, it could involve constructing an electromagnetic screen, enclosing the welding power source and the work, complete with associated input filters. In all cases, the electromagnetic disturbances shall be reduced to the point where they are no longer troublesome. Note: The welding/cutting circuit may or may not be earthed for safety reasons. Changing the earthing arrangements should only be authorized by a person who is competent to assess whether the changes will increase the risk of injury, e.g. by allowing parallel welding/cutting circuit return paths which may damage the earth circuits of other equipment.

RATING PLATE

1	MODEL: PP40PLUS	NO.:		
2		EN 60974-1 EN 60974-10		12
3			15 A / 88 V ~ 40 A / 90 V	11
4	$U_0 = 310 \text{ V}$	I_2	30 % 35 A 25 A 19 A	10
		U_2	94 V 90 V 87.6 V	
5	 1 ~ 50/60 Hz	$U_1 = 230 \text{ V}$	$I_{1\text{max}} = 30 \text{ A}$	
6	P21S	7	8	9

1. Part number
2. Internal wiring information
3. Plasma symbol
4. Max open circuit voltage
5. AC supply details
6. Insulation protection rating
7. Rated supply voltage
8. Max RMS current absorbed
9. Effective current supplied
10. X Duty cycle based on 10mins (35% indicates 3.5mins cutting 6.5 mins rest, 100% indicates continuous usage.
I₂ , U₂: current and corresponding voltage.
11. Cutting current range and corresponding voltage.
12. Equipment safety standard.



ENVIRONMENT PROTECTION

Recycle unwanted materials instead of disposing of them as waste. All tools, accessories, and packaging should be sorted, taken to a recycling center, and disposed of in a manner that is compatible with the environment. When the product becomes completely unserviceable and requires disposal, drain any fluids (if applicable) into approved containers and dispose of the product and fluids according to local regulations.



WEEE REGULATIONS


Dispose of this product at the end of its working life in compliance with the EU Directive on Waste Electrical and Electronic Equipment (WEEE). When the product is no longer required, it must be disposed of in an environmentally protective way. Contact your local solid waste authority for recycling information.

- **Note:** It is our policy to continually improve products and as such we reserve the right to alter data, specifications, and component parts without prior notice. Please note that other versions of this product are available. If you require documentation for alternative versions, please email or call our technical team at technical@sealey.co.uk or 01284 757505.
- **Important:** No Liability is accepted for incorrect use of this product.
- **Warranty:** The guarantee is 12 months from the purchase date, proof of which is required for any claim.

CONTACT INFORMATION

- Sealey Group, Kempson Way, Suffolk Business Park, Bury St Edmunds, Suffolk. IP32 7AR
- 01284 757500
- sales@sealey.co.uk .
- www.sealey.co.uk.

Documents / Resources

	<p>SEALEY PP40PLUS.V2 Plasma Inverter 40A with Compressor [pdf] Instruction Manual PP40PLUS.V2 Plasma Inverter 40A with Compressor, PP40PLUS.V2, Plasma Inverter 40A with Compressor, Inverter 40A with Compressor, 40A with Compressor, Compressor</p>
--	---

References

- [User Manual](#)

[Manuals+](#), [Privacy Policy](#)

This website is an independent publication and is neither affiliated with nor endorsed by any of the trademark owners. The "Bluetooth®" word mark and logos are registered trademarks owned by Bluetooth SIG, Inc. The "Wi-Fi®" word mark and logos are registered trademarks owned by the Wi-Fi Alliance. Any use of these marks on this website does not imply any affiliation with or endorsement.