



# CISCO Stealthwatch Flow Sensor Update Patch v7.3.2 User Guide

[Home](#) » [Cisco](#) » CISCO Stealthwatch Flow Sensor Update Patch v7.3.2 User Guide 



## Contents

- [1 Stealthwatch Flow Sensor Update Patch v7.3.2](#)
- [2 Patch Description](#)
- [3 Download and Installation](#)
- [4 Contacting Support](#)
- [5 Copyright Information](#)
- [6 Documents / Resources](#)
  - [6.1 References](#)

## Stealthwatch Flow Sensor Update Patch v7.3.2

This document provides a description of the patch for the Flow Sensor v7.3.2 and the installation process.



There are no prerequisites for this patch.

## Patch Description

This patch, patch-fsuf-ROLLUP005-7.3.2-01.swu, includes the following fix:

Defect	Description
SWD-17734	Fixed an issue where there were duplicate Avro files.



Previous fixes included in this patch are described in Previous Fixes.

## Download and Installation


### Download

To download the patch update file, complete the following steps:

1. Log in to Cisco Software Central, <https://software.cisco.com>.
2. In the Download and Upgrade area, choose Access downloads.
3. Type Secure Network Analytics in the Select a Product search box.
4. Choose the appliance model from the drop-down list, then press Enter.
5. Under Select a Software Type, choose Secure Network Analytics Patches.
6. Choose 7.3.2 from the Latest Releases area to locate the patch.
7. Download the patch update file, patch-fsuf-ROLLUP005-7.3.2-01.swu, and save it to your preferred location.

### Installation

To install the patch update file, complete the following steps:

1. Log in to the Manager.
2. Click the  (Global Settings) icon, then choose Central Management.
3. Click Update Manager.
4. On the Update Manager page, click Upload, and then open the saved patch update file, patch-fsuf-ROLLUP05-7.3.2-01.swu.
5. Choose the Actions menu for the appliance, then choose Install Update.



The patch stops the Flow Sensor engine, then restarts the appliance.

### Previous Fixes

The following items are previous defect fixes included in this patch:

Defect	Description
LVA- 2811	Updated Apache Log4J 2 to v2.15.
SWD- 162 17	Fixed an issue related to segfault errors in Flow Sensor console due to file /etc/udev/rules.d/70-persistent-net.rules being empty.
SWD- 168 68 / SWD- 16906	<p>Fixed an issue where Flow Sensor wasn't supporting mgmt/data interfaces on the same subnet.</p> <p><b>Instructions for adding parameter information to flowsensor.xml:</b></p> <ol style="list-style-type: none"> <li>1. Edit /lancope/var/flowsensor/config/flowsensor.xml.</li> <li>2. Modify sysctl_arp_fix value="1" from 0 to 1 or add one more variable if it does not exist: &lt;sysctl_arp_fix value="1" min="0" max="1" default="0"/&gt; systemctl restart engine</li> </ol>
SWD- 176 13	Fixed an issue where the Flow Sensor engine packet capture page wasn't loading.

## Contacting Support

If you need technical support, please do one of the following:


- Contact your local Cisco Partner
- Contact Cisco Support
- To open a case by web: <http://www.cisco.com/c/en/us/support/index.html>
- To open a case by email: [tac@cisco.com](mailto:tac@cisco.com)
- For phone support: 1-800-553-2447 (U.S.)
- For worldwide support numbers:  
[www.cisco.com/en/US/partner/support/tsd\\_cisco\\_worldwide\\_contacts.html](http://www.cisco.com/en/US/partner/support/tsd_cisco_worldwide_contacts.html)

## Copyright Information





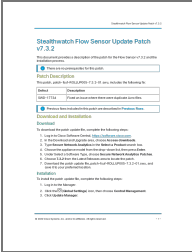


Cisco and the Cisco logo are trademarks or registered trademarks of Cisco and/or its affiliates in the U.S. and other countries. To view a list of Cisco trademarks, go to this URL: <https://www.cisco.com/go/trademarks>. Third-party trademarks mentioned are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (1721R)

© 2022 Cisco Systems, Inc. and/or its affiliates.  
All rights reserved.



	<p><b><a href="#">CISCO Stealthwatch Flow Sensor Update Patch v7.3.2</a></b> [pdf] User Guide</p> <p>Stealthwatch Flow Sensor Update Patch v7.3.2, Stealthwatch Flow, Sensor Update Patch v7.3.2, Update Patch v7.3.2, Patch v7.3.2</p>
--	---

References

-  [Networking, Cloud, and Cybersecurity Solutions - Cisco](#)
-  [Support - Cisco Support and Downloads – Documentation, Tools, Cases - Cisco](#)
-  [Cisco](#)
-  [Cisco](#)
-  [Cisco Software Central](#)
-  [Cisco Software Central](#)
-  [Cisco Trademarks - Cisco](#)