


WHADDA K4401 Sound Generator Instruction Manual

[Home](#) » [WHADDA](#) » WHADDA K4401 Sound Generator Instruction Manual 



velleman®

**SOUND GENERATOR
K4401**

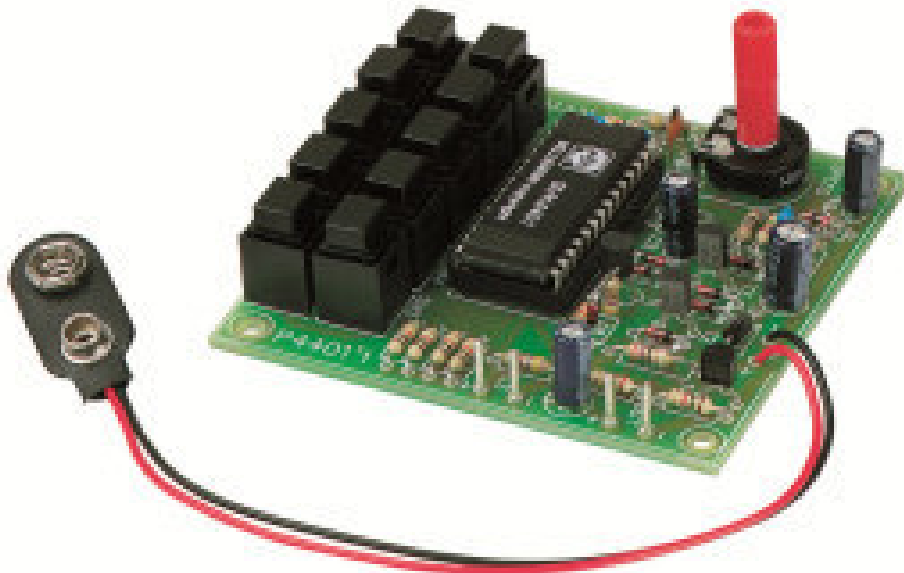

**Sound effects, tunes, sirens ... 10 of
them at the touch of a button.**

Contents

- 1 Specifications
- 2 Features:
- 3 Specifications:
- 4 Effects :
- 5 Assembly (Skipping this can lead to troubles !)
 - 5.1 Make sure you have the right tools:
 - 5.2 Assembly Hints :
 - 5.3 Soldering Hints :
- 6 Diodes. Watch the polarity!
- 7 Zenerdiode. Watch the polarity !
- 8 Resistors
- 9 Metal film resistor
- 10 IC socket. Watch the position of the notch!
- 11 Correction network
- 12 Capacitors.
- 13 Transistors.
- 14 PCB – pins
- 15 Trim potentiometer
- 16 Electrolytic Capacitors. Watch the polarity!
- 17 Push buttons
- 18 IC Watch the polarity!
- 19 Axe.
- 20 Connection & use
- 21 PCB layout.
- 22 Diagram
- 23 Documents / Resources
- 24 Related Posts

Specifications

- Loudspeakers output: 8 ohm/1W
- Line output: 1VRms.
- Power supply : 8 – 10VDC (9v battery).
- Max. current consumption : 100mA
- 10 different Sounds : Sirens, Machine gun, Mortar, Car engine...

Features:

- 10 different Sounds : Sirens, Machine gun, Mortar, Car engine...
- Adjustable sound speed.
- Push-button keyboard.

Specifications:

- Loudspeakers output : 8 ohm/1W
- Line output : 1VRms.
- Power supply : 8 – 10VDC (9v battery).
- Max. current consumption : 100mA


- Secured against polarity reversal of the supply voltage.

Effects :

- Machine-gun (random number of shots with bullet impact).
- European siren.
- Phasor gun (STAR-WARS-like machine-gun).
- Racing-car engine (increase/decrease the number of r.p.m.).
- Car tire screech
- Explosion.
- Mortar shot followed by an explosion.
- Tune: "Wild charge tune".
- Tune: "Snake charmers tune".
- U.S.A. siren.


Assembly (Skipping this can lead to troubles !)

Ok, so we have your attention. These hints will help you to make this project successful. Read them carefully.

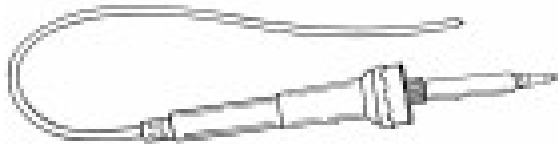


Make sure you have the right tools:

- A good quality soldering iron (25-40W) with a small tip.
- Wipe it often on a wet sponge or cloth, to keep it clean; then apply solder to the tip, to give it a wet look. This is called 'tinning' and will protect the tip, and enables you to make good connections. When solder rolls off the tip, it needs cleaning.

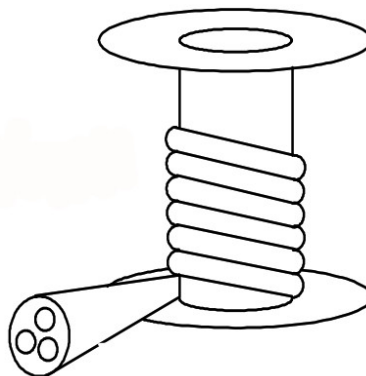


- Thin raisin-core solder. Do not use any flux or grease.
- A diagonal cutter to trim excess wires. To avoid injury when cutting excess leads, hold the lead so they cannot fly towards the eyes.

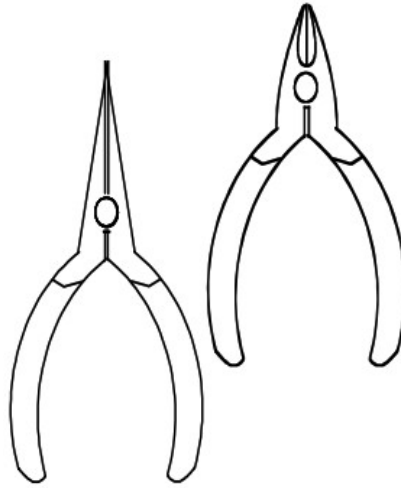

- Needle nose pliers, for bending leads, or to hold components in place.
- Small blade and Phillips screwdrivers. A basic range is fine.



For some projects, a basic multi-meter is required, or might be handy

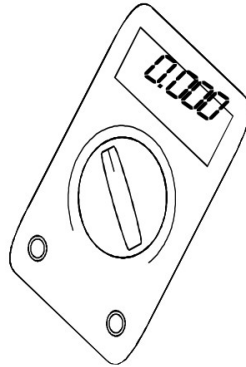


Assembly Hints :

- Make sure the skill level matches your experience, to avoid disappointments.
- Follow the instructions carefully. Read and understand the entire step before you perform each operation.
- Perform the assembly in the correct order as stated in this manual
- Position all parts on the PCB (Printed Circuit Board) as shown on the drawings.
- Values on the circuit diagram are subject to changes.
- Values in this assembly guide are correct*
- Use the check-boxes to mark your progress.
- Please read the included information on safety and customer service



* Typographical inaccuracies excluded. Always look for possible last minute manual updates, indicated as 'NOTE' on a separate leaflet.

Soldering Hints :


1. Mount the component against the PCB surface and carefully solder the leads

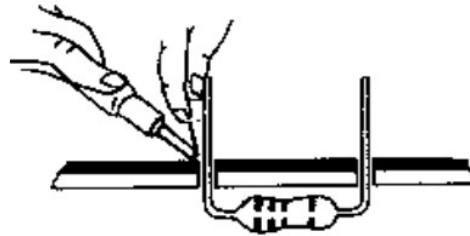

2. Make sure the solder joints are cone-shaped and shiny

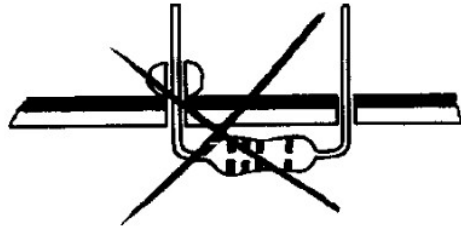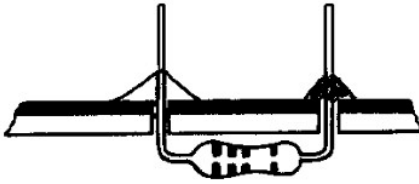


3. Trim excess leads as close as possible to the solder joint

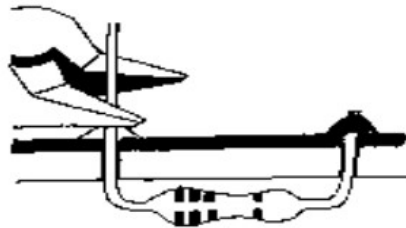


REMOVE THEM FROM THE TAPE ONE A TIME!

AXIAL COMPONENTS ARE TAPED IN THE CORRECT MOUNTING SEQUENCE!

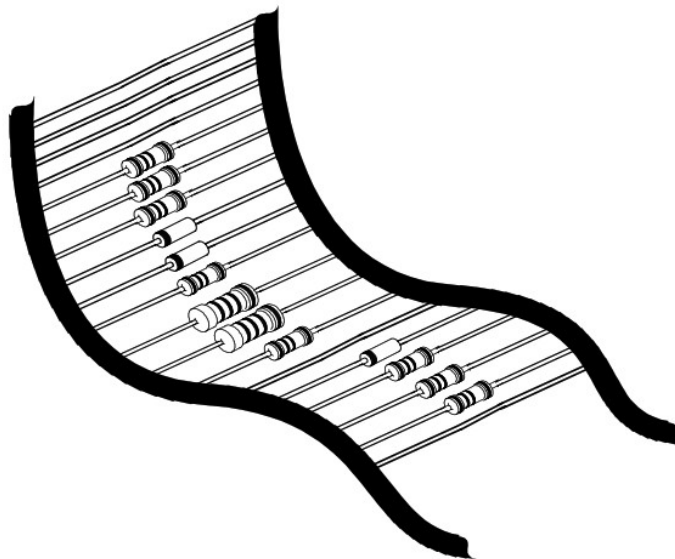


Diodes. Watch the polarity!

- D1: 1N4148
- D2: 1N4148
- D3: 1N4148
- D4: 1N4148
- D5: 1N4148
- D6: 1N4148
- D7: 1N4148
- D9: 1N4148
- D10: 1N4007

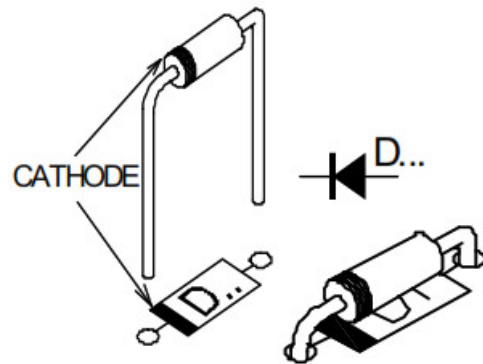


Zenerdiode. Watch the polarity !

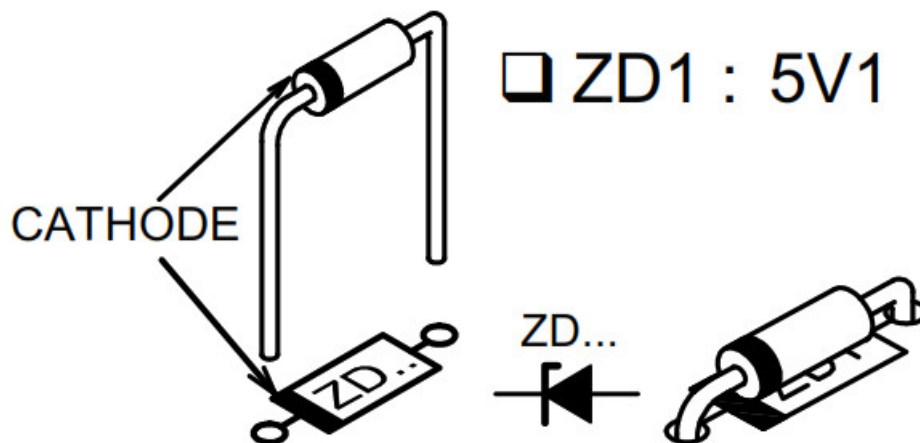

Resistors


)

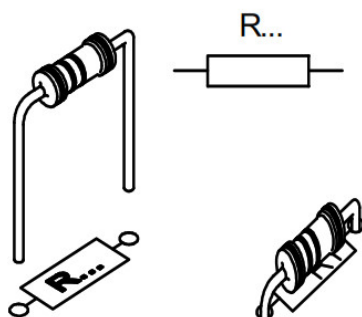

- R1 : 4K7 (4 – 7 – 2 – B)
- R2 : 330 (3 – 3 – 1 – B)
- R3 : 2M2 (2 – 2 – 5 – B)
- R4 : 2K2 (2 – 2 – 2 – B)
- R5 : 10M (1 – 0 – 6 – B)
- R7 : 470 (4 – 7 – 1 – B)
- R8 : 1K (1 – 0 – 2 – B)


- R9 : 10K (1 – 0 – 3 – B)
- R10 : 10K (1 – 0 – 3 – B)
- R11 : 10K (1 – 0 – 3 – B)
- R12 : 10K (1 – 0 – 3 – B)
- R13 : 10K (1 – 0 – 3 – B)
- R14 : 10K (1 – 0 – 3 – B)
- R15 : 3K3 (3 – 3 – 2 – B)

Metal film resistor

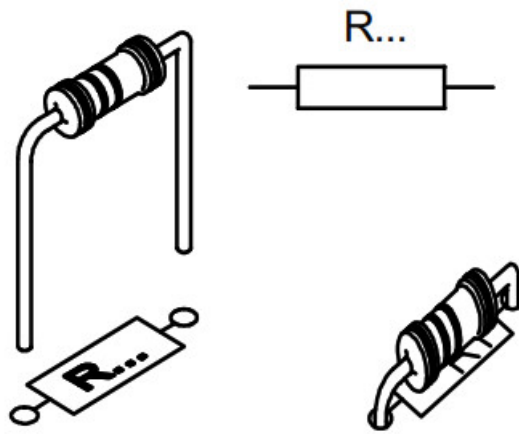

• R6 : 27 (2 – 7 – 0 – B – 9)



IC socket. Watch the position of the notch!

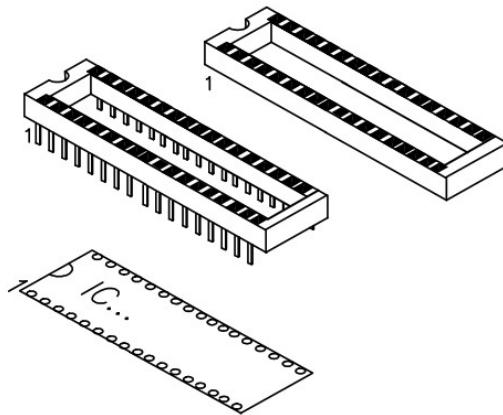

□ IC1 : 28p



Correction network

Fit the diode D8 vertically and with one lead connected for the present.

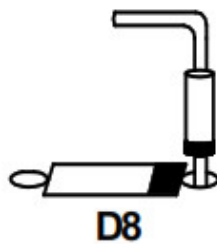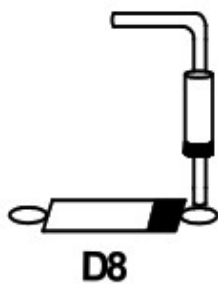


□ D8 : 1N4148

Mount one side of R16 vertically on the anode side of D8.

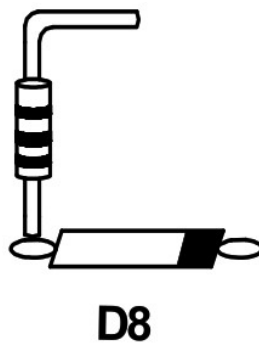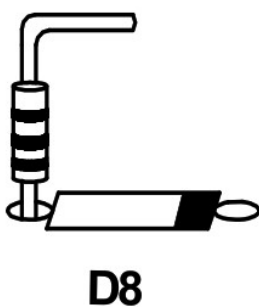

□ R16 : 470

Then connect the free extremities of each diode resistor pair together and cut them.

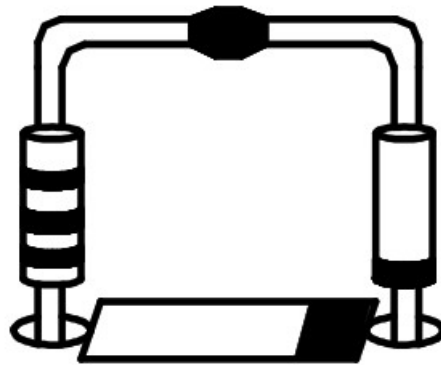

D8


Capacitors.

A diagram showing two capacitors being soldered to a PCB. The capacitors are represented by standard electronic symbols. The PCB is shown as a rectangular board with several pins. The capacitors are being connected to specific pins on the board.	<ul style="list-style-type: none">• C1 : 22pF (22)• C2 : 100nF (104)• C3 : 100nF (104)• C4 : 100nF (104)
---	---


Transistors.

A diagram showing two transistors being soldered to a PCB. The transistors are represented by standard electronic symbols. The PCB is shown as a rectangular board with several pins. The transistors are being connected to specific pins on the board.	<ul style="list-style-type: none">• T1 : BC557B• T2 : BC557B• T3 : BC557B• T4 : BC517
--	--


PCB – pins

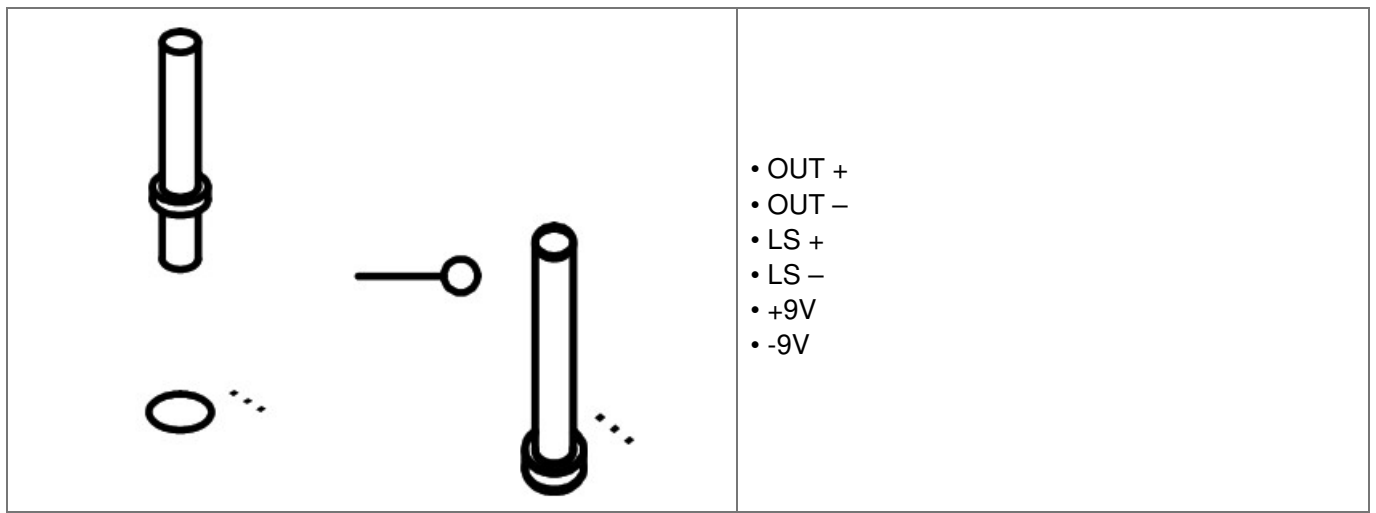


Trim potentiometer

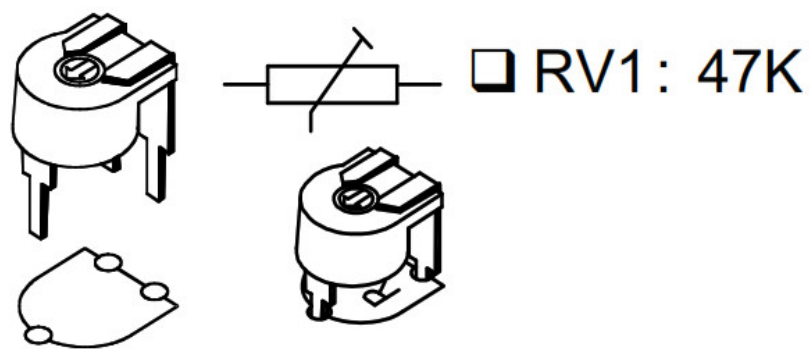


Electrolytic Capacitors. Watch the polarity!

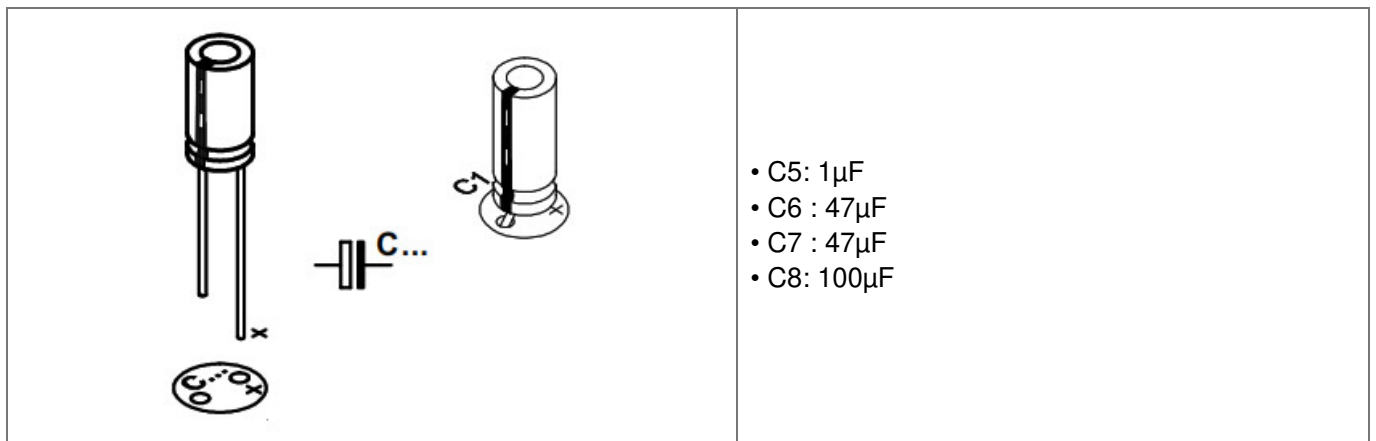

Push buttons

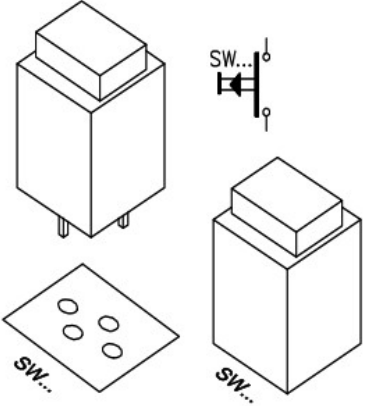
	<ul style="list-style-type: none"> • SW1 • SW2 • SW3 • SW4 • SW5 	<ul style="list-style-type: none"> • SW6 • SW7 • SW8 • SW9 • SW10
---	---	--

IC Watch the polarity!

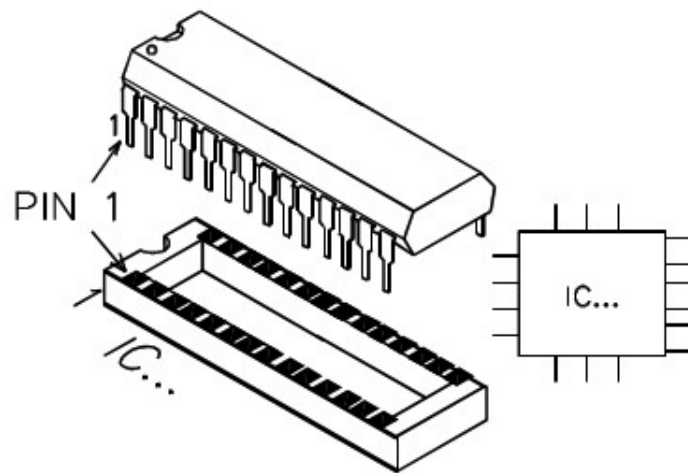

- IC1: VK4401 Programmed PIC16C55A

Axe.

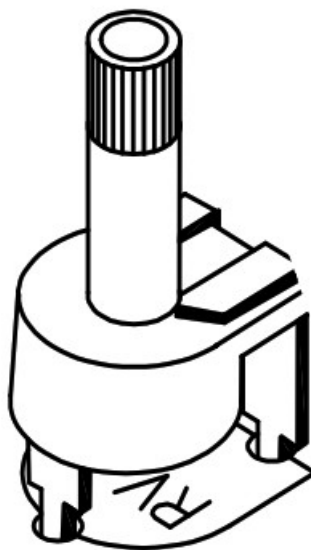

Fit the potentiometer axe.

Connection & use

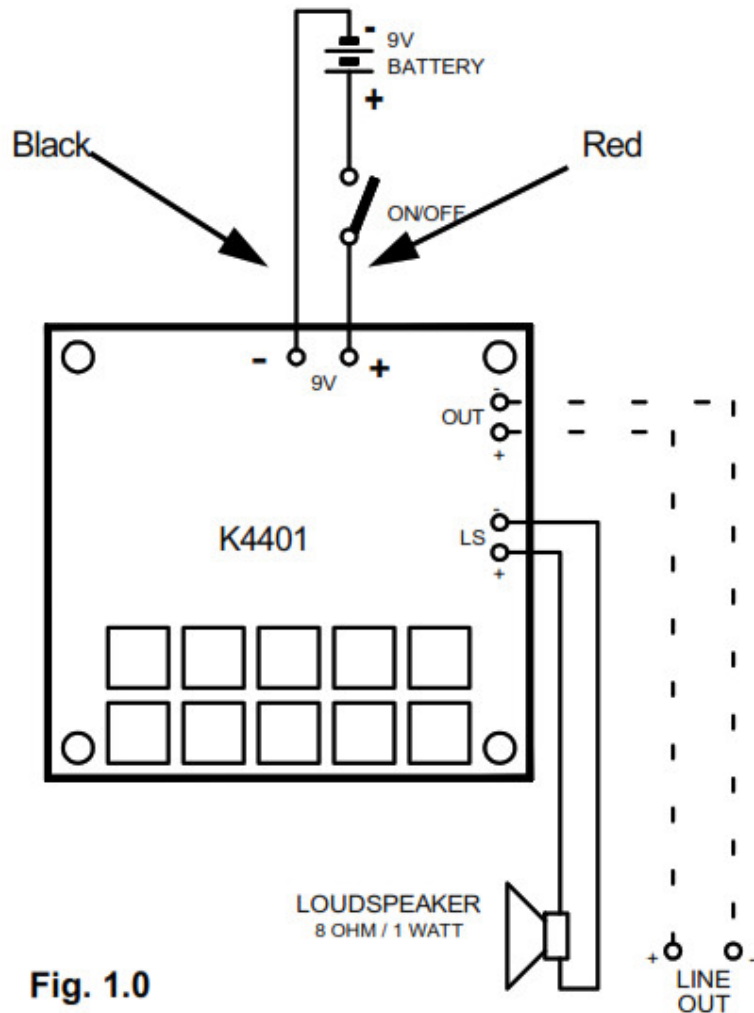


Fig. 1.0

- Turn the potentiometer to its centre position.
- Connect a loudspeaker (8 ohm / 1Watt min.) between the points LS.
- Connect a power supply (9VDC) or a 9V battery between the points +9V and -9V.
- Pressing the different push buttons now causes the respective effects to be produced.




ATTENTION: With some of the effects (e.g. sirens, car engine) it's necessary to keep the push-button pressed. The speed of the effects can be changed (optimized) by turning the potentiometer.

The OUT output allows you to extra amplify the sounds or to connect them to a mixing panel. In this case, you possibly can disconnect the loudspeaker. Thanks to the position of the push buttons and of the potentiometer, this circuit can be built into a plastic housing, or the PCB be counted behind a panel very easily.



Loudspeaker & on/off switch are not included !

PCB layout.

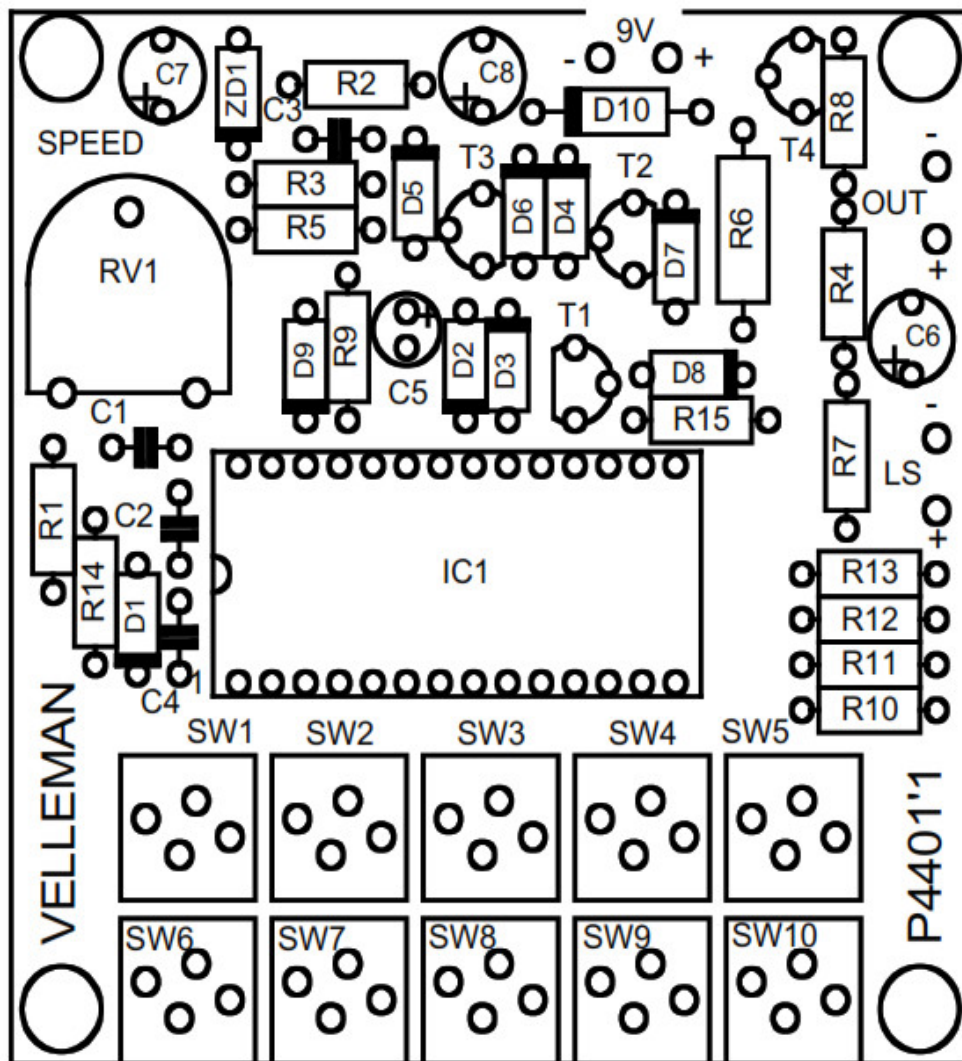

Diagram

VELLEMAN NV
Legen Heirweg 33 9890 Gavere Belgium Europe
www.velleman.be
www.velleman-kit.com



VELLEMAN NV
Legen Heirweg 33, B-9890 GAVERE
Belgium (Europe)



5 410329 291747

Modifications and typographical errors reserved – © Velleman nv. H4401IP'1 – 2014 (rev1)

Documents / Resources



[WHADDA K4401 Sound Generator](#) [pdf] Instruction Manual
K4401 Sound Generator, K4401, Sound Generator