




GREYSTONE CS-675 Series Current Sensor Instruction Manual

[Home](#) » [Greystone](#) » GREYSTONE CS-675 Series Current Sensor Instruction Manual 



GREYSTONE
ENERGY SYSTEMS INC

675 Series Current Sensor
Instruction Manual

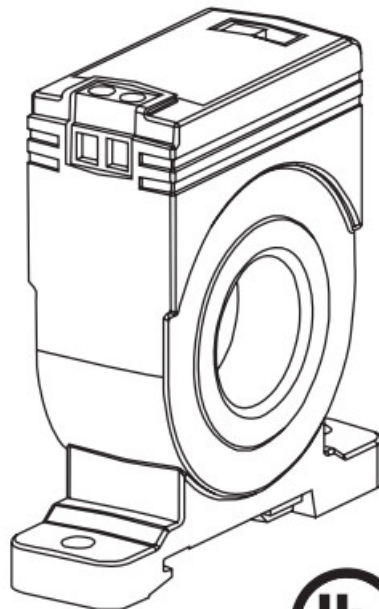

Contents

- [1 INTRODUCTION](#)
- [2 INSTALLATION](#)
- [3 APPLICATION](#)
- [4 SPECIFICATIONS](#)
- [5 DIMENSIONS](#)
- [6 Documents / Resources](#)
 - [6.1 References](#)
- [7 Related Posts](#)

INTRODUCTION

The CS-675 series current sensor monitors line current for electrical loads such as pumps, conveyors, machine tools or fans and outputs an analog true RMS 4-20 mA signal to represent the load current. The sensor is loop powered and requires an external 15-30 Vdc power supply. The power supply must be $10 \text{ Vdc} + (\text{Load} \times 20 \text{ mA})$ where Load is the input resistance of the device measuring the signal. So if Rload is 250Ω the minimum power supply is 15 Vdc. The measured AC line current can be calculated as

$I_{\text{line}} = (I_{\text{loop}} - 4 \text{ mA}) \times \text{Orange} / 16$. The device is factory calibrated to $< \pm 2\%$ FSO and features either three jumper-selectable current ranges or fixed range models

The sensors are typically used to monitor motor operation and can be used to determine motor failure, belt loss, machine feed rates or tool wear.

WARNING

- Electric shock hazard, use caution
- Disconnect and lock out power before installation
- Follow national and local electrical codes
- Read and understand these instructions before installing
- Installation only by qualified electrical personnel
- Do not rely on this device to indicate line power
- Only install this device on insulated conductors
- Only install on 600 Vac maximum conductors
- Do not use this device for life-safety applications
- Do not install in hazardous or classified locations
- Install this product in a suitable electrical enclosure
- Failure to follow these instructions will result in death or serious injury

INSTALLATION

Read all warnings before beginning. Ensure the selected device has the correct ratings for your application. Set the range jumper to the desired range. See Figure 1. The CS-675-2, 5 & 200 each have one fixed range. See Figure 2.

Disconnect and lock out power. Mount the sensor with two screws through the base or snap onto a standard DIN mounting rail. The base has an integrated mounting tab to allow either screw mount to a surface or spring mount to a DIN rail.

To mount the device to a flat surface, select an area that will allow side and top access to wire device. Slide the mounting tab in so that both mounting holes are accessible.

If predrilling is required, the actual device may be used to mark holes or simply cut out the pattern below in Figure 3. The mounting holes in the base will accommodate up to a #10 size screw (Not supplied). See Figure 3

For DIN rail mounting, first slide the mounting tab to its outer position and then hook the fixed end to the DIN rail and finally the tab end may be snapped onto the rail. The tab may be pulled out slightly to allow easier mounting

or to remove the device from the rail. See Figure 4.

Place the monitored conductor (must be insulated) through the sensor hole and reconnect. See Figure 5.

Observe polarity and wire the output to the controller. Use 14-22 AWG shielded wiring for all connections and do not locate the device wires in the same conduit with wiring used to supply inductive loads such as motors.

Figure 4



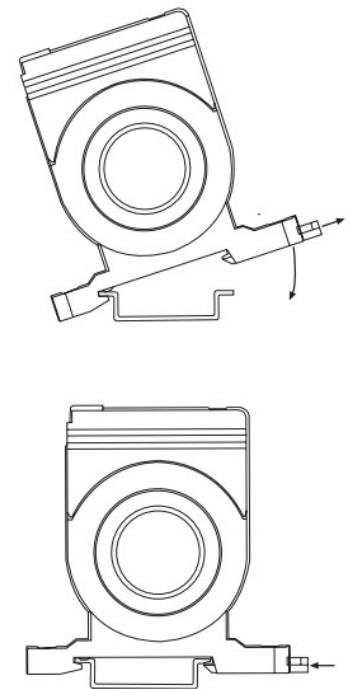


Figure 1

Range Jumper
Selector
Jumper Position Legend




CS-675-R1 Ranges
Low (L) = 0 to 10 Amps
Mid (M) = 0 to 20 Amps
High (H) = 0 to 50 Amps

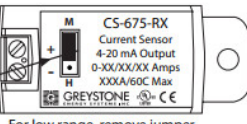

For low range, remove jumper


CS-675-R2 Ranges
Low (L) = 0 to 50 Amps
Mid (M) = 0 to 100 Amps
High (H) = 0 to 150 Amps

Figure 2

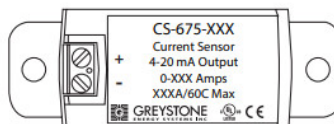

CS-675-2/5/200 Ranges
No setup is required


Figure 3

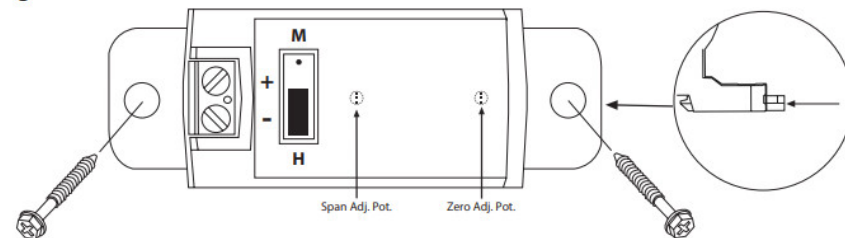

Make all connections in accordance with national and local codes. See Figure 6. Ensure the controller scale matches the sensed range. See specifications for model ranges. Reconnect the power.

APPLICATION

Figure 5

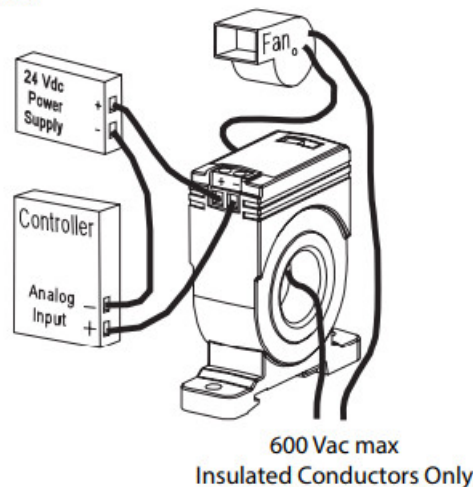

The CS-675 series are factory calibrated to operate within $\pm 2\%$ of FSO. If field calibration is required or a custom measurement range is desired, simply peel back the top label to expose the calibration pots. See Figure 3. The adjustment pots set the current zero (4 mA) and span (20 mA) of the device and may be adjusted by about $\pm 20\%$ of FSO. Repeat each adjustment until both are acceptable.

For applications with load currents exceeding the sensor current ranges use an external CT to reduce the current to an acceptable value. For example, to measure a 500 Amp load current, use a 500A:5A CT and wrap the CT secondary through the CS-675-5 so the sensor output will be 4-20 mA = 0-500 Amps.

For applications with small load currents (such as less than 2 Amps), wrap the monitored conductor through the sensor aperture several times to increase the current measured by the sensor. For example, to measure 0-1 Amp with a CS-675-5, wrap the conductor through the sensor aperture 5 times so the sensor output will be 4-20 mA = 0-1 Amp.





For external CT or multiple wrap applications, ensure the controller is scaled accordingly to obtain correct readings.

For any application with multiple wraps, note that the CS-675 maximum current rating must be divided by the number of wraps. For example, with one wrap the maximum current is 100 Amps for the 50 Amp range, with 5 wraps the maximum current is $100/5 = 20$ Amps. Ensure the load current is < 20 Amps or the device may overheat and be damaged.

Note: These may not be practical applications, select the correct device for the current range required.



SPECIFICATIONS

Measurement Range	CS-675-2: 0-2 Amps CS-675-5: 0-5 Amps CS-675-R1: 0-10/20/50 Amps CS-675-R2: 0-50/100/150 Amps CS-675-200: 0-200 Amps
Maximum Input Current	CS-675-2: 10 Amps continuous CS-675-5: 15 Amps continuous CS-675-R1: 3x range continuous CS-675-R2: 2x range continuous CS-675-200: 250 Amps continuous
Accuracy	CS-675-R1/R2: $\pm 2\%$ FSO (5 to 100% of range) CS-675-2, 5, & 200: $\pm 1\%$ FSO (5 to 100% of range)
Signal Output	4-20 mA
Sensor Power	15 to 30 Vdc (loop-powered)
Insulation Class	600 Vac, insulated conductors
Frequency	20-400 Hz
Response Time	500 mS typical, 0 to 90%
Output Load	.250 Ω typical
Maximum Load	>600 Ω @ 24 Vdc
Operating Temperature	-15 to 60°C (5 to 140°F)
Operating Humidity	5 to 90 %RH non-condensing
Terminal Block	14 to 22 AWG
Dimensions	67 x 68.6 x 24.1 mm (2.65 x 2.7 x 0.95 in)
Sensor Aperture	20.3 mm (0.8 in)
Enclosure Material	ABS/PC, UL94 V-0
Agency Approval	cULus Listed
Country of Origin	Canada

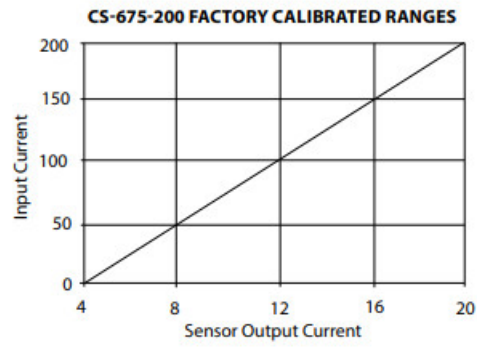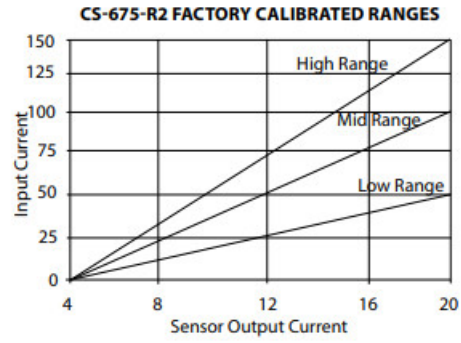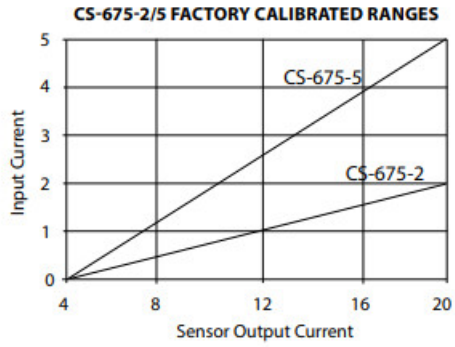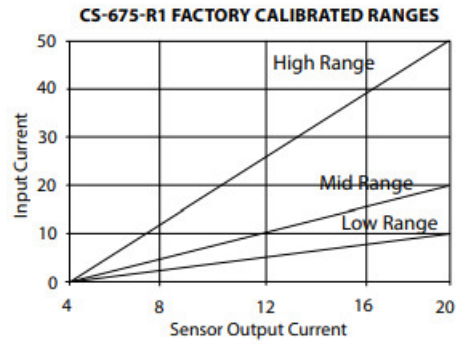

PRINTED IN CANADA

DIMENSIONS

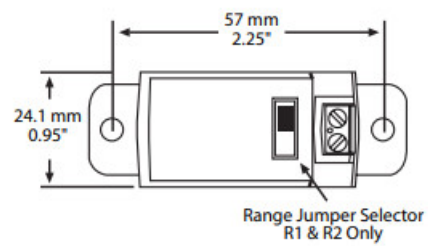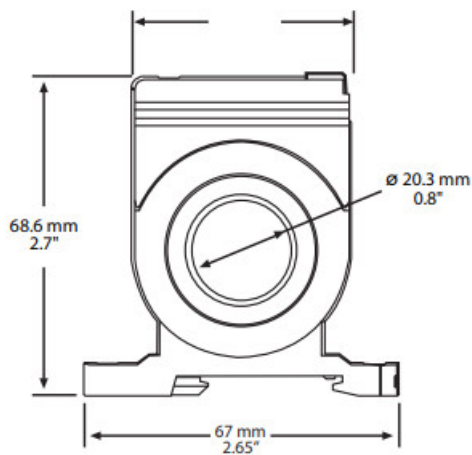

GREYSTONE
ENERGY SYSTEMS INC

IN-GE-CS675XXX-01

Copyright © Greystone Energy Systems, Inc.

Documents / Resources



[GREYSTONE CS-675 Series Current Sensor](#) [pdf] Instruction Manual
CS-675 Series Current Sensor, CS-675 Series, Current Sensor, Sensor

References

-  [Greystone Energy Systems – HVAC Sensors and Transmitters](#)