



VeriMark™ Windows 11 (Windows Hello) Setup Guide

1. Click on **Start** on the taskbar and click on **Settings**

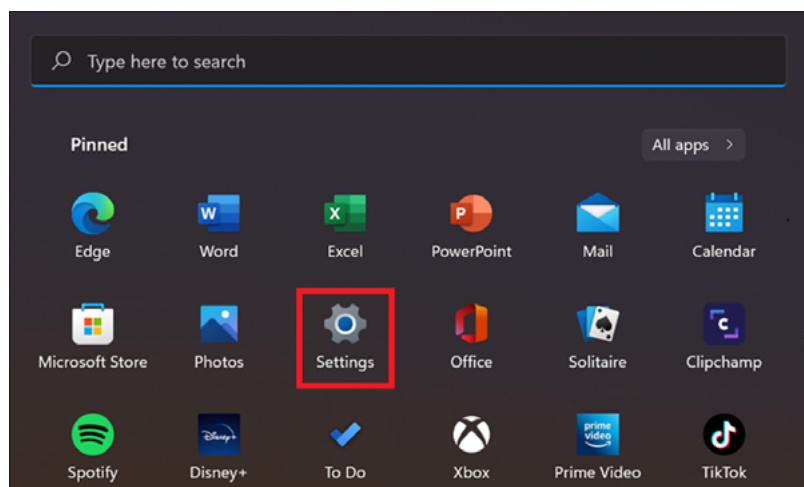


2. Click on **Accounts** to show sign in options.

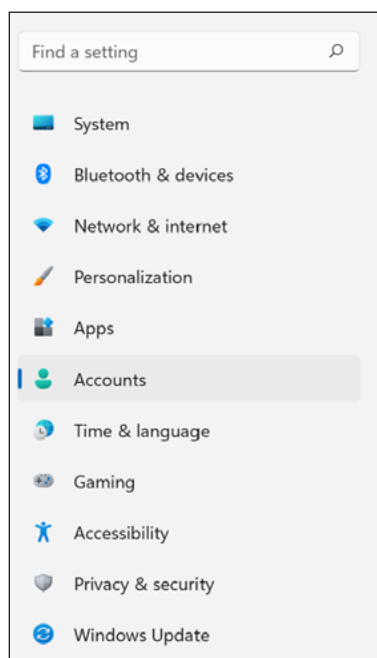


Verimark Windows 11 (Windows Hello) Setup Guide


3. Click on Sign-in options

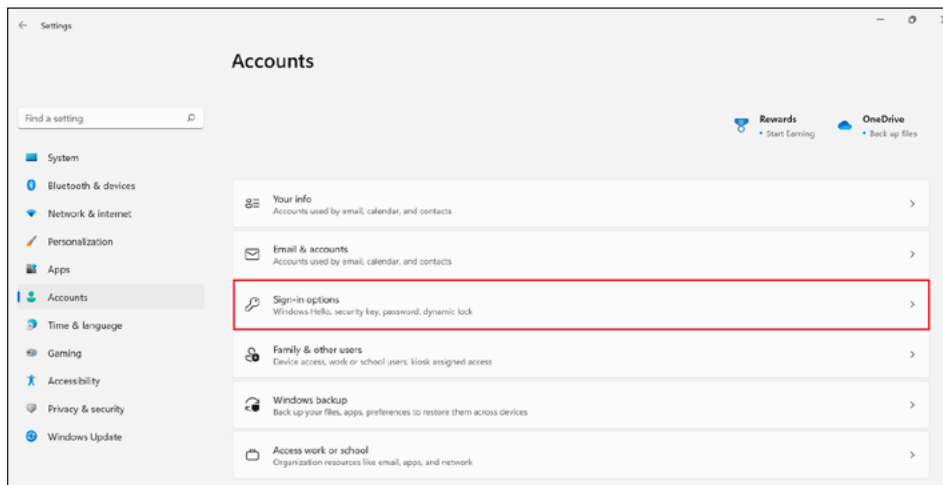


4. Alternatively, you can click on the magnifier glass on the taskbar and search for “Windows Hello”

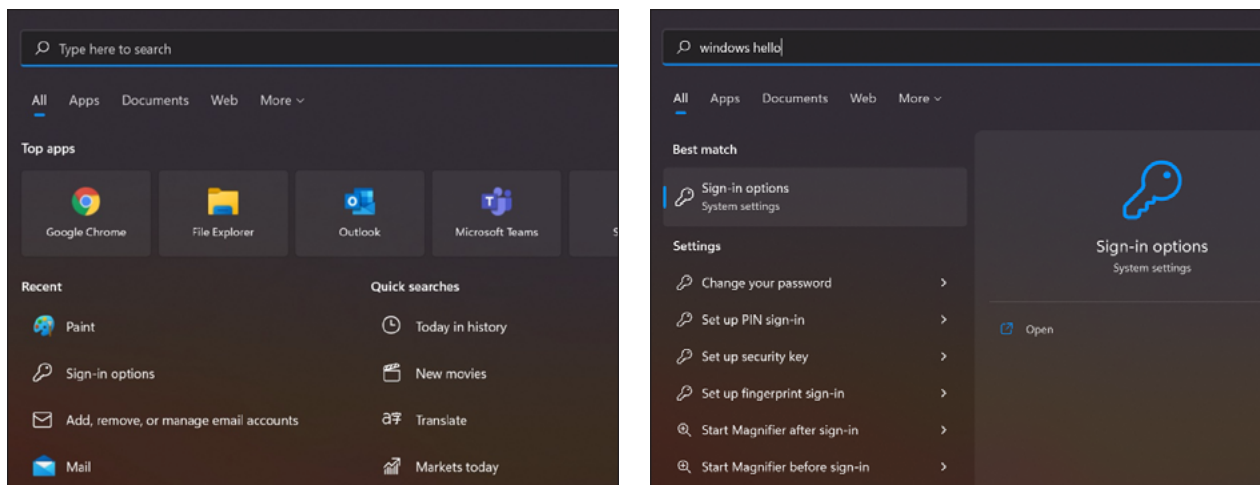


5. Click on Fingerprint recognition (Windows Hello) and Set up

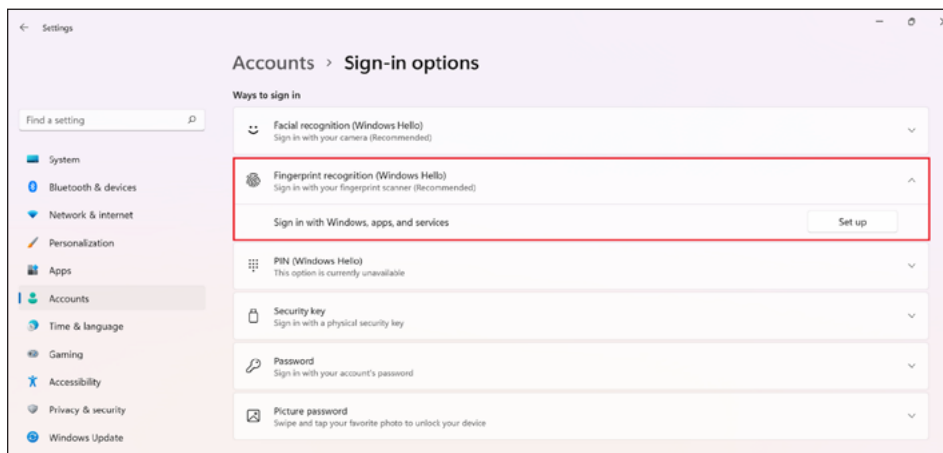


6. On the next window click on **Get Started**

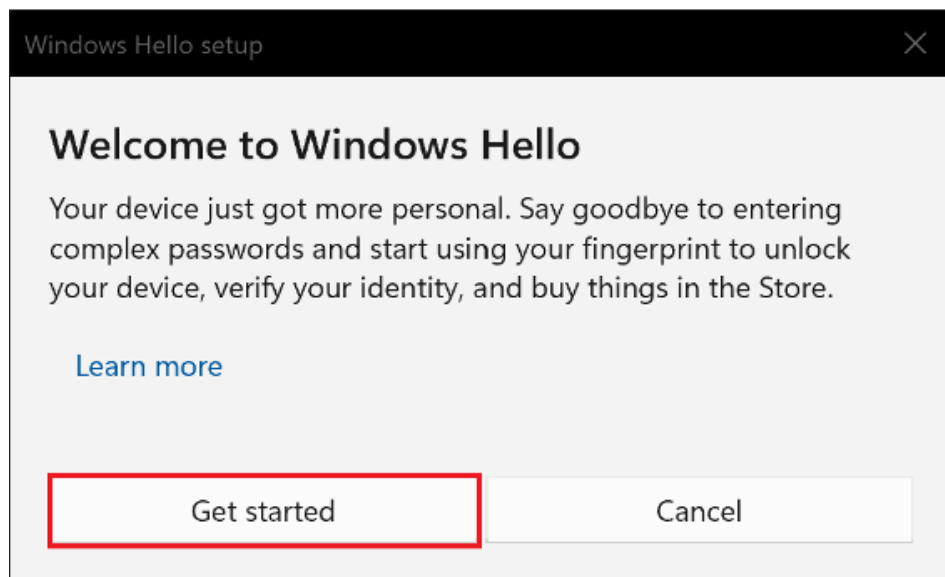


7. If it is the first time using Windows Hello, you need to add a security PIN. Enter a security key PIN then click OK for next step

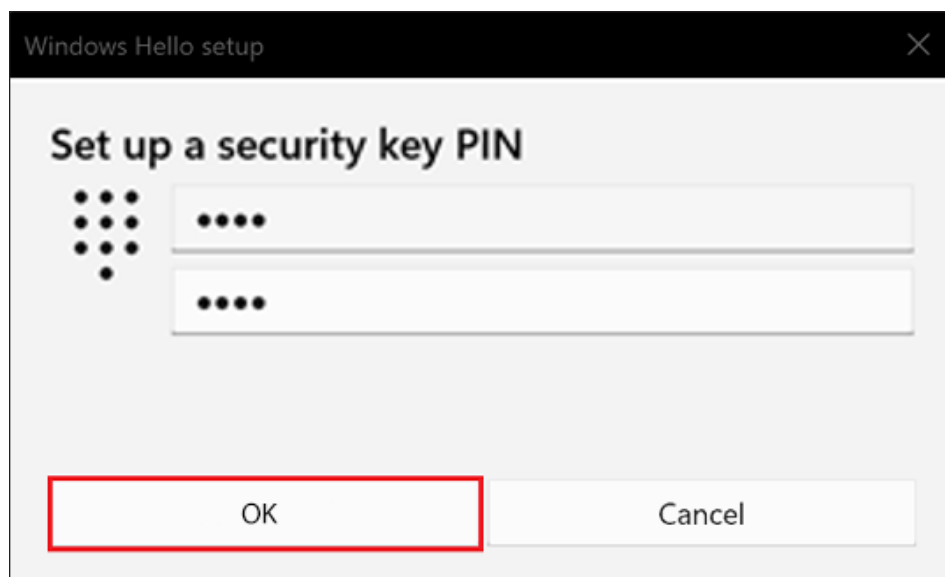


8. Once PIN has been set up enter it on the **Windows Hello setup**

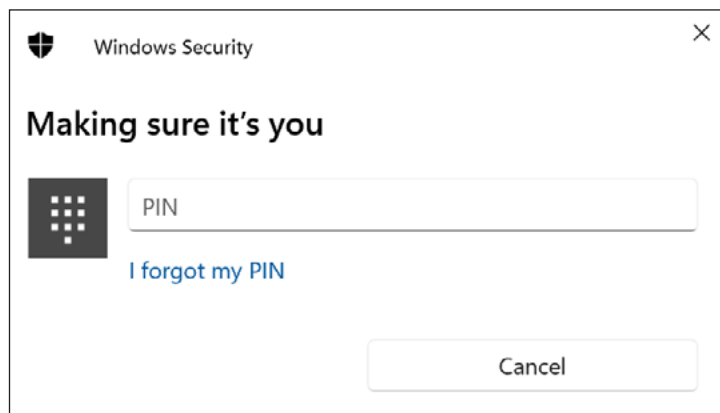

9. Touch the fingerprint sensor area repeatedly

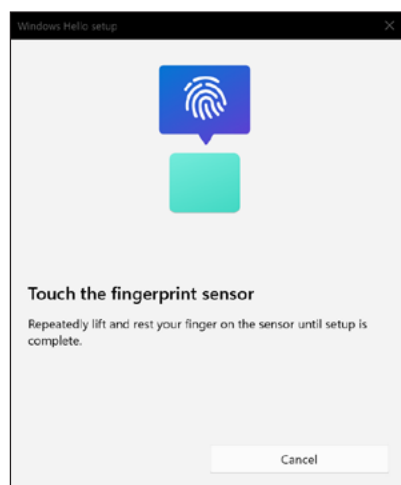


10. Continue lifting and touching the sensor to read fingerprint

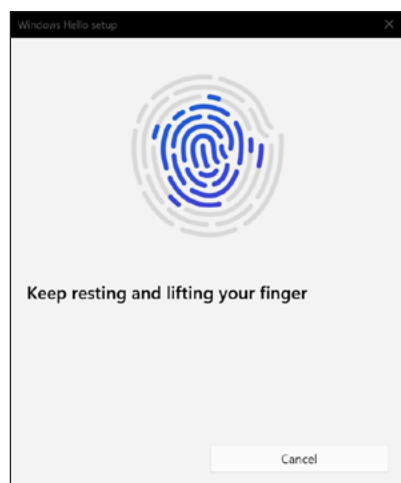

Verimark Windows 11 (Windows Hello) Setup Guide

11. Click **Close** to finish fingerprint enrollment or **Add another finger** to set up another fingerprint

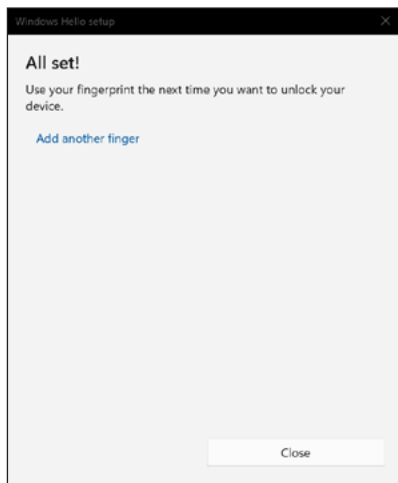

12. To remove the fingerprint from the USB dongle click on **remove**

