Service Manual

Blu-ray Disc Recorder
Model No. DMR-PWT500GL
DMR-PWT500GZ



Notes: This model's BD Drive is VXY2119

When replacing HDD, Main P.C.B. or EEPROM "HDD Error" indication is displayed and HDD must be formatted.


After that, <u>programme in the HDD will be lost.</u>
In detail, please refer to each content in this service manual.


Vol. 1
Colour:
(K).....Black Type

15 Parts and Exploded Views


15.1. Exploded View and Mechanical Replacement Parts List

15.1.1. Casing Parts & Mechanism Section

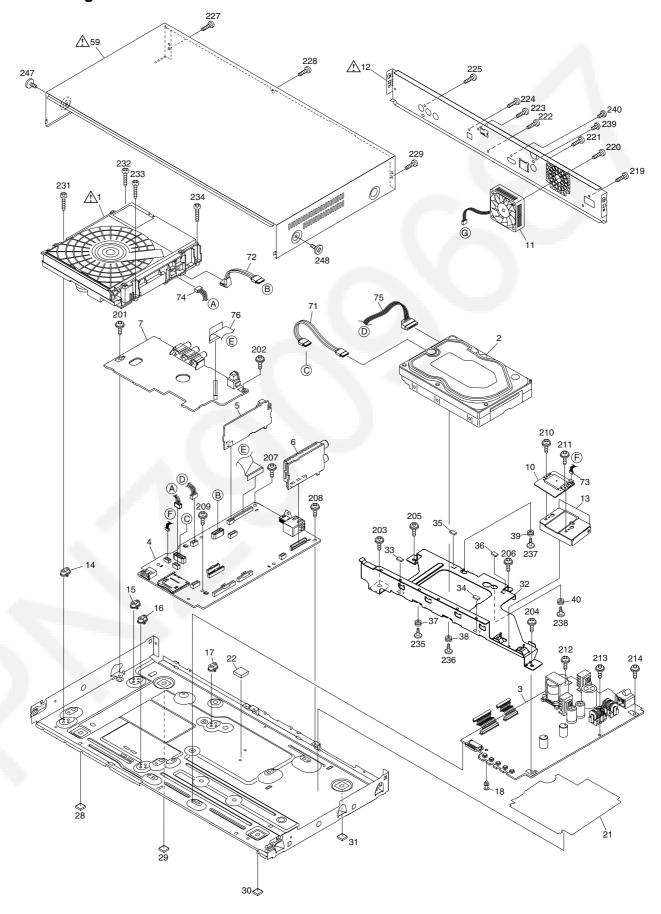

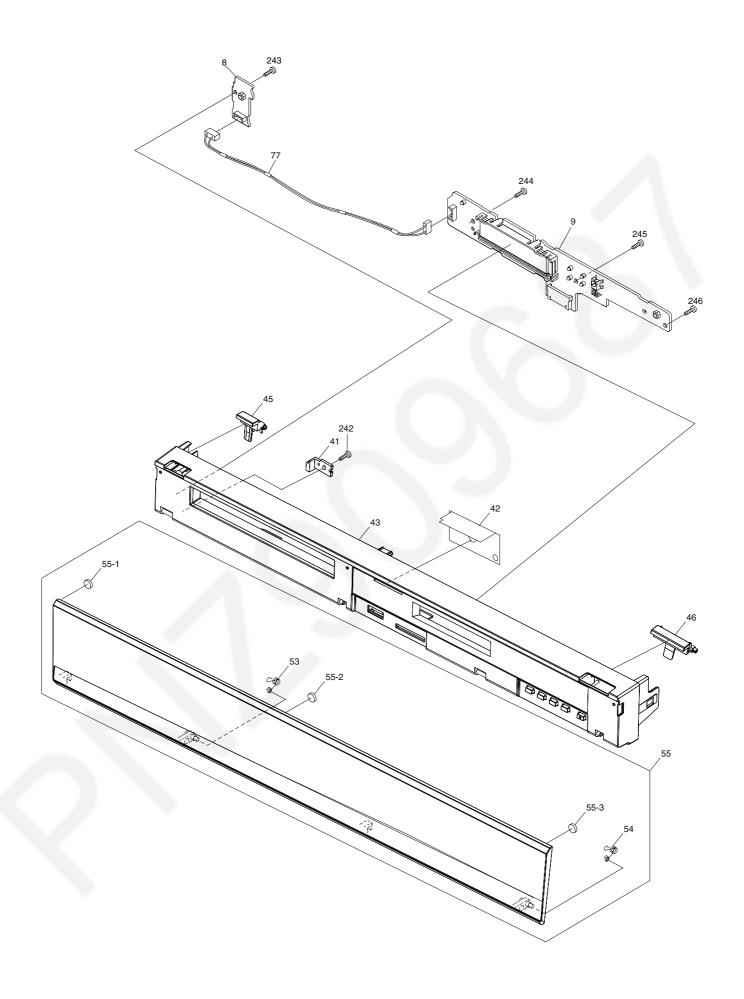

15.1.2. Exploded View OF BD drive (Mechanism Section)

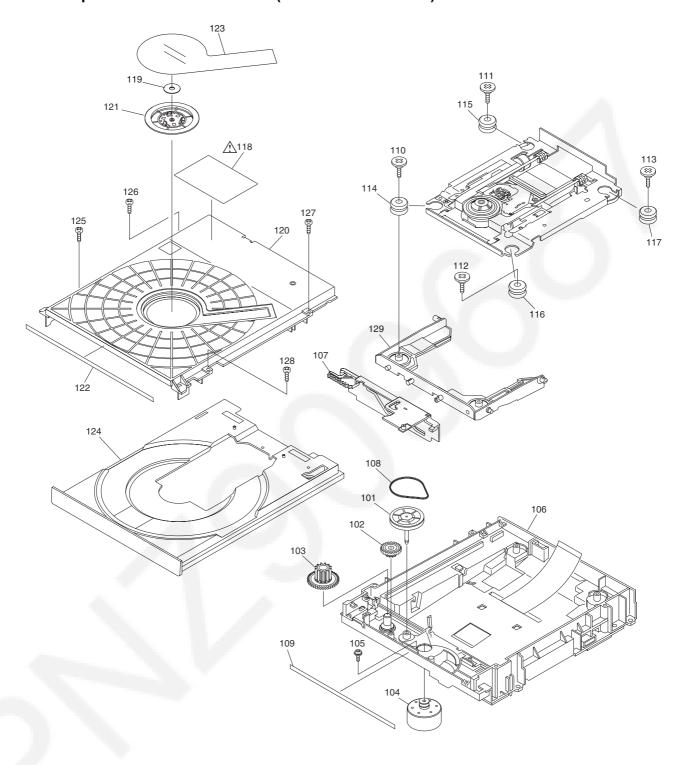

15.1.3. Packing & Accessories Section

