

# LEA Connect 4.0.3.6 Firmware Update Readme

\*\*\*NOTE – This firmware file is for 80, 160, 350, and 700 watt models (not including –ADSP models).

# **Firmware update instructions:**

- The firmware updater is located in the WebUI in the top right corner. Click the Hamburger Menu, Choose File, and then Update Firmware.
- Click 'Choose Firmware File' <u>unzip the firmware update file</u> and select .tar.xz file (ASBT-4-0-3-6-V2.tar.xz.enc) then click "update amps"
  - **NOTE:** All amplifiers on the same network will be updated.
- The shark fin will turn magenta during the update process, please do not turn off or power cycle the amplifier until the firmware update is complete.
- Once the shark fin is blue and the LCD screen is illuminated, the firmware update process is complete.
- While not required, it is recommended to power cycle the amp with the power cord after the firmware update is complete.
- 350W and 700W models will take ~5 minutes to update firmware
- 80W and 160W models *may* take up to 15 minutes to update firmware

To Confirm the update was successful, click on the ① and then Amp Settings. Scroll down to Device Information and you should have the following Firmware versions:

#### **350W and 700W Models:**

Firmware Version: 4.0.3.6

Power Supply Version: 4.0.3.0

Amp1234 Version: 4.0.3.0


### 80W and 160W Models:

Firmware Version: 4.0.3.6

Power Supply Version: 4.0.3.1

Amp1-8 Version: 4.0.3.2

#### Click the Hamburger Menu

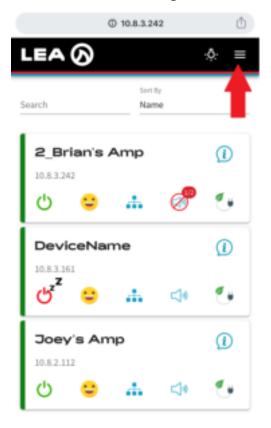

#### Click 'Firmware Update'



- 1. Choose file: ASBT-4-0-3-6-V2.tar.xz.enc
- 2. Click 'Update Amps'



# **Features and Improvements in 4.0.3.6:**

# **WebUI and General Updates**

- Added Input Mixer Functionality
- Added Chinese and Spanish Language Support
- Added CS Touch configuration via WebUI

# **Sharkware Specific Updates**

Added User Access Control of the WebUI to lock out specific parameters

# **Amplifier Updates**

Resolves an issue with 80/160 that may report AC current draw incorrectly