


# velleman K8035 Advanced UP/DOWN Counter Installation Guide

Home » Velleman » velleman K8035 Advanced UP/DOWN Counter Installation Guide 1



### velleman K8035 Advanced UP/DOWN Counter Installation Guide

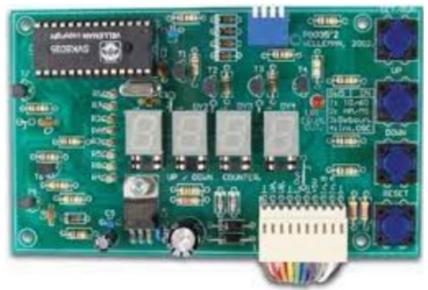

#### **Contents**

- 1 Features & Specifications
- 2 Assembly (Skipping this can lead to troubles!

- 3 Jumpers
- **4 Connection**
- **5 Operation**
- 6 PCB
- 7 Schematic diagram.
- 8 Documents / Resources
  - 8.1 References
- 9 Related Posts

#### **Features**

- · Count up or down.
- Count input trough on-board push buttons or by external pulses.
- Display modes: Normal or time (hh:mm and mm:ss).
- · An internal oscillator allows time measurement.
- Programmable pre-set value with equal output.
- Self diagnostic at power up.
- Comes whit easy board to wire connector (20cm wire).
- · Comes in handy for people counting, part counting, score keeping,

#### **Specifications**

• Counter Input: 3...12 VDC (normal dry contact also possible)

• EQUAL Output: 5VDC / max 50mA

• Max. Counting speed: 200 / sec. (2 / sec. with long debounce delay)

• Max. Count: 4 Digits (9999 / 23h59m / 59m59s)

• Power supply: 9...12 VDC or transformer 2 x 9 VAC type: 209005

• Power consumption: 150mA max.

• **Dimensions**: 125 x 75 x 18mm (4,9"x3"x0,7")


### Assembly (Skipping this can lead to troubles!)

Ok, so we have your attention. These hints will help you to make this project successful. Read them carefully.


### Make sure you have the right tools:



- A good quality soldering iron (25-40W) with a small tip.
- Wipe it often on a wet sponge or cloth, to keep it clean; then apply solder to the tip, to give it a wet look. This is called 'thinning' and will protect the tip, and enables you to make good connections. When solder rolls off the tip, it needs cleaning.

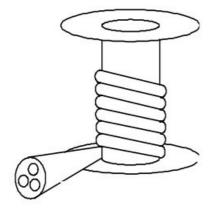


- Thin raisin-core solder. Do not use any flux or grease.
- A diagonal cutter to trim excess wires. To avoid injury when cutting excess leads, hold the lead so they 6k09
  cannot fly towards the eyes.

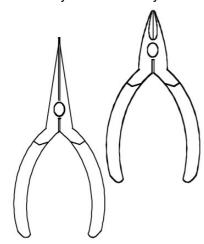

- Needle nose pliers, for bending leads, or to hold components in place.
- Small blade and Phillips screwdrivers. A basic range is fine.

For some projects, a basic multi-meter is required, or might be handy

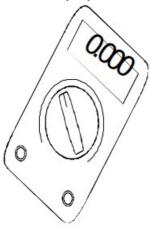




- Make sure the skill level matches your experience, to avoid disappointments.
- Follow the instructions carefully. Read and understand the entire step before you perform each operation.
- Perform the assembly in the correct order as stated in this manual
- Position all parts on the PCB (Printed Circuit Board) as shown on the drawings.
- · Values on the circuit diagram are subject to changes.
- Values in this assembly guide are correct\*
- Use the check-boxes to mark your progress.
- · Please read the included information on safety and customer service


Typographical inaccuracies excluded. Always look for possible last minute manual updates, indicated as 'NOTE' on a separate leaflet

### **Soldering Hints:**


1. Mount the component against the PCB surface and carefully solder the leads

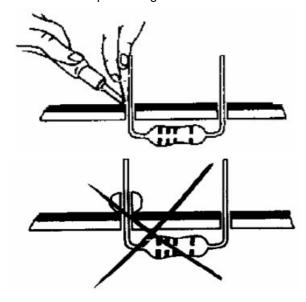


2. Make sure the solder joints are cone-shaped and shiny

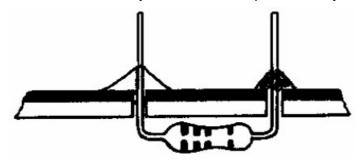

3. Trim excess leads as close as possible to the solder joint

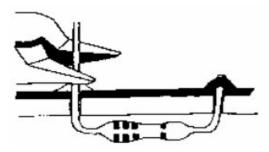


REMOVE THEM FROM THE TAPE ONE AT A TIME!

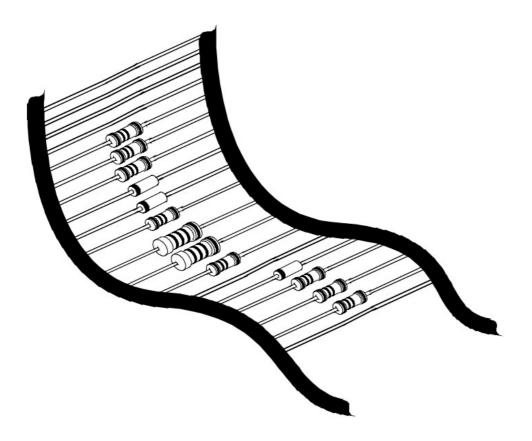

AXIAL COMPONENTS ARE TAPED IN THE CORRECT MOUNTING SEQUENCE!

## **Jumpers**

• J:10x

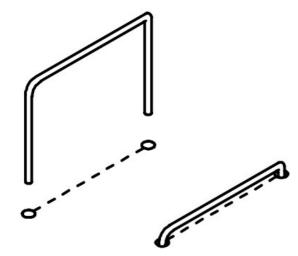

## Diodes. Watch the polarity!

• **D1**: 1N4007

• **D2:** 1N4007


• D3: 1N4148

• **D4**: 1N4148

• **D5**: 1N4148


• **D6**: 1N4148

• **D7**: 1N4148

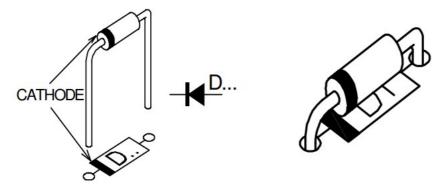

### Zener diode. Watch the polarity!

ZD1: 4V7ZD2: 4V

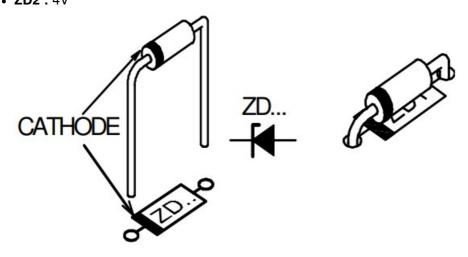

#### **Resistors**

• **R9**: 10K (1-0-3-B)

• R10: 10K (1-0-3-B)

• R11: 10K (1-0-3-B)

• R12: 10K (1-0-3-B)

• R13: 10K (1-0-3-B)

• R14: 2K2 (2-2-2-B)

• R15: 2K2 (2-2-2-B)

• R16: 2K2 (2-2-2-B)

• R17: 2K2 (2-2-2-B)

• R18: 4K7 (4-7-2-B)

• R19: 4K7 (4-7-2-B)

• **R20**: 10K (1-0-3-B)

• **R21**: 10K (1-0-3-B)

• R22: 10K (1-0-3-B)

• **R23**: 10K (1-0-3-B)


• R24: 10K (1-0-3-B)

• R25: 10K (1-0-3-B)

• **R26**: 10K (1-0-3-B)

• **R27**: 10K (1-0-3-B)

• **R28**: 390 (3-9-1-B)

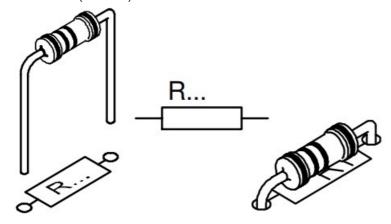


#### **Pushbuttons**


• SW1: KRS1243

• SW2: KRS1243

• SW3: KRS1243


• SW4: KRS1243

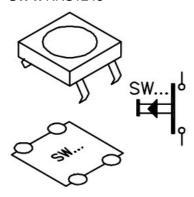

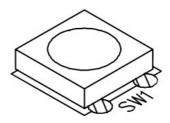

### Voltage Regulator.

• VR1: UA7805

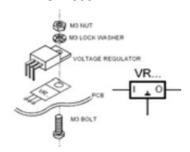


### IC sockets. Watch the position of the notch!

• IC1: 28P

• **DY1**: 14P


• **DY2**: 14P

DY3: 14PDY4: 14P

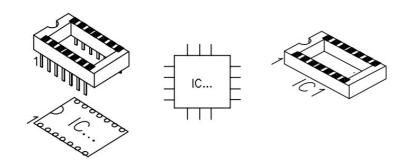

## LED. Watch the polarity!


• **LD1**: 3mm Red.

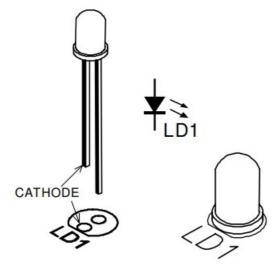

## **Ceramic Capacitors**

C1: 18pF (18,18J)
C2: 18pF (18,18J)
C3: 100nF (104)
C4: 100nF (104)
C5: 100nF (104)
C6: 1nF (102)

• **C7**: 1nF (102)

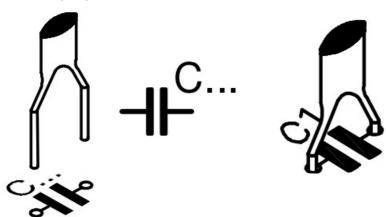

#### **Transistors**

• T1: BC557C

• T2: BC557C


• T3: BC557C

• T4: BC557C

• T5: BC557C

• **T6**: BC547

• **T7**: BC547

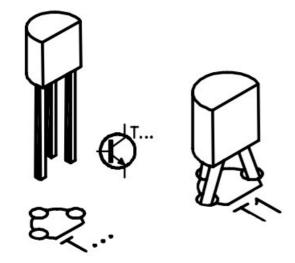

#### **Resistors**

• **R1**: 150 (1-5-1-B)

• **R2**: 150 (1-5-1-B)

• **R3**: 150 (1-5-1-B)

• **R4** : 150 (1-5-1-B)

3 III : 100 (1 0 1 B)

• **R5**: 150 (1-5-1-B)


• **R6**: 150 (1-5-1-B)

• **R7**: 150 (1-5-1-B)


• **R8**: 150 (1-5-1-B)

#### Connector

• 10p

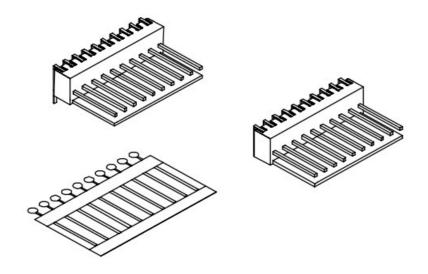


### **DIP Switch**

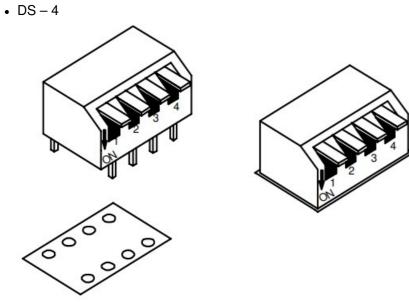


## **Quartz crystal**

• **X1**: 4,1943... MHz.

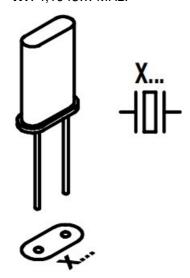


• **C8**: 470μF

• **C9**: 10μF

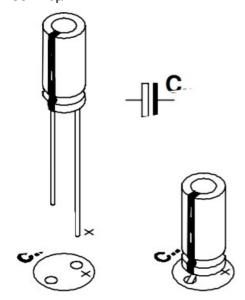


## Display

• SA39-11EWA

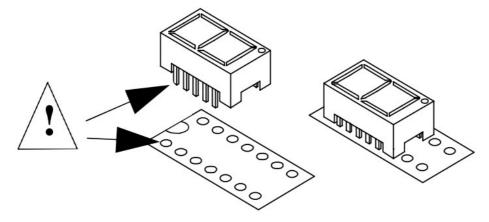


## IC, Check the position of the notch!

• IC1: VK8035 (Programmed PIC16C5

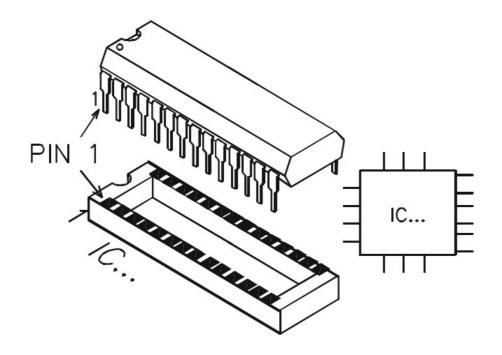

## Connection

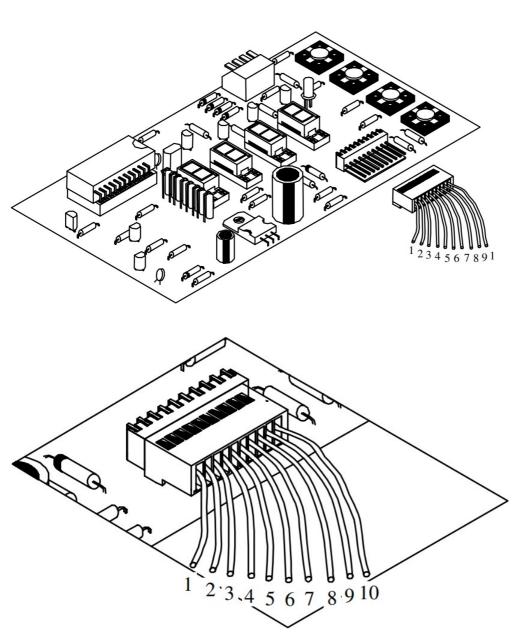

1	GND	6	GND	
2	+ VA	7	+ 5V	
3	+ VB	8	Count Down input (B)	
4	GND	9	9 Count Up input (A)	
5	E. OUT	10	GND	




The grounds are internally connected.


E.out: 5V / 50mA max. output at "equal" pre-set value

Inspect the complete assembly once more before applying power to the unit!

## Hook-up when using an adapter

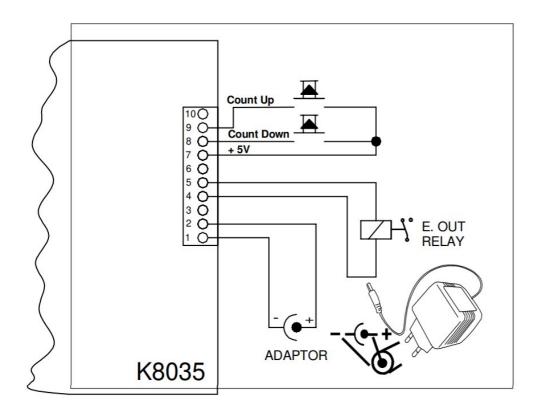

Hook-up when using a transformer

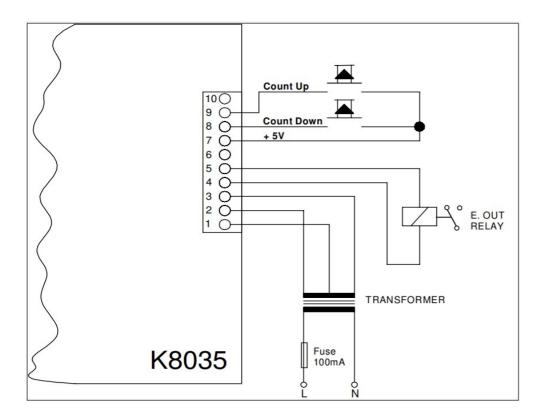

## Operation

When all connections are made, the four LED displays will light up and the Kit number will appear "8 0 3 5" after which following messages appear:

r x. x x	Version number
TEST	Self-test is working
GOOD	Internal parts are working correctly

If an irregularity is found during the self-test, an error code will appear, when GOOD appears then the unit is ready for u

Error code	Description	
Err. 2	Error in the keyboard section.	
Err. 3	The switches are in the wrong position. 'DIP SWITCH'	
Err. 4	Input A and B are at the same time active	
Err. 5	Input A is active during self-test or input A is possibly malfunctioning.	
Err. 6	Input B is active during self-test or input B is possibly malfunctioning.	

The errors 5 & 6 can appears when during the self-test counter pulses are received, this can be reset by pressing SW4 briefly.

#### Counting pulses can be applied to the unit in two different ways:

1. + 3V to 12V pulses with respect to ground.

- 2. Use the + 5V connection for push buttons or relay contacts when there is no power supply from an external source.
- Press "Reset" button briefly to reset the readout. "0000".
- Press the "UP" button to increase the actual value with one.
- Press the "DOWN" button to decreases the actual value with one.

#### **Setting the Pre-set value:**

It is possible to set a number which will continuously be compared with the content of the counter. If both are equal, then the output (Equal OUT) is activated.

- Press Set/Run (set briefly appears).
- Press Up or Down to set the value.
- Press Set/Run to store the value (Run appears).


#### Counter settings:

The counter can be used for decade or modulo 60 (clock) counting, an internal oscillator can be provided for use in modulo 60-mode


1. COUNTER SETTINGS					
FUNCTION	DIP SWITCH				
FUNCTION	OFF	ON			
Decade counter	1				
Modulo 60 : hh:mm (23.59)	2	1			
Modulo 60 : mm:ss. (59.59)		1 & 2			
2. DEBOUNCE SETTING					
Normal debounce	3				
Long debounce		3			
3. INPUT SETTING					
External pulses	4				
Internal oscillator		4			


**ATTENTION**: When changing the position of one of the switches, the current counter value and the pre-set value will be erased. (0000)

#### **PCB**

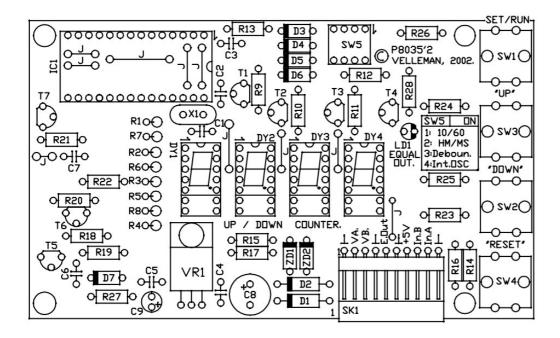

#### Schematic diagram.

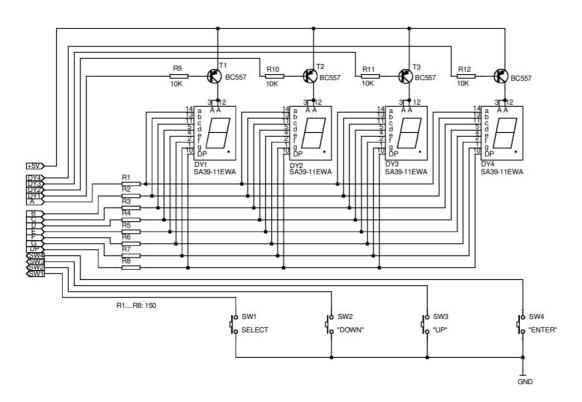

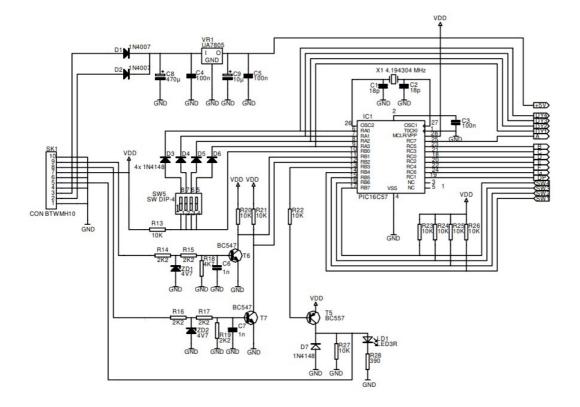

VELLEMAN Components NV
Legen Heirweg 33
9890 Gavere
Belgium Europe
www.velleman.be
www.velleman-kit.com

Modifications and typographical errors reserved © Velleman Components nv. H8035IP - 2003 - ED1



### **Documents / Resources**



velleman K8035 Advanced UP/DOWN Counter [pdf] Installation Guide K8035 Advanced UP DOWN Counter, K8035, Advanced UP DOWN Counter, UP DOWN Counter, DOWN Counter, Counter

#### References

- <u>velleman-kit.com</u>
- • 
   © Velleman Wholesaler and developer of electronics

Manuals+,