Fuzion LiftX

Fuzion LiftX Shipping Scale 440lb User Manual

Model: LiftX

1. INTRODUCTION

Thank you for choosing the Fuzion LiftX Shipping Scale. This digital scale is designed for accurate weighing of packages, parcels, and other items up to a maximum capacity of 440 pounds (200 kg). It features a durable tempered glass and stainless steel platform, a remote LCD display, and convenient functions such as HOLD and TARE. This manual provides essential information for proper setup, operation, and maintenance of your scale.

2. PRODUCT OVERVIEW AND FEATURES

The Fuzion LiftX Shipping Scale is engineered for reliability and ease of use. Key features include:

- **High Capacity:** Weighs items up to 440 lbs (200 kg) with a minimum weight detection of 40g.
- **Durable Construction:** Features a tempered glass and stainless steel weighing platform.
- **Remote LCD Display:** A separate display unit connected by a coiled cord allows for easy reading, even with large packages.
- **Multiple Weighing Modes:** Switch between kilograms (kg), pounds (lb), and pounds:ounces (lb:oz).
- **HOLD Function:** Locks the weight reading on the display for convenient recording.
- **TARE Function:** Zeros out the weight of a container, allowing you to weigh only the contents.
- **Dual Power Options:** Operates on 3x AAA batteries or an AC adapter.
- **Auto-Off Feature:** Conserves battery life by automatically turning off after a period of inactivity.

LiftX Shipping Scale

Min.Weight: 40g

Tempered Glass

Stainless Steel

11.18 inch

11.18 inch

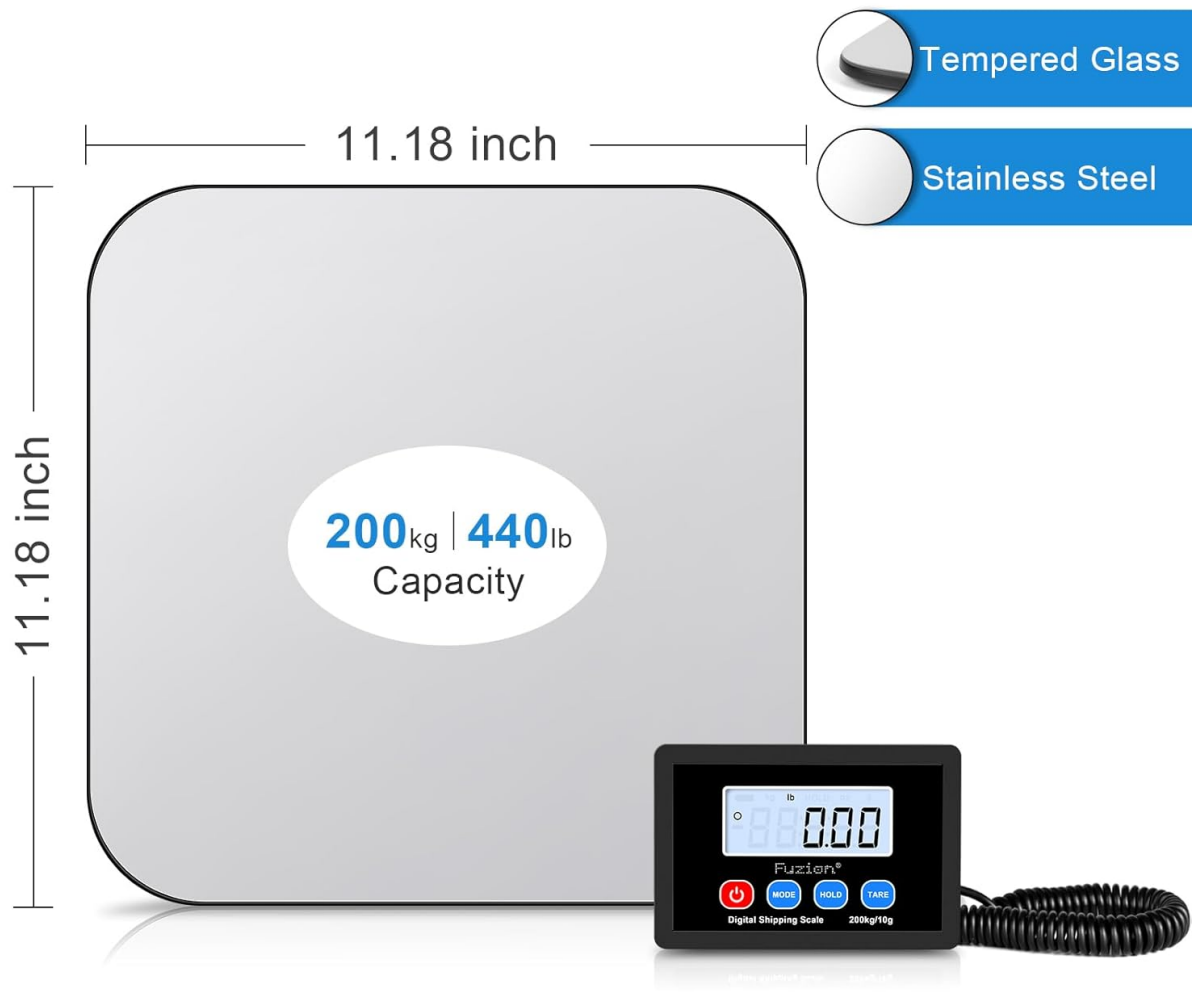**200**kg | **440**lb
Capacity

Image 2.1: The Fuzion LiftX Shipping Scale, illustrating its 11.18-inch square platform, 200kg/440lb capacity, and the remote display unit. The platform is constructed from tempered glass and stainless steel.

3. SETUP

3.1 Unpacking and Placement

- Carefully remove all components from the packaging.
- Place the scale platform on a flat, stable, and level surface to ensure accurate readings. Avoid placing it on soft or uneven surfaces.
- Position the remote display unit where it is easily visible and accessible.

3.2 Power Supply

The Fuzion LiftX scale can be powered by either AAA batteries or an AC adapter.

Battery Installation:

1. Locate the battery compartment on the underside of the scale platform.
2. Open the battery compartment cover.
3. Insert 3 AAA batteries, ensuring correct polarity (+/-) as indicated inside the compartment.

4. Close the battery compartment cover securely.

AC Adapter Connection:

- Connect the AC adapter to the power port on the scale.
- Plug the AC adapter into a standard wall outlet.

Image 3.1: The "What You Get" image, displaying the scale platform, remote display, 3 AAA batteries, and AC adapter, along with a snippet of the user guide. This illustrates the power options and included accessories.

4. OPERATING INSTRUCTIONS

4.1 Power On/Off

- To turn the scale **ON**, press the **POWER** button (🔘). The display will show "8888" and then "0.00" or "0.0".
- To turn the scale **OFF**, press and hold the **POWER** button for a few seconds until the display turns off.

4.2 Weighing Items

1. Ensure the scale is on a stable surface and powered on, displaying "0.00".

2. Gently place the item to be weighed onto the center of the scale platform.

3. Read the weight displayed on the remote LCD unit.

4.3 Mode Selection (Units)

The scale supports three weighing units: kilograms (kg), pounds (lb), and pounds:ounces (lb:oz).

- Press the **MODE** button to cycle through the available units: kg → lb → lb:oz.
- The selected unit will be indicated on the display.

Image 4.1: The remote display unit showing the three available weighing modes: kilograms (kg), pounds (lb), and pounds:ounces (lb:oz).

4.4 HOLD Function

The HOLD function allows you to lock the weight reading on the display, which is useful for weighing large or awkwardly shaped items that might obscure the display.

1. Place the item on the scale platform.

2. Once the weight stabilizes, press the **HOLD** button.

3. The weight reading will be locked on the display, indicated by a "HOLD" icon.

4. You can now remove the item and read the locked weight. Press **HOLD** again to release the reading.

HOLD FUNCTION

Press HOLD button to lock the reading, make weighing easier.

Image 4.2: An illustration of the HOLD function. A package is placed on the scale, and the user presses the HOLD button on the remote display to lock the weight reading.

4.5 TARE Function

The TARE function allows you to subtract the weight of a container, so you can weigh only the contents.

1. Place an empty container (e.g., a basket or box) on the scale platform.
2. Wait for the weight to stabilize.
3. Press the **TARE** button. The display will reset to "0.00".
4. Now, place the items you wish to weigh into the container. The display will show only the net weight of the items.
5. To clear the TARE function, remove the container from the scale and press **TARE** again.

Tare Function

Hit the button to zero out the weight for packages,
kitchen food, small pets.

Image 4.3: A two-step illustration of the TARE function. Step 1 shows an empty basket on the scale, then the TARE button is pressed. Step 2 shows fruit added to the basket, and the display shows only the weight of the fruit.

4.6 Auto-Off Setting

The scale is equipped with an auto-off feature to conserve power. By default, the scale will turn off automatically after a period of inactivity. You can adjust or disable this setting:

1. With the scale OFF, press and hold the **MODE** button.
2. While holding **MODE**, press the **POWER** button to turn the scale ON.
3. The display will show "0", "60", "180", or "300" (representing seconds for auto-off).
4. Release the **MODE** button.
5. Press **MODE** repeatedly to cycle through the auto-off times: 0 (disable auto-off), 60 seconds, 180 seconds, 300 seconds.
6. Once your desired setting is displayed, press the **POWER** button to confirm and exit.

5. MAINTENANCE

5.1 Cleaning

- Wipe the scale platform and display unit with a soft, damp cloth.

- Do not use abrasive cleaners or immerse the scale in water.
- Ensure the scale is dry before storage or next use.

5.2 Storage

- Store the scale in a cool, dry place.
- If the scale will not be used for an extended period, remove the batteries to prevent leakage.

6. TROUBLESHOOTING

Common Issues and Solutions:

- **Display shows "Lo" or no display:**
  - Check battery levels. Replace with new AAA batteries if necessary.
  - Ensure the AC adapter is securely connected and the power outlet is functional.

- **Inaccurate readings:**
  - Ensure the scale is placed on a flat, stable, and level surface.
  - Avoid placing the scale near strong electromagnetic fields or vibrating equipment.
  - Make sure the item is centered on the weighing platform.
  - Check if the TARE function is active unintentionally. Press TARE to clear it if needed.

- **Display shows "O-Ld" (Overload):**
  - The item being weighed exceeds the scale's maximum capacity (440 lbs / 200 kg). Remove the item immediately to prevent damage.

7. SPECIFICATIONS

Model	LiftX
Capacity	440 lbs (200 kg)
Minimum Weight	40 g
Weighing Units	kg, lb, lb:oz
Platform Dimensions	11.18 x 11.18 inches (approx. 28.4 x 28.4 cm)
Item Weight	1.65 kg
Power Supply	3x AAA batteries or AC adapter
Materials	Tempered Glass, Stainless Steel

8. WARRANTY AND SUPPORT

For warranty information or technical support, please refer to the documentation provided at the time of purchase or contact your retailer. Keep your proof of purchase for any warranty claims.