USAGE INSTRUCTIONS

>> To turn on, press and hold power button (1) for 2-3 seconds.

>> Press repeatedly to cycle through modes. Double click the power button to activate strobe from any other mode. Single click to return to low mode.

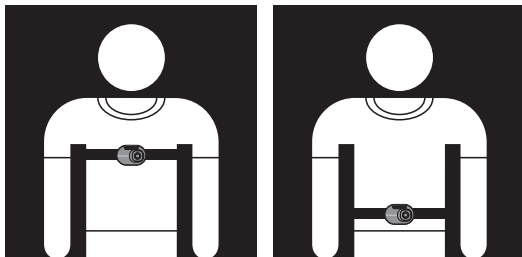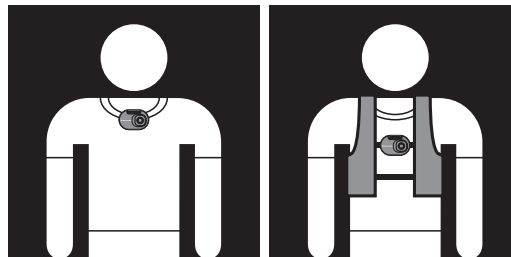>> To turn off, press and hold power button for 2-3 seconds.

TO RECHARGE:

>> Plug supplied USB cord in to a USB power source (500mA minimum) and then plug gently in to the covered charge port on the back of the unit. A red LED will light up to indicate charging is occurring and a green light indicates the Luna Fire RX is fully charged.

>> Charge time is 3 hours for a fully depleted battery.

>> When fully charged, unplug Luna Fire™ RX from USB power supply, return port cover gasket to original position and store charger cord until next use.

NATHAN®

With included belt

Remove strap to clip anywhere

Change angle

IPX4

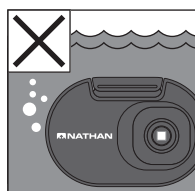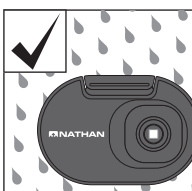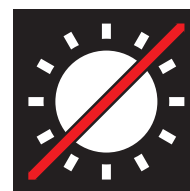**Weather Resistant**

Cleaning and Drying

Lamp Precautions

Disposal