UNI-T.

UT383
Mini Light Meters
Operating Instruction

1. Introduction

UT383 is a stable, safe, reliable mini digital light meter, widely used in lightening enterprises, agriculture and animal husbandry, mining enterprises, laboratory, office, household, street lights construction and others.
This operating manual includes relevant safety information and warnings. Please read this manual carefully and observe all the cautions strictly.
⚠ Warning:
Before using the product, please read the operation safety rules carefully.

2. Out of the Box

Open the packing box and take out the meter. Please check carefully if any items are missing or damaged.
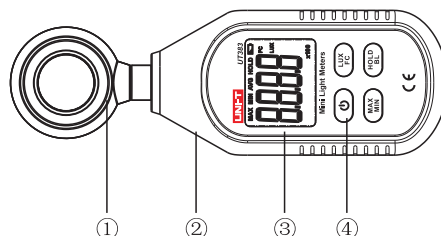   1. Main Unit--------------------------1
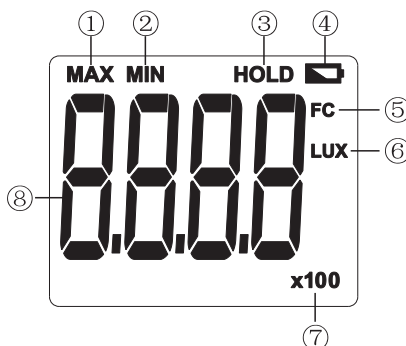   2. Operating manual ------------ 1

3. Operation Safety

1. Please check the meter and the accessories before using and beware of any damage or abnormal phenomenon. If you find the case is damaged or the LCD shows nothing, or you consider that the meter could not work properly anymore, please stop using it.
2. Observe the operating instructions while measuring.
3. Do not open the meter at will or change internal wiring to avoid damages to the meter.
4. When the LCD displays "▭", replace the battery timely. Remove the battery if the meter is not used for a long time.
5. Do not store or use the meter in high temperature, high humidity, flammable, combustible, or strong electromagnetic environment.
6. Please use soft cloth and neutral detergent to clean the case for maintenance. Do not use grinding agent and solvent to avoid case corrosion and damaging the meter.

4. Product Outlook

1. Illumination transducer
2. Meter case
3. LCD display
4. Function keys

① ② ③ ④

5. Display Interface

1	Maximum measurement	5	Foot candle
2	Minimum measurement	6	Lux
3	Data hold	7	Value*10 or value*100
4	Low battery	8	Illumination value

6. Key Function and Setup

1. ON/OFF:
   Short press once to start up; short press again to power off.
   Note: Product's auto power off feature can be disabled: Press and hold "HOLD" and then press "ON/OFF" key to enable/disable auto power off, LCD will display "APO OFF" to indicate status.

2. LUX/FC:
   Unit conversion key: Short press this key to select Lux or Foot candles.

3. MAX/MIN:
   Pressing this key can select maximum, minimum or normal value measurement; select maximum and the meter will always show the maximum reading; select minimum and the meter will always show the minimum reading.

4. HOLD/BL:
   HOLD: Short press this key to hold measurement; short press this key again to exit data hold and continue normal measurement.
   BL: Long press this key to turn on backlight; long press this key again to turn off backlight.

7. Technical Specifications

1. Illumination

Function	Range	Resolution	Accuracy	Description
Illumination	0~9999 Lux	1 Lux	±(4%rdg＋8dgts)	(regulate in the standard of 2856K color temperature flat lamp) Note: 1FC=10.76 Lux
	≥10000 Lux	10 Lux	±(5%rdg＋10dgts)	
Range	0~199,999 Lux			Auto-ranging
Sampling Time			0.5s	Refresh sampling in 0.5s
Overload Indication			OL	Shows "OL"
MAX/MIN Measurement			MAX/MIN	Shows "MAX/MIN"
Data Hold			HOLD	Shows "HOLD"
Backlight			BL	Manually on and off
Auto Power Off			5mins	Automatically power off after 5mins without operation
Low Battery			3.0~3.5V	Shows low battery prompt when power is 3.0~3.5V

2. General Type
a. LCD: 4 digits LCD display. The max display is 9999
b. Overload indication: When illumination is over 199,999 Lux, "OL" will be displayed
c. Battery low power display: Prompt "▭". New battery should be replaced in time
d. Sampling rate: 2/s
e. Sensor type: Silicon photocell
f. Impact strength: Can withstand the impact of landing from 1 meter height
g. Battery requirement: 1.5V batteries (AAA) ×3
h. Product size: 160×50×28mm
i. Weight: 118g

3. Environment Specification
a. Indoor use
b. Altitude height: 2000m
c. Safety: EN61326-1
d. Pollution level: 2
e. Working temperature and humidity:
   0℃~40℃ (not greater than 80%RH)
   40℃~50℃ (not greater than 45%RH)
f. Storage temperature and humidity:
   -20℃~60℃ (not greater than 75%RH)
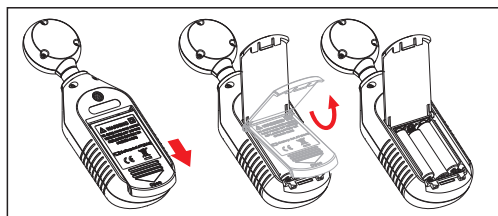
4. Electrical Specifications
a. Accuracy: 0~9999Lux, ±(4%rdg＋8dgts)
   ≥10000Lux, ±(5%rdg＋8dgts)
b. Environment temperature: 23℃±3℃
c. Environment humidity: ≤80%RH

5. General Maintenance
⚠ Warning: please do not open the case of meter to avoid affecting device accuracy or damage to the meter.
a. Maintenance and service of the meter should be accomplished by professional personnel or designated maintenance department.
b. Clean the case by dry cloth periodically, detergent with abrasive or solvent composition shall not be used.

6. Battery Installation and Replacement
a. The meter uses 3 pieces of AAA 1.5V batteries. Please see figure below for steps of battery installation and replacement.

UNI-T.®
UNI-TREND TECHNOLOGY（CHINA）CO., LTD.

No6, Gong Ye Bei 1st Road,
Songshan Lake National High-Tech Industrial
Development Zone, Dongguan City,
Guangdong Province, China
Tel: (86-769) 8572 3888
http://www.uni-trend.com

UNI-T

UT383 BT

Mini Light Meter (Bluetooth Version) Operating Manual

1. Introduction

UT383 BT with Bluetooth function is a stable, safe, reliable mini digital light meter, widely used in lightening enterprises, agriculture and animal husbandry, mining enterprises, laboratory, office, household, street lights construction and others.

This operating manual includes relevant safety information and warnings. Please read this manual carefully and observe all the cautions strictly.
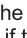
⚠ **Warning:**
Before using the product, please read the operation safety rules carefully.

2. Out of the Box

Open the packing box and take out the meter. Please check carefully if any items are missing or damaged.
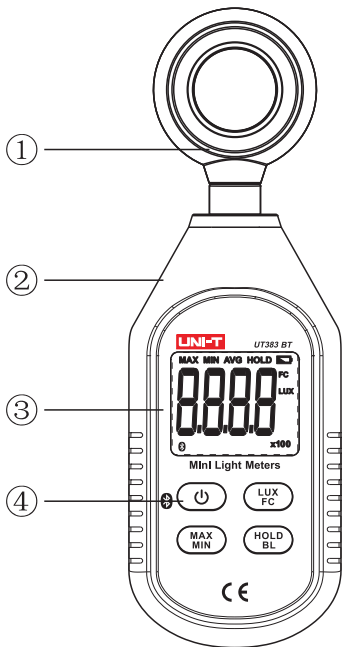
```
1. Blister------------------------------------------ 1
2. Operating manual --------------------------- 1
```
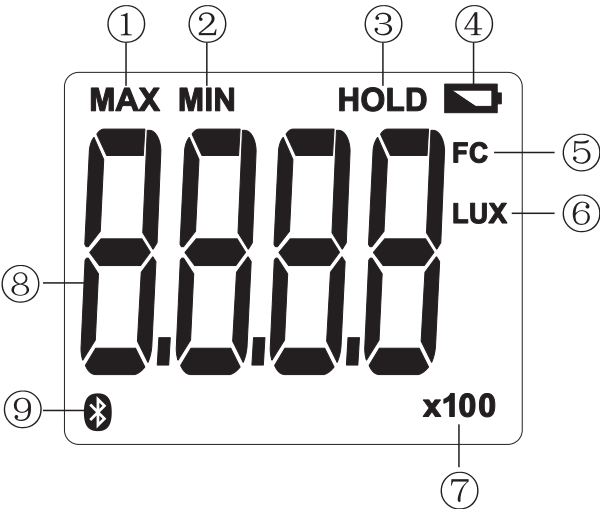
3. Operation Safety Rules

1. Please check the meter and the accessories before using and beware of any damage or abnormal phenomenon. If you find the case is damaged or the LCD shows nothing, or you consider that the meter could not work properly anymore, please stop using it.
2. Observe the operating instructions while measuring.
3. Do not open the meter at will or change internal wiring to avoid damages to the meter.
4. When the LCD displays "▭", replace the battery timely. Remove the battery if the meter is not used for a long time.
5. Do not store or use the meter in high temperature, high humidity, flammable, combustible, or strong electromagnetic environment.
6. Please use soft cloth and neutral detergent to clean the case for maintenance. Do not use grinding agent and solvent to avoid case corrosion and damaging the meter.
7. This product has passed CE certification.

4. Product Exterior

1. Illumination transducer
2. Meter case
3. LCD display
4. Function keys

5. Display Interface

1	Maximum measurement	
2	Minimum measurement	
3	Data hold	
4	Low battery	
5	Foot candle	
6	Lux	
7	Value*10 or value*100	
8	Illumination value	
9	Bluetooth communication symbol indication	

6. Key Function and Setup

（remark: "short press"means : about 1second continuous press;"long press" means : about 2 second continuous press）

1. ⏻ ON/OFF /Bluetooth communication
Short press once to start up; short press again to power off.
Bluetooth communication : Under the state of boosting unit , long press to enter Bluetooth communication mode, and then long press again to quit Bluetooth communication mode.

2. LUX/FC: lux / FOOTCANDLE
LUX/FC unit conversion key: short press the key, the illumination units can be selected between LUX and FC in performing illumination measurement

3. MAX/MIN
Pressing this key can select maximum, minimum or normal value measurement; select maximum and the meter will always show the maximum reading; select minimum and the meter will always show the minimum reading.
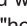
4. HOLD/BL
HOLD: Short press this key to hold measurement; short press this key again to exit data hold and continue normal measurement.

BL: Long press this key to turn on backlight; long press this key again to turn off backlight.
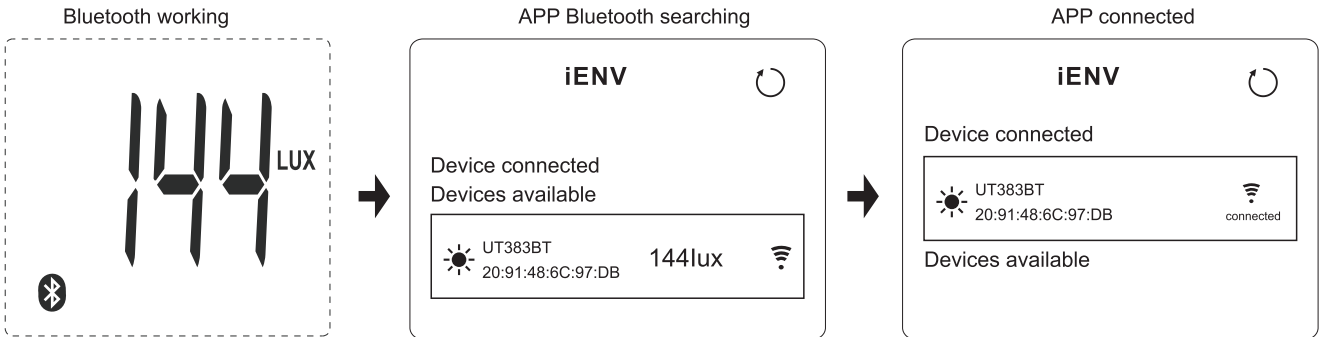
5. Automatic shutdown
No operation 5 minutes after , then shut down the unit automatically (the default is automatic shutdown mode)
When you want to remove the automatic shutdown function, hold down the "hold" + " ⏻ " key to boot. LCD has a "APO OF" character prompt, the automatic shutdown function will be removed .

7.Bluetooth APP specification

1. To connect Bluetooth , you need to install the application (iENV APP) on the smartphone
2. iOS device access it in App Store , Android device access it in Play Store or Please login www.uni-trend.com to download.

   Compatibility:
   ios 8.4 or higher version
   Android 4.3 or higher version
   Bluetooth 4.0 or higher version
   Memory 1G or more

3. Before Bluetooth APP and product are connected , you need to open the Bluetooth at the same time, and through the APP search the Bluetooth, and select the corresponding products to be connected in iENV APP
● when in the working state, long press the power button to turn on or off the Bluetooth
a. Bluetooth icon is flashing, indicating that the product is not connected with APP
b. Bluetooth icon isn't flashing, indicating that the product is connected with APP

Bluetooth working | APP Bluetooth searching | APP connected

iENV

Device connected
Devices available

UT383BT
20:91:48:6C:97:DB   144lux

iENV

Device connected

UT383BT
20:91:48:6C:97:DB   connected

Devices available

8. Performance Testing

1. Technical Parameter

Function	Range	Resolution	Accuracy	Remark
Illuminance Measurement	0～9999 Lux	1 Lux	± (4% rdg+8 dgts)	Ambient temperature: 23℃±5℃ Ambient humidity: ≤80%RH
	≥10000 Lux	10 Lux	± (5% rdg+10 dgts)	
	≥100000 Lux	100 Lux	± (5% rdg+10 dgts)	
Measurement Range	0～199900 Lux			Shift to automatic range

2. General Type
a. LCD: 4 digits LCD display. The max display is 9999
b. Overload indication: When illumination is over 199900 Lux, "OL" will be displayed
c. Battery low power display: Prompt " ".
d. Sampling rate: 0.5s
e. Sensor type: Silicon photocell
f. Impact strength: Can withstand the impact of landing from 1 meter height
g. Battery requirement: 1.5V batteries (AAA) ×3
h. Power consumption: More than 12 hours with Bluetooth enabled
i. Product size: 163×55×28mm
j. Spec of thread to connect the product with three tripod：m¼″
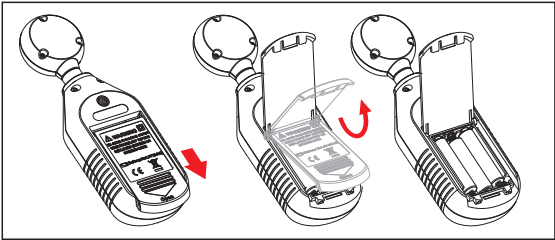k. Weight: 118g

3. Environment Limitation
a. Indoor use
b. Maximum operating height: 2000m
c. Pollution level: 2
d. Working temperature and humidity:
   0℃~40℃（not greater than 80%RH)
   40℃~50℃ (not greater than 45%RH)
e. Storage temperature and humidity:
   -20℃~60℃ (not greater than 75%RH)

4. General Maintenance
Warning: please do not open the case of meter to avoid affecting device accuracy or damage to the meter.
a.Maintenance and service of the meter should be accomplished by professional personnel or designated maintenance department.
b.Clean the case by dry cloth periodically, detergent with abrasive or solvent composition shall not be used.

5. Battery Installation and Replacement
a. The meter uses 3 pieces of AAA 1.5V batteries. Please see figure below for steps of battery installation and replacement.
b. Turn the panel down, push the battery cover open in the direction of the arrow, lift the cover and remove the batteries; install new batteries in accordance of polarity indications.
c. Please use batteries of same type instead of improper ones.
d. Close the cover tightly after installing new batteries.