Manuals+

User Manuals Simplified.

OMEGA OS306-Series Infrared Thermometer User Guide

OMEGA OS306-Series Infrared Thermometer

Contents hide

Battery Installation

1. Locate the notches on the side of the unit's handle and pull the front of the handle forwards as shown above.

2. Attach a 9V battery (provided) to the black connector inside. The battery should snap into place. Swing the front of the handle back upwards to close the unit.

How to turn on the unit

- Press the trigger of device to power on

Quick Measurement

- Point thermometer at a target surface
- Pull and hold the trigger to begin scanning
- Release the trigger to stop scanning
- The data will be held for 30 seconds then the unit will power off

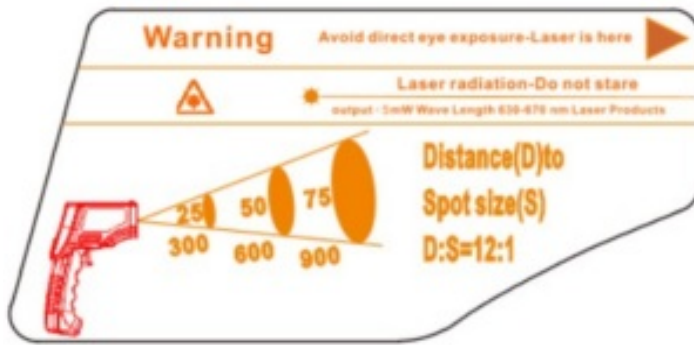## Switch between Celsius and Fahrenheit

The default setting for the temperature unit is in Celsius. Please follow the below steps to change the temperature units to Fahrenheit.

- Press the "°C °F" Button
- You should now see the temperature displayed in ⁰F (Fahrenheit)

Press °C °F button

Field of View

- This unit has a distance ratio of 12:1
- When measuring a surface 300 mm away, a 25 mm area will be measured.

Contact Information

If you need technical support, please call 1-888-826-6342.

omega.com

Documents / Resources

[OMEGA OS306-Series Infrared Thermometer](#) [pdf] User Guide
OS306-Series, OS306-Series Infrared Thermometer, OS306-Series, Infrared Thermometer

[Manuals+](#),

- **[home](#)**
- **[privacy](#)**