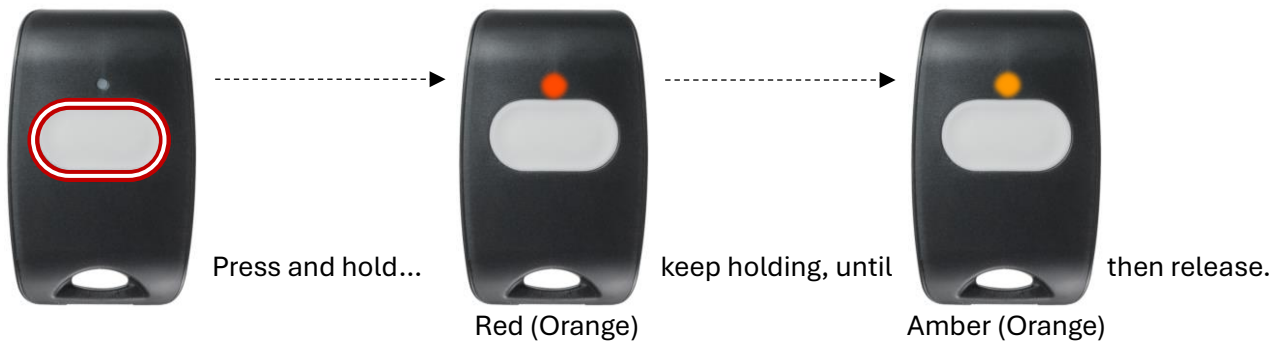**IQ PANEL**

PG9938 Enrollment

IQ Panel 4 v4.5.2 and higher

The PG9938 remote panic button can be enrolled into an IQ4 panel as audible or silent medical, or audible or silent intrusion alarm activation for the system.

Enrollment process:

Press and hold the ( ) button of the fob until the keyfob's LED flashes amber.

Press and hold...   keep holding, until   then release.

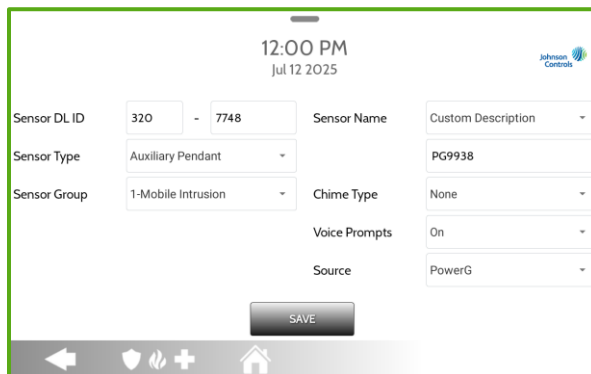Red (Orange)   Amber (Orange)

> ***Tech Tip:*** If the LED flashes only once after holding for 10 seconds, or if it flashes multiple times the keyfob may have been enrolled into another panel. Release the ( ) button and press and hold again.

Programming:

Settings > Advanced Settings > Installation > Devices > Security Sensors > Auto Learn Sensor

Press and hold the ( ) button of the fob until the keyfob's LED flashes amber.

Program the 'Sensor Group', 'Sensor Name' and 'Voice Prompts' as needed.

Select "ADD NEW".

PG9938 Enrollment

> ➤ ***Tech Tip:*** Do not program the PG9938 as a Fixed sensor group.
>
> <u>Select only:</u>
> 1 - Mobile Intrusion
> 3 - Mobile Silent
> 6 - Mobile Auxiliary
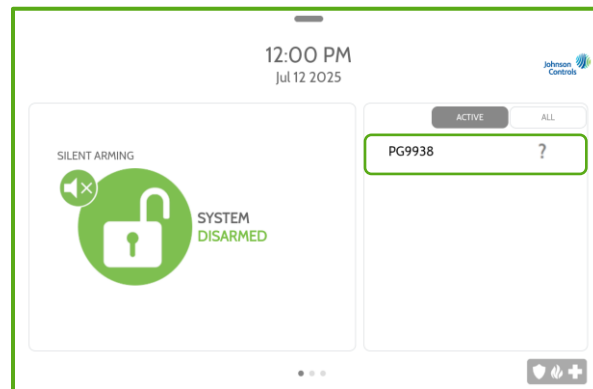> 7 - Mobile Silent Auxiliary
>
> 25 - Safety Auxiliary Pendent (non-alarm)
> (Set 'Voice Prompts' to OFF for no zone status annunciation)
>
> If a Fixed sensor group is used the zone may go into supervisory trouble after the supervision window has expired (default 24 hours.)
>
> When supervisory trouble occurs the History tab under Settings > Status will show "Failure" with a time and date stamp of the loss of supervision.
>
> In addition, the device tray on the arming page will show a "**?**" for the zone.

Button Operations:

PG9938

① Panic **

** Press and hold for 3+ seconds