

DOLD MK 9053N Current Monitoring Relay Instruction Manual

Home » DOLD » DOLD MK 9053N Current Monitoring Relay Instruction Manual

Contents

- 1 DOLD MK 9053N Current Monitoring Relay
- **2 Product Description**
- **3 Circuit Diagrams**
- 4 Safety Notes
- **5 Features**
- 6 Function
- 7 Function Diagram with Start-up Delay
- 8 Technical Data
- 9 Characteristic
- 10 Documents / Resources
 - 10.1 References
- 11 Related Posts




DOLD MK 9053N Current Monitoring Relay



Product Description

The current relay MK 9053N of the VARIMETER series monitors single phase DC or AC voltage systems. The adjustment is made via potentiometers on the front of the device. Early recognition and preventive maintenance avoid interruptions of electrical plants and provides a higher operational and plant safety.

Circuit Diagrams

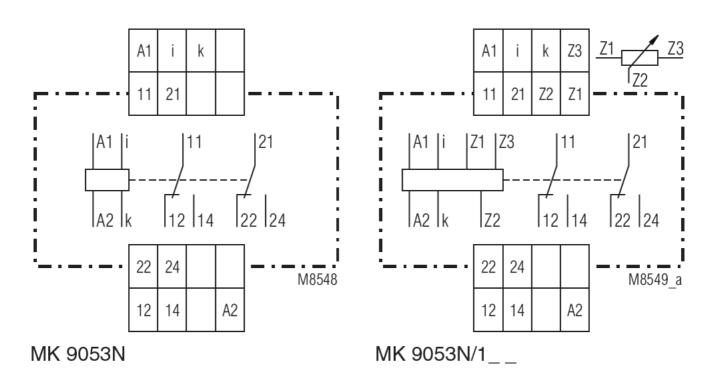

Connection Terminals

Terminal designation	Signal description
A1, A2	Auxiliary voltage
i, k	Current measuring input
11, 12, 14	1st changeover contact
21, 22, 24	2nd changeover contact
at MK 9053/1: Z1, Z2, Z3	Remote potentiometer for response value

Safety Notes

Please observe when connecting a remote potentiometer to MK 9053N/1__:

Measuring circuit and remote potentiometer not galvanically separated. The voltage on on measuring circuit i, k / PE has connection to the remote potentiometer. The remote potentiometer has to be connected volt- and ground-free.

Your Advantages

- · Preventive maintenance
- · For better productivity
- · Quicker fault locating
- · Precise and reliable

Features

- According to IEC/EN 60255-1, IEC/EN 60947-1
- To: Monitor DC and AC
- Measuring ranges from 2 mA up to 10 A
- · High overload possible
- Input frequency up to 5 kHz
- Galvanic separation between auxiliary circuit measuring ciruit
- · With start-up delay
- With time delay, up to max. 100 sec
- As option with remote potentiometer
- · As option with manual reset
- Option with fixed settings possible
- LED indicators for operation and contact position
- · As option with pluggable terminal blocks for easy exchange of devices
 - With screw terminals
 - Or with cage clamp terminals
- Width: 22.5 mm

Applications

- · Monitoring current in AC or DC systems
- For industrial and railway applications

Function

The relays measure the arithmetic mean value of the rectified measuring current. The AC units are adjusted to the r.m.s value. They have settings for response value and hysteresis. The units work as overcurrent relays but can also be used for undercurrent detection. The hysteresis is dependent on the response value.


2 time delays are possible in different variants:

The start up delay ta operates only when connecting the auxiliary supply. It disables tripping e.g. caused by an increased starting current of a motor. The response delay tv is active after exceeding a response value. On overcurrent relays the delay is active when the current goes over the tripping value, on undercurrent relays when the current drops below the hysteresis value.

Indicators

- · Green LED: On, when auxiliary supply connected
- · Yellow LED: On, when output relay acitvated

Function Diagram with Start-up Delay

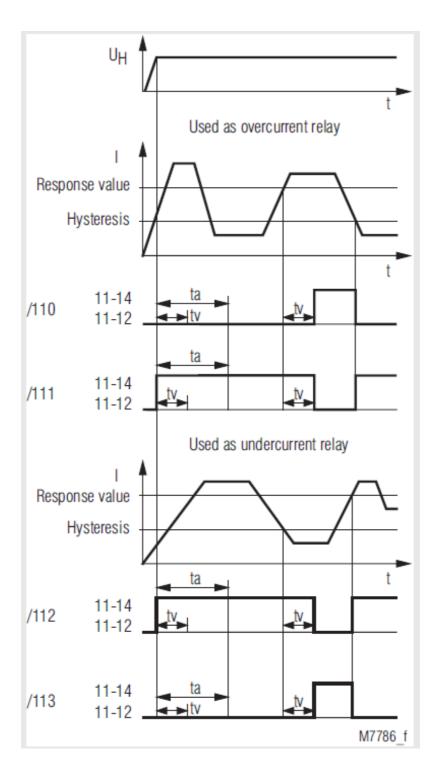

On model MK 9053N/6_ with manual reset the contacts remain in the fault state after detecting a fault or after to has elapsed. The contacts are reset by disconnecting the supply voltage.

Technical Data

Input (i, k)

MK 9053N with 1 Mea suring range for		AC and C					
Measuring rang RM e1)		max. perm. cont					
		(int	current				
AC	DC	ern al me asu - ri ng resi sto r (s hun t)	De vic e mo unt . wi tho ut dist anc e	with 5 m dis- tand		max. p ermiss. current 3 s On, 100 s O ff	
2 – 20 mA	1.8 – 18 mA	1.5 W	0.5 A 0.7 A		1 A		
20 – 200 mA	18 – 18 0 mA	0.1 5 W	1.5 A 2 A		4 A		
30 – 300 mA	27 – 27 0 mA	0.1 W	2 A	2 A 2.5 A		8 A	
50 – 500 mA	45 – 45 0 mA	0.1 W	2 A 2.5 A		8 A		
0.1- 1 A	0.09 – 0 .9 A	30 m W	3 A 4 A		8 A		
0.5- 5 A	0.45 – 4 .5 A	6 m W	8 A 11 A		20 A		
1 – 10 A	0.9 – 9 A	3 m W	12 A	15 A		20 A	
1) DC o	1) DC or AC current 50 5000 Hz						
(Other frequency ranges of 10 \dots 5000 Hz, e.g. 16 $2/_3$ Hz on request)						, e.g. 16	

Extending of measuring range:

For DC currents exceeding the largest measuring range, the measuring range 15 ... 150 mV or 6 ... 60 mV of the BA 9054 and MK 9054N can be used

with external shunt.

For AC current exceeding the largest measuring range a current transformer can be used. For Example with secondary winding of 1 A or 5 A. The nominal load of the CT should be ≥ 0.5 VA.

Measuring principle: Arithmetic mean value

Adjustment: The AC-devices can also monitor DC

current. The scale offset in this case is:

 $(I = 0.90 I_{off})$

< 0.05 % / K Temperature Influence:

Setting Ranges

Setting

Response value: Infinite variable 0.1 I_N ... 1 I_N

relative scale

Hysteresis

Infinite variable 0.5 ... 0.98 of setting value At AC: At DC: Infinite variable 0.5 ... 0.96 of setting value

Accuracy:

Response value at

Potentiometer right stop (max): 0 + 8 % Potentiometer left stop (min): - 10 + 8%

Repeat accuracy

 $\leq \pm 0.5 \%$ (constant parameter):

Recovery time

At devices with manual reset

(Reset by braking of the auxiliary voltage)

MK 9053N/6__: ≤1 s

(dependent to function and auxiliary voltage)

Time delay t_s: Infinite variable at logarythmic scale

from 0 ... 20 s, 0 ... 30 s, 0 ... 60 s, 0 ... 100 s

setting 0 s = without time delay

0.1 ... 20 s; 0.1 ... 60 s; 0.1 ... 100 s Start-up delay t:

Auxiliary voltage U_u (A1, A2) for wide voltage range

Nominal voltage	Voltage range	Frequency range	
AC/DC 24 80 V	AC 18 100 V	45 400 Hz; DC 48 % W	
AO/DO 24 60 V	DC 18 130 V	W £ 5 %	
AC/DC 80 230 V	AC 40 265 V	45 400 Hz; DC 48 % W	
	DC 40 300 V	W £ 5 %	

Nominal consumption:

4 VA; 1.5 W at AC 230 V Rel. energized 1 W at DC 80 V Rel. energized

Output

Contacts: 2 changeover contacts Thermal current Ith: 2 x 4 A

Switching capacity

to AC 15: 1.5 A / AC 230 V IEC/EN 60947-5-1 to DC 13: 1 A / DC 24 V IEC/EN 60947-5-1

Electrical life

at 2 A, AC 230 V $\cos \phi = 1$: 105 switching cycles

Short-circuit strength

max. fuse rating: 6 A gG / gL IEC/EN 60947-5-1 Mechanical life: 20 x 106 switching cycles

Housing:

Vibration resistance:

Climate resistance:

Wire connection Screw terminals

Terminal designation:

General Data

Operating mode:	Continuous operation	1
Temperature range		
Operation:	- 40 + 50°C	
	(higher temperature)	with limitations
	on request)	
Storage:	- 40 + 70°C	
Altitude:	≤ 2000 m	
Clearance and creepage		
distances		
Rated impulse voltage /		
pollution degree:	4 kV / 2	IEC 60664-1
EMC		
Electrostatic discharge:	8 kV (air)	IEC/EN 61000-4-2
HF irradiation		
80 MHz 1 GHz:	20 V/m	IEC/EN 61000-4-3
1 GHz 2.7 GHz:	10 V/m	IEC/EN 61000-4-3
Fast transients:	4 kV	IEC/EN 61000-4-4
Surge voltages		
Between		
wires for power supply:	2 kV	IEC/EN 61000-4-5
Between wire and ground:	4 kV	IEC/EN 61000-4-5
HF wire guided:	10 V	IEC/EN 61000-4-6
Interference suppression:	Limit value class B	EN 55011
Degree of protection		
Housing:	IP 40	IEC/EN 60529
Terminals:	IP 20	IEC/EN 60529

Thermoplastic with V0 behaviour

Amplitude 0.35 mm IEC/EN 60068-2-6

IEC/EN 60068-1

EN 50005

according to UL subject 94

frequency 10 ... 55 Hz

40 / 060 / 04

coren commission

(integrated): 1 x 4 mm² solid or

1 x 2.5 mm² stranded ferruled (isolated) or 2 x 1.5 mm² stranded ferruled (isolated)

or 2 x 2.5 mm² solid

Insulation of wires

or sleeve length: 8 mm

Plug in with screw terminals max. cross section

for connection: 1 x 2.5 mm² solid or

1 x 2.5 mm² stranded ferruled (isolated)

Insulation of wires

or sleeve length: 8 mm

Plug in with

cage clamp terminals max. cross section

for connection: 1 x 4 mm² solid or

1 x 2.5 mm2 stranded ferruled (isolated)

min. cross section

for connection: 0.5 mm²

Insulation of wires

or sleeve length: 12 ±0.5 mm

Wire fixing: Plus-minus terminal screws M3.5 box

terminals with wire protection or cage clamp terminals

Stripping length: 10 mm Fixing torque: 0.8 Nm

Mounting: DIN-rail IEC/EN 60715

Weight: 150 g

Dimensions

Width x height x depth: 22.5 x 90 x 97 mm

CCC-Data

Thermal current Ith: 4 A Switching capacity

to AC 15: 1,5 A / AC 230 V IEC/EN 60 947-5-1 to DC 13: 1 A / DC 24 V IEC/EN 60 947-5-1

Standard Type

MK 9053N.12/010 AC 0.5 ... 5 A AC/DC 80 ... 230 V tv 0 ... 20 s ta 0.1 ... 20 s

Article number: 0063176

· For Overcurrent monitoring


• Measuring range:: AC 0.5 ... 5 A


Auxiliary voltage UH: AC/DC 80 ... 230 V

Time delay by tv: 0 ... 20 sStart up delay ta: 0.1 ... 20 s


Width: 22.5 mm

Ordering Example for Variants

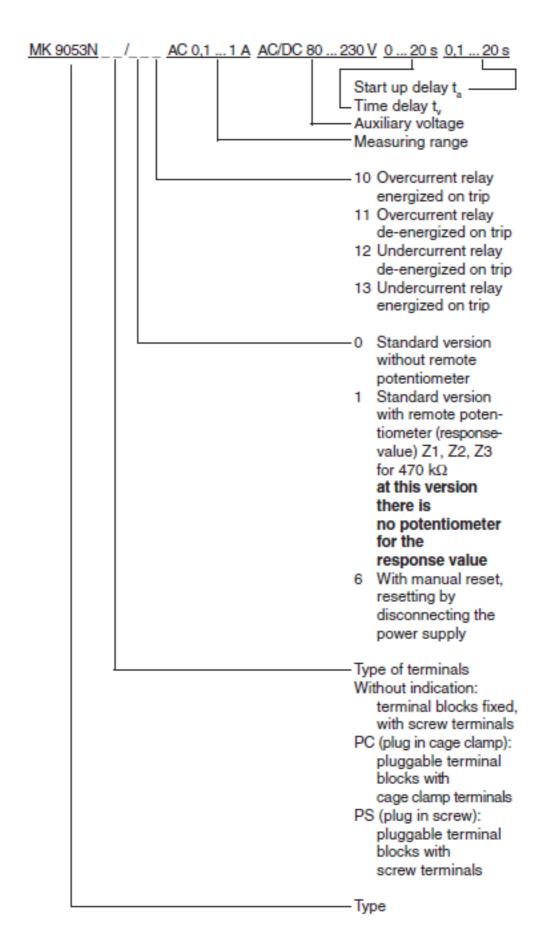

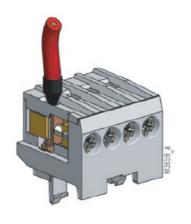

Screw terminal

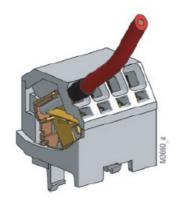


Cage clamp (PS/plugin screw) (PC/plugin cage clamp)

Notes

Removing the terminal blocks with cage clamp terminals

- 1. The unit has to be disconnected.
- 2. Insert a screwdriver in the side recess of the front plate.
- 3. Turn the screwdriver to the right and left.
- 4. Please note that the terminal blocks have to be mounted on the belonging plug in terminations.

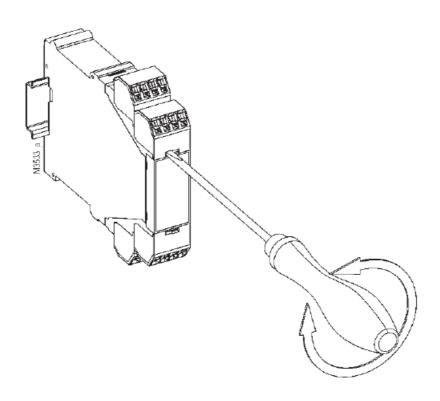

Accessories

AD 3: Remote potentiometer 470 K Ω

Article number: 0050174

Setting

Example:

Current relay AC 0.5 ... 5 A

AC according to type plate: i.e. the unit is calibrated for AC 0.5 ... 5 A = measuring range Response value AC 3 A Hysteresis AC 1.5 A

Settings

Upper potentiometer: 0.6 (0.6 x 5 A = 3 A) Lower potentiometer: 0.5 (0.5 x 3 A = 1.5 A)


The AC – devices can also monitor DC current. The scale offset in this case is: $I = 0.90 \times 10^{-2}$ AC 0.5 ... 5 A is equivalent to DC 0.45 ... 4.5 A

Response value DC 3 A Hysteresis DC 1.5 A

Settings

Upper potentiometer: $0.66 (0.66 \times 4.5 A = 3 A)$ Lower potentiometer: $0.5 (0.5 \times 3 A = 1.5 A)$

Characteristic

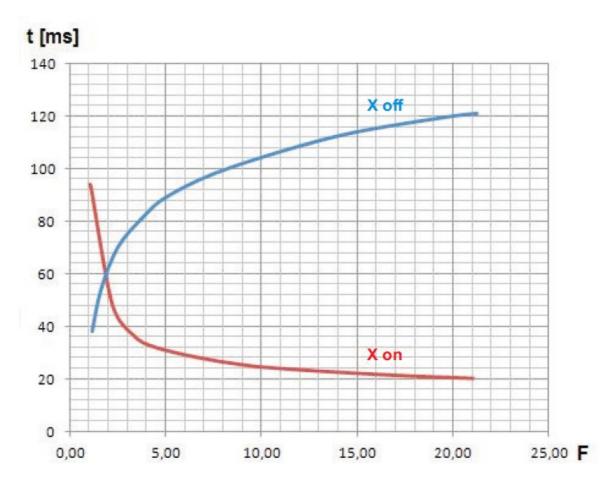

M11504 a

X on: Measured value rise
$$F = \frac{\text{Measured value (after rise of measured value)}}{\text{Setting value}}$$

X off: Measured value drops
$$F = \frac{\text{Mesaured value (befor measured value drops)}}{\text{Setting value (hysteresis)}}$$

The diagram shows the typical delay of a standard devices depending on the measured values "X on and X off" at sudden rise or drop of the signal. At slow change of the measured value the delay is shorter.

The total reaction time of the device results from the adjustable delay tv and the delay created by the measuring circuit.

The diagram shows an average delay. The delay times could differ on the different variants.

Example for "X on" (overcurrent detection with MK 9053N/010):

Adjusted setting value X on = 2 A.

Due to a stalled motor the current rises suddenly to 10 A.

$$F = \frac{\text{Measured value (after rise of measured value)}}{\text{Setting value}} = \frac{10 \text{ A}}{2 \text{ A}} = 5$$

Reading from the diagram:

The output relay switches on after 31 ms at a setting tv=0.

Example for "X off" (undercurrent detection with MK 9053N/012):

Adjusted hysteresis setting value is 10 A.

The current drops suddenly from 23 A to 0 A.

$$F = \frac{\text{Mesaured value (befor measured value drops)}}{\text{Setting value (hysteresis)}} = \frac{23 \text{ A}}{10 \text{ A}} = 2.3$$

Reading from the diagram:

The output relay switches off after 70 ms at a setting tv=0.

dold-relays@dold.com www.dold.com

Documents / Resources



DOLD MK 9053N Current Monitoring Relay [pdf] Instruction Manual MK 9053N Current Monitoring Relay, MK 9053N, Current Monitoring Relay, MC 9053N, Current Monitoring Relay

References

Manuals+,