



Honeywell Linear Hall-Effect Sensor ICs Installation Guide

[Home](#) » [Honeywell](#) » Honeywell Linear Hall-Effect Sensor ICs Installation Guide 

Honeywell

Contents

- [1 Installation Instructions for the](#)
- [2 CLEANING INSTRUCTIONS](#)
- [3 Documents / Resources](#)
 - [3.1 References](#)
- [4 Related Posts](#)

Installation Instructions for the

SS490 Series Linear Hall-Effect Sensor ICs

PK 88840
Issue 8

SOLDERING INSTRUCTIONS

NOTICE

Do not wave solder surface mount sensor ICs (catalog listings with suffixes -S or -SP). Wave soldering may negatively affect sensor performance and reliability and will void Honeywell's warranty.

Surface mount (catalog listings with suffixes -S or -SP): Use infrared reflow process with active flux, lead-free solder. Do not exceed peak temperature of 245 °C [473 °F] for a maximum of 10 seconds.

Through-hole leads: Wave solder at 250 °C to 260 °C [482 °F to 500 °F] for a maximum of three seconds. Burrs are allowed only if full length of leads will pass through 0,68 mm [0.027] dia. hole.

CLEANING INSTRUCTIONS

CAUTION

PRODUCT DAMAGE

Use agitated rinse, not pressure wash, in order to avoid forcing contaminants into the sensor package.

Failure to comply with these instructions may result in product damage.

Table 1. General Specifications for All Catalog Listings.

Characteristic	Condition	Min.	Typ.	Max.	Unit
Supply current	TA = 25°C [77°F]	—	7	8.7	mA
Output current:					mA
sourcing	Vs > 4.5	1	1.5	—	
sinking	Vs > 4.5	0.6	1.5	—	
sinking	Vs > 5.0	1	1.5	—	
Response time	—	—	3	—	μs
Output voltage swing:					V
VOM-	-B applied	0.4	0.2	—	
VOM+	+B applied	Vs – 0.4	Vs – 0.2	—	
Supply voltage	TA = -40°C to 125°C [-40°F to 257°F]	4.5	5.0	10.5	V
Operating temperature	—	-40 [40]	—	150 [302]	°C [°F]
Soldering temperature	wave soldering process: 250°C to 260°C [482°F to 500°F] for 3 s max. infrared reflow process: peak temperature 245°C [473°F] for 10 s max.				
and time					

Table 2. Absolute Maximum Specifications for All Catalog Listings

Characteristic	Symbol	Condition	Min.	Typ.	Max.	Unit
Supply voltage	Vs	—	-0.5	—	11	V
Output voltage	Vout	—	-0.5	—	11	V
Output current	Iout	sourcing or sinking	—	—	10	mA
Operating temperature	TA	—	-55	—	150	°C [°F]
Storage temperature	TS	Vs = 0	-55	—	165	°C [°F]

NOTICE

Absolute maximum ratings are the extreme limits the device will momentarily withstand without damage to the device. Electrical and mechanical characteristics are not guaranteed if the rated voltage and/or currents are exceeded, nor will the device necessarily operate at absolute maximum ratings.

NOTICE

The magnetic field strength (Gauss) required to cause the switch to change state (operate and release) will be as specified in the magnetic characteristics. To test the switch against the specified limits, the switch must be placed in a uniform magnetic field.



	CAUTION ELECTROSTATIC SENSITIVE DEVICES DO NOT OPEN OR HANDLE EXCEPT AT A STATIC FREE WORKSTATION	
ESD SENSITIVITY: CLASS 3		

Table 3. Specifications for Catalog Listing SS494B (Vs = 5.00 V with 4.7 k output to minus, TA = -40°C to 125°C [-40°F to 257°F])

Characteristic	Condition	Min.	Typ.	Max.	Unit
B limits for linear operation	-B max.	-375	-420	—	Gauss
	+B max.	+375	+420	—	
Linearity	B = -60 to +60	—	—	—	% of span
	B = -375 to +375	0	-1.0	-1.5	
Sensitivity	TA = 25°C [77°F]	4.6	5.0	5.4	mV/Gauss
Null	TA = 25°C [77°F]	2.26	2.50	2.74	V
Sensitivity drift	TA = -40°C to 25°C [-40°F to 77°F]	0	—	+0.08	% / °C
	TA = 25°C to 150°C [77°F to 302°F]	-0.02	—	+0.08	
Vnull drift	B = 0; TA = -40°C to 125°C [-40°F to 257°F]	-0.064	—	+0.064	% / °C
	B = 0; TA = 125°C to 150°C [257°F to 302°F]	-0.02	—	+0.08	

Table 4. Specifications for Catalog Listings Beginning with SS495 (Vs = 5.00 V with 4.7 k output to minus, TA = -40°C to 125°C [-40°F to 257°F])

Characteristic	Condition	Min.	Typ.	Max.	Unit
SS495A					
B limits for	-B max.	-600	-670	—	Gauss
linear operation	+B max.	+600	+670	—	
Linearity	B = -600 to +600	0	-1.0	1.5	% of span
Sensitivity	TA = 25°C [77°F]	3.00	3.125	3.25	mV/Gauss
Null	TA = 25°C [77°F]	2.425	2.50	2.575	V
Sensitivity drift	TA = -40°C to 25°C [-40°F to 77°F]	0	—	+0.06	%/°C
	TA= 25°C to 150°C [77°F to 302°F]	-0.01	—	+0.05	
Vnull drift	B = 0; TA = 25°C to 125°C [77°F to 257°F]	-0.06	—	+0.06	%/°C
	B = 0; TA = 125°C to 150°C [257°F to 302°F]	-0.08	—	+0.08	
SS495A1					
B limits for	-B max.	-600	-670	—	Gauss
linear operation	+B max.	+600	+670	—	
Linearity	B = -600 to +600	0	-1.0	1.5	% of span
Sensitivity	TA = 25°C [77°F]	3.031	3.125	3.219	mV/Gauss
Null	TA = 25°C [77°F]	2.425	2.50	2.575	V
Sensitivity drift	TA = -40°C to 25°C [-40°F to 77°F]	0	—	+0.06	%/°C
	TA= 25°C to 150°C [77°F to 302°F]	-0.01	—	+0.05	
Vnull drift	B = 0; TA = 25°C to 125°C [77°F to 257°F]	-0.04	—	+0.04	%/°C
	B = 0; TA = 125°C to 150°C [257°F to 302°F]	-0.08	—	+0.08	
SS495A2					
B limits for	-B max.	-600	-670	—	Gauss


linear operation	+B max.	+600	+670	—	
Linearity	B = -600 to +600	0	-1.0	1.5	% of span
Sensitivity	TA = 25°C [77°F]	2.969	3.125	3.281	mV/Gauss
Null	TA = 25°C [77°F]	2.400	2.50	2.600	V
Sensitivity drift	TA = -40°C to 25°C [-40°F to 77°F]	-0.01	—	+0.07	%/°C
	TA = 25°C to 150°C [77°F to 302°F]	-0.02	—	+0.06	
Vnull drift	B = 0; TA = 25°C to 125°C [77°F to 257°F]	-0.07	—	+0.07	%/°C
	B = 0; TA = 125°C to 150°C [257°F to 302°F]	-0.08	—	+0.08	
<p style="text-align: center;">SS495B</p> 					
B limits for	-B max.	-600	-670	—	Gauss
linear operation	+B max.	+600	+670	—	
Linearity	B = -600 to +600	0	-1.0	1.5	% of span
Sensitivity	TA = 25°C [77°F]	2.875	3.125	3.375	mV/Gauss
Null	TA = 25°C [77°F]	2.350	2.50	2.650	V
Sensitivity drift	TA = -40°C to 25°C [-40°F to 77°F]	-0.02	—	+0.08	%/°C
	TA = 25°C to 150°C [77°F to 302°F]	-0.02	—	+0.08	
Vnull drift	B = 0; TA = 25°C to 125°C [77°F to 257°F]	-0.08	—	+0.08	%/°C
	B = 0; TA = 125°C to 150°C [257°F to 302°F]	-0.08	—	+0.08	

Table 5. Specifications for Catalog Listings Beginning with SS496 (Vs = 5.00 V with 4.7 k output to minus, TA = -40°C to 125°C [-40°F to 257°F])

Characteristic	Condition	Min.	Typ.	Max.	Unit
SS496A					
B limits for	-B max.	-750	-840	—	Gauss
linear operation	+B max.	+750	+840	—	
Linearity	B = -750 to +750	0	-1.0	1.5	% of span
Sensitivity	TA = 25°C [77°F]	2.4	2.5	2.575	mV/Gauss
Null	TA = 25°C [77°F]	2.425	2.50	2.575	V
Sensitivity drift	TA = -40°C to 25°C [-40°F to 77°F]	0	—	+0.06	% / °C
	TA= 25°C to 125°C [77°F to 257°F]	-0.01	—	+0.05	
Vnull drift	B = 0; TA = 25°C to 125°C [77°F to 257°F]	-0.048	—	+0.048	% / °C
	B = 0; TA = 125°C to 150°C [257°F to 302°F]	-0.064	—	+0.064	
SS496A1					
B limits for	-B max.	-750	-840	—	Gauss
linear operation	+B max.	+750	+840	—	
Linearity	B = -750 to +750	0	-1.0	1.5	% of span
Sensitivity	TA = 25°C [77°F]	2.425	2.500	2.575	mV/Gauss
Null	TA = 25°C [77°F]	2.425	2.50	2.575	V
Sensitivity drift	TA = -40°C to 25°C [-40°F to 77°F]	0	—	+0.06	% / °C
	TA= 25°C to 125°C [77°F to 257°F]	-0.01	—	+0.05	
	TA= 125°C to 150°C [257°F to 302°F]	-0.04	—	+0.08	
Vnull drift	B = 0; TA = 25°C to 125°C [77°F to 257°F]	-0.032	—	+0.032	% / °C
	B = 0; TA = 125°C to 150°C [257°F to 302°F]	-0.064	—	+0.064	
SS496B					

B limits for	-B max.	-750	-840	—	Gauss
linear operation	+B max.	+750	+840	—	
Linearity	B = -750 to +750	0	-1.0	1.5	% of span
Sensitivity	TA = 25°C [77°F]	2.300	2.500	2.700	mV/Gauss
Null	TA = 25°C [77°F]	2.350	2.50	2.650	V
Sensitivity drift	TA = -40°C to 25°C [-40°F to 77°F]	-0.02	—	+0.08	%/°C
	TA = 25°C to 150°C [77°F to 302°F]	-0.02	—	+0.08	
Vnull drift	B = 0; TA = 25°C to 125°C [77°F to 257°F]	-0.064	—	+0.064	%/°C
	B = 0; TA = 125°C to 150°C [257°F to 302°F]	-0.064	—	+0.064	

Figure 1. Block Diagram

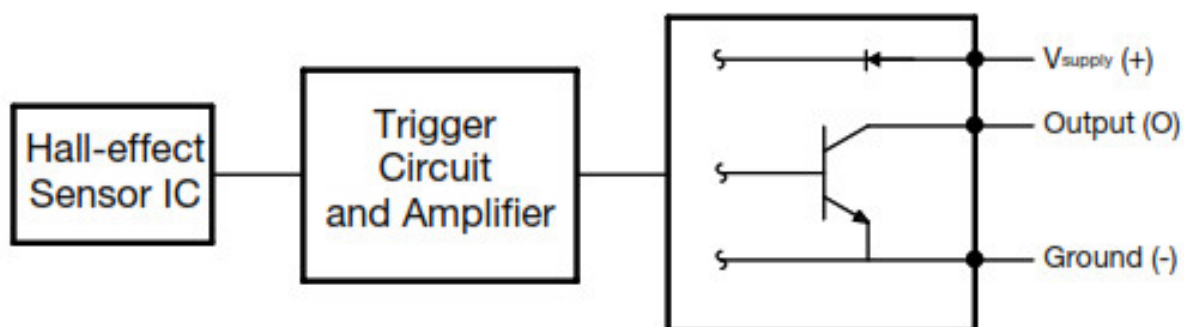


Figure 2. Maximum Supply Voltage vs Temperature


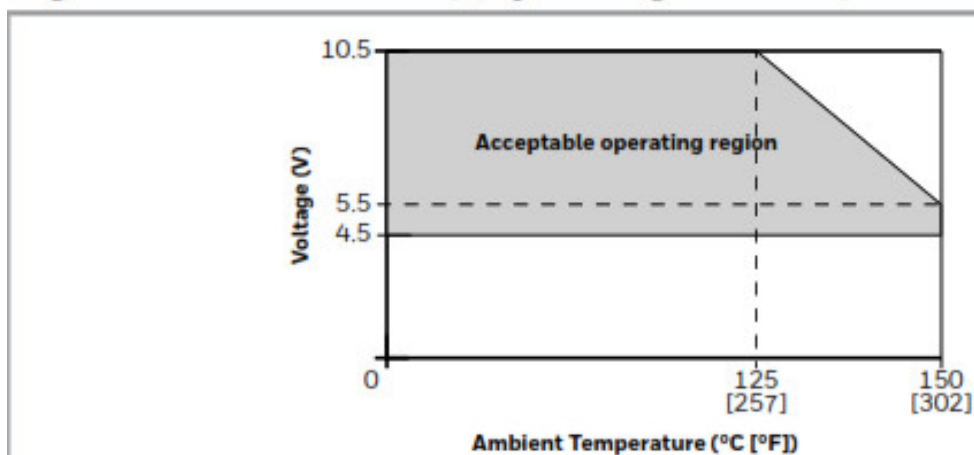



Figure 3. Transfer Characteristics: Typical Output Voltage

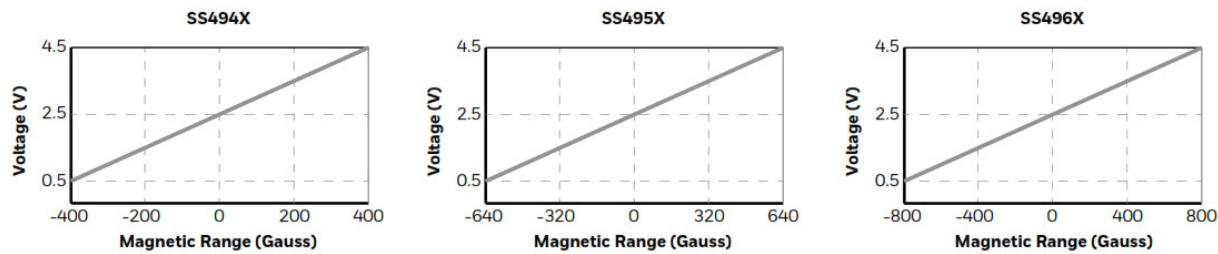


Advanced Sensing Technologies

Figure 4. SS490 Series Flat TO-92-Style Mounting and Dimensional Drawings (For reference only: mm/[in.])

A: Straight Standard Leads Sensor IC, Bulk Pack

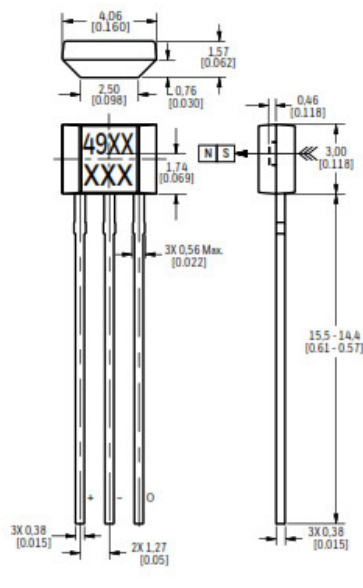


B: Straight Long Leads Sensor IC, Bulk Pack

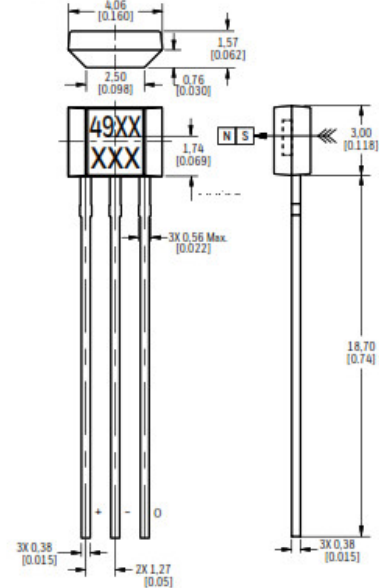


Note: Ensure the minimum hole size in the PCB is 0,68 mm [0.027] dia. based on the IPC 2222 Level B standard.

C. Formed Leads Sensor IC, Ammopack Tape-In-Box

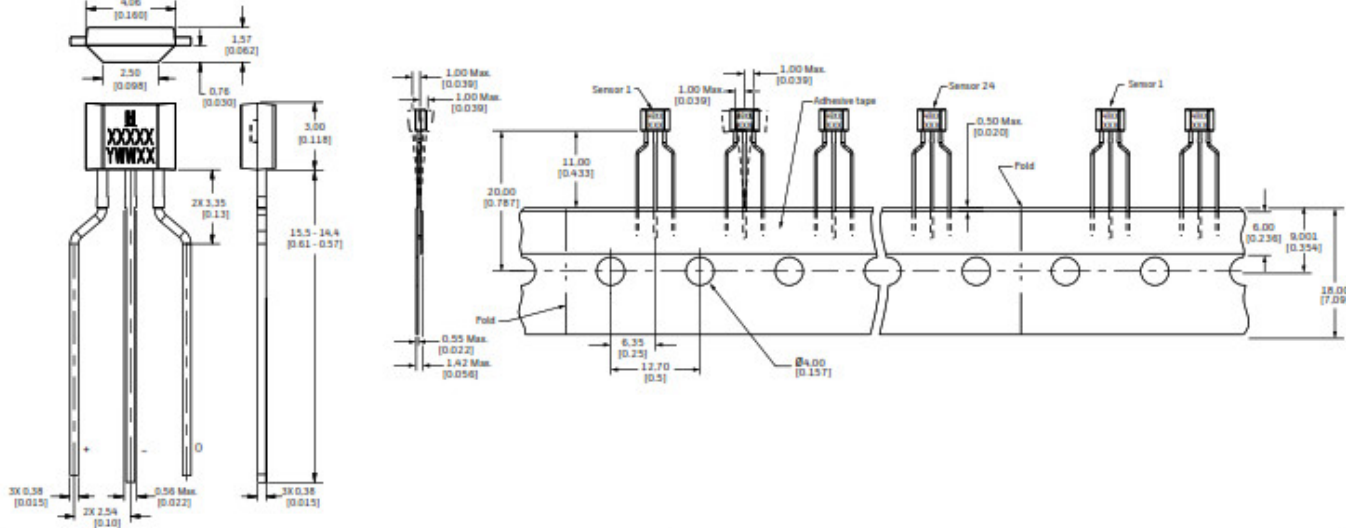

D. Straight Leads Sensor IC, Ammopack Tape-In-Box (See Figure 5.A. for individual sensor IC dimensions.)

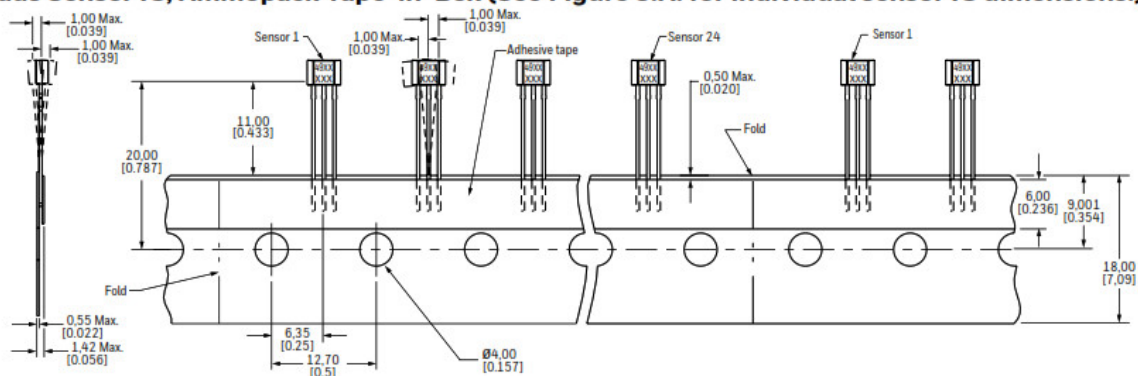

Advanced Sensing Technologies


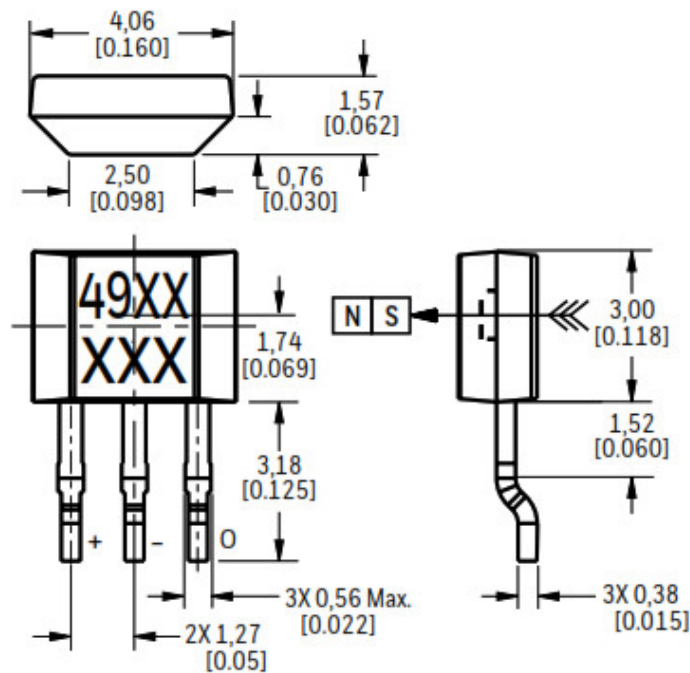


Figure 4. SS490 Series Flat TO-92-Style Mounting and Dimensional Drawings (continued)
E. Surface Mount Sensor IC, Bulk Pack

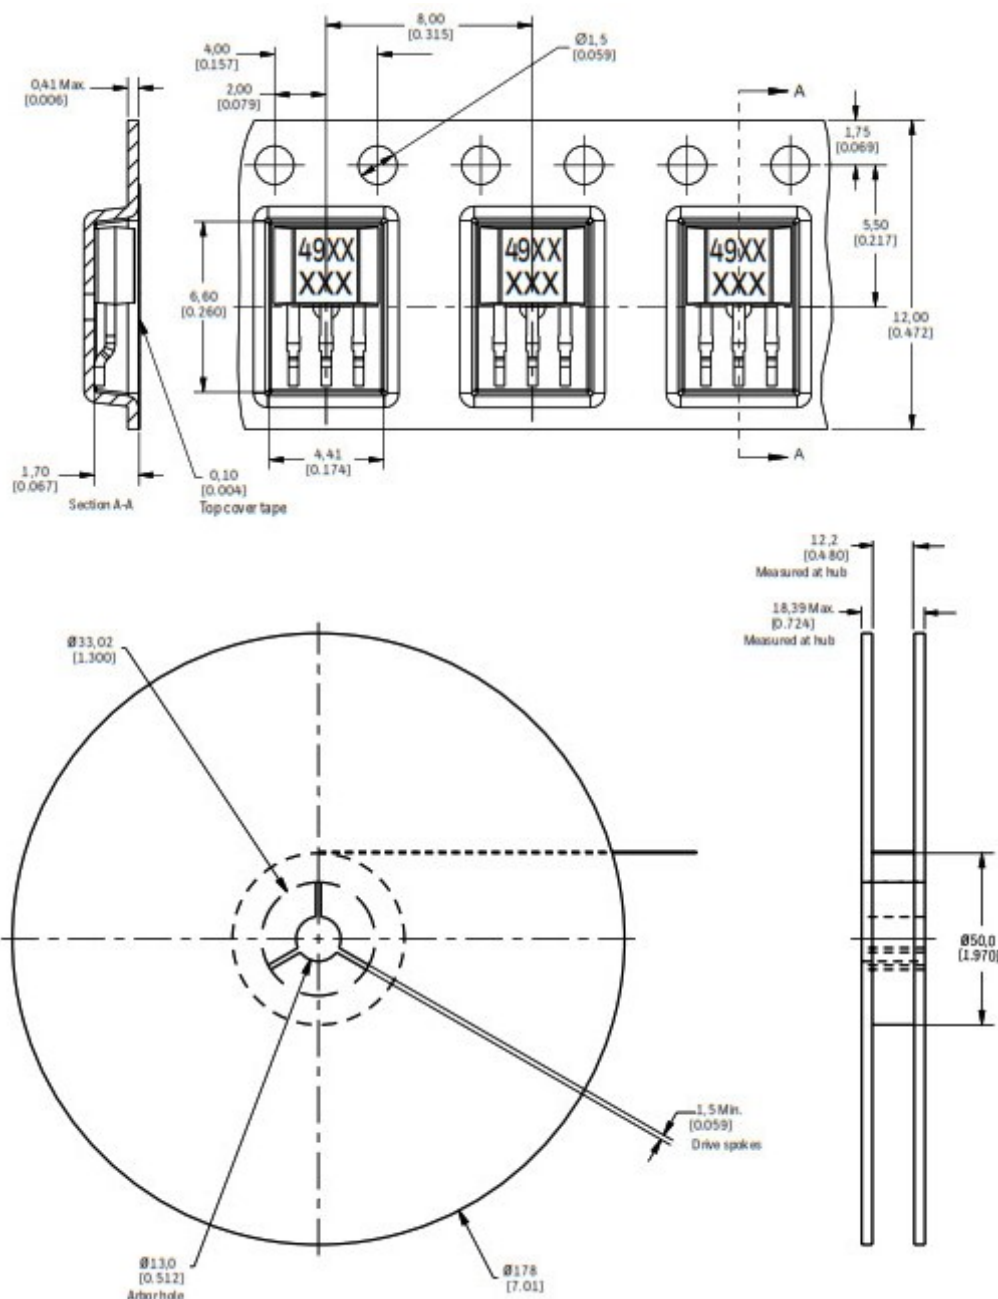

WARNING PERSONAL INJURY

DO NOT USE these products as safety or emergency stop devices or in any other application where the failure of the product could result in personal injury.

Failure to comply with these instructions could result in death or serious injury.

Warranty/Remedy

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship during the applicable warranty period. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgment or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items that Honeywell, in its sole discretion, finds defective. The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.

While Honeywell may provide application assistance personally, through our literature and the Honeywell web site, it is buyer's sole responsibility to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this writing. However, Honeywell assumes no responsibility for its use.

For more information


Honeywell Advanced Sensing Technologies services its customers through a worldwide network of sales offices and distributors. For application assistance, current specifications, pricing or the nearest Authorized Distributor, visit sps.honeywell.com/ast or call:

Asia Pacific +65 6355-2828

Europe +44 (0) 1698 481481

USA/Canada +1-800-537-6945

Documents / Resources

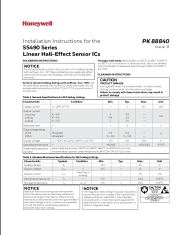	<p>Honeywell Linear Hall-Effect Sensor ICs [pdf] Installation Guide Honeywell, Linear Hall-Effect Sensor ICs, SS490 Series</p>
-----------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------

References

- [H Products - Advanced Sensing Technologies | Honeywell](#)