

# **GCC601X UC + Networking Convergence Solutions**

## **System Firmware Release Notes**

### **IMPORTANT UPGRADING NOTE**

- [12/6/2024] [1.0.5.5 (SYS)] Due to changes in Application Filtering, users will no longer be able to downgrade to SYS 1.0.3.x or lower and PBX 1.0.25.41 or lower after upgrading to 1.0.5.5.
- [8/21/2024] [1.0.1.34 (SYS)] Supported new GCC601x models and blocked firmware downgrade to any older firmware than 1.0.1.34.
- [7/26/2024] [1.0.1.32 (SYS)] Changed the default value from Enable to Disable for **“Allow DHCP Option 43 and 66 to Override Server”** and **“Check/Download New Firmware at Bootup”**. Upon upgrading from older version, these two options will be disabled. Please re-enable it if needed.

## Table of Content

|                                              |           |
|----------------------------------------------|-----------|
| <b>IMPORTANT UPGRADING NOTE .....</b>        | <b>1</b>  |
| <b>FIRMWARE FILE DOWNLOAD .....</b>          | <b>5</b>  |
| <b>FIRMWARE VERSION 1.0.7.46 (SYS) .....</b> | <b>6</b>  |
| PRODUCT NAME.....                            | 6         |
| DATE .....                                   | 6         |
| FIRMWARE FILE INFORMATION .....              | 6         |
| BUG FIXING .....                             | 6         |
| <b>FIRMWARE VERSION 1.0.7.44 (SYS) .....</b> | <b>7</b>  |
| PRODUCT NAME.....                            | 7         |
| DATE .....                                   | 7         |
| FIRMWARE FILE INFORMATION .....              | 7         |
| CHANGES/ENHANCEMENT .....                    | 7         |
| BUG FIXING .....                             | 10        |
| <b>FIRMWARE VERSION 1.0.7.14 (SYS) .....</b> | <b>11</b> |
| PRODUCT NAME.....                            | 11        |
| DATE .....                                   | 11        |
| FIRMWARE FILE INFORMATION .....              | 11        |
| CHANGES/ENHANCEMENT .....                    | 11        |
| <b>FIRMWARE VERSION 1.0.7.10 (SYS) .....</b> | <b>12</b> |
| PRODUCT NAME.....                            | 12        |
| DATE .....                                   | 12        |
| FIRMWARE FILE INFORMATION .....              | 12        |
| CHANGES/ENHANCEMENT .....                    | 12        |
| <b>FIRMWARE VERSION 1.0.7.5 (SYS) .....</b>  | <b>13</b> |
| PRODUCT NAME.....                            | 13        |
| DATE .....                                   | 13        |
| FIRMWARE FILE INFORMATION .....              | 13        |
| CHANGES/ENHANCEMENT .....                    | 13        |
| <b>FIRMWARE VERSION 1.0.5.11 (SYS) .....</b> | <b>22</b> |
| PRODUCT NAME.....                            | 22        |
| DATE .....                                   | 22        |

|                                              |           |
|----------------------------------------------|-----------|
| FIRMWARE FILE INFORMATION .....              | 22        |
| CHANGES/ENHANCEMENT .....                    | 22        |
| <b>FIRMWARE VERSION 1.0.5.6 (SYS) .....</b>  | <b>23</b> |
| PRODUCT NAME .....                           | 23        |
| DATE .....                                   | 23        |
| FIRMWARE FILE INFORMATION .....              | 23        |
| CHANGES/ENHANCEMENT .....                    | 23        |
| <b>FIRMWARE VERSION 1.0.3.6 (SYS) .....</b>  | <b>25</b> |
| PRODUCT NAME .....                           | 25        |
| DATE .....                                   | 25        |
| FIRMWARE FILE INFORMATION .....              | 25        |
| CHANGES/ENHANCEMENT .....                    | 25        |
| <b>FIRMWARE VERSION 1.0.3.5 (SYS) .....</b>  | <b>26</b> |
| PRODUCT NAME .....                           | 26        |
| DATE .....                                   | 26        |
| FIRMWARE FILE INFORMATION .....              | 26        |
| CHANGES/ENHANCEMENT .....                    | 26        |
| <b>FIRMWARE VERSION 1.0.1.34 (SYS) .....</b> | <b>28</b> |
| PRODUCT NAME .....                           | 28        |
| DATE .....                                   | 28        |
| FIRMWARE FILE INFORMATION .....              | 28        |
| CHANGES/ENHANCEMENT .....                    | 28        |
| <b>FIRMWARE VERSION 1.0.1.32 (SYS) .....</b> | <b>29</b> |
| PRODUCT NAME .....                           | 29        |
| DATE .....                                   | 29        |
| FIRMWARE FILE INFORMATION .....              | 29        |
| CHANGES/ENHANCEMENT .....                    | 29        |
| <b>FIRMWARE VERSION 1.0.1.10 (SYS) .....</b> | <b>30</b> |
| PRODUCT NAME .....                           | 30        |
| DATE .....                                   | 30        |
| FIRMWARE FILE INFORMATION .....              | 30        |
| CHANGES/ENHANCEMENT .....                    | 30        |
| <b>FIRMWARE VERSION 1.0.1.8 (SYS) .....</b>  | <b>31</b> |
| PRODUCT NAME .....                           | 31        |

|                                 |    |
|---------------------------------|----|
| DATE .....                      | 31 |
| FIRMWARE FILE INFORMATION ..... | 31 |
| CHANGES/ENHANCEMENT .....       | 31 |

## FIRMWARE FILE DOWNLOAD

Individual firmware files are available for downloading at URL below:

<https://www.grandstream.com/support/firmware>

## **FIRMWARE VERSION 1.0.7.46 (SYS)**

### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

### **DATE**

9/18/2025

### **FIRMWARE FILE INFORMATION**

- GCC601x system firmware file name: gcc601xfw.bin  
MD5 checksum: 8e748d405355f9c0012d5ce10db24185
- GCC601x complete firmware file name: gcc601xfullyfw.bin  
MD5 checksum: c6dc027a626e09bec0edd71ca7b84464  
(Including SYS 1.0.7.46 + PBX 1.0.27.90)

### **BUG FIXING**

- Internal bug fixes

## FIRMWARE VERSION 1.0.7.44 (SYS)

### PRODUCT NAME

GCC6010, GCC6010W, GCC6011

### DATE

8/27/2025

### FIRMWARE FILE INFORMATION


- GCC601x system firmware file name: gcc601xfw.bin  
MD5 checksum: 24a69f2f7aeb85b9f5e183cddad0b515
- GCC601x complete firmware file name: gcc601xfullyfw.bin  
MD5 checksum: 88f3c1609ad8092734d44557f1694437  
(Including SYS 1.0.7.44 + PBX 1.0.27.89)

### CHANGES/ENHANCEMENT

- **Home**
  - **Overview** → **Basic Information**: Added Security Versions.
  - **System Settings** → **Basic Settings**: Added **LED Indicator** configurations.
  - **System Settings** → **Security Settings** → **Web Access**: Added **Server Certificate**.
  - **System Settings** → **SMS Settings**: Added support for **Alibaba Cloud**.
  - **Maintenance** → **Backup & Restore**: Added support for changing backup file name.
  - **Setup Wizard**: Added session for quick firewall inbound policy configuration.
- **Networking**
  - **Network Settings** → **Port Configuration**: Added configuration for Port Name
  - **Network Settings** → **LAN** → **Static IP Binding**: Added support for VLAN setting


- **VPN:**

- Added feature of **ZeroTier** VPN

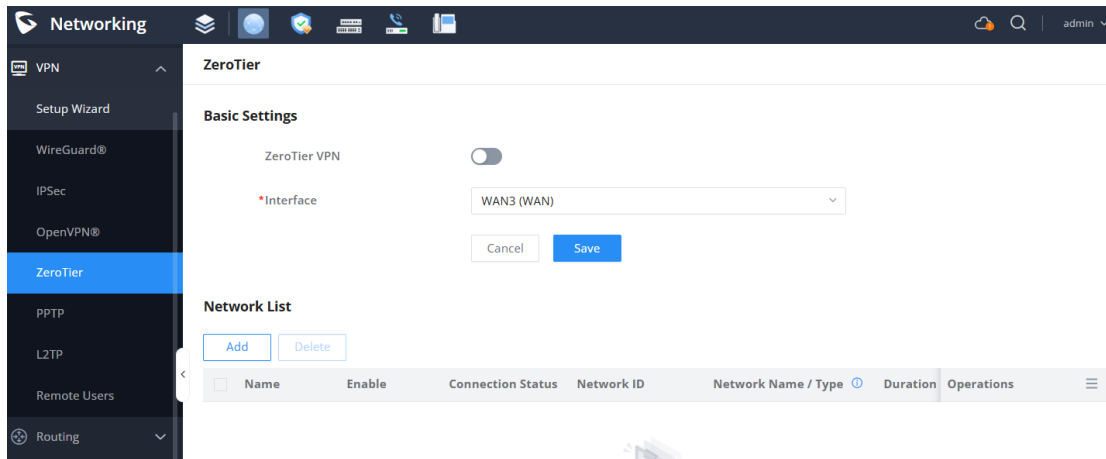

- Added **Setup Wizard** of ZeroTier


- Added feature of RADIUS authentication for **OpenVPN®**

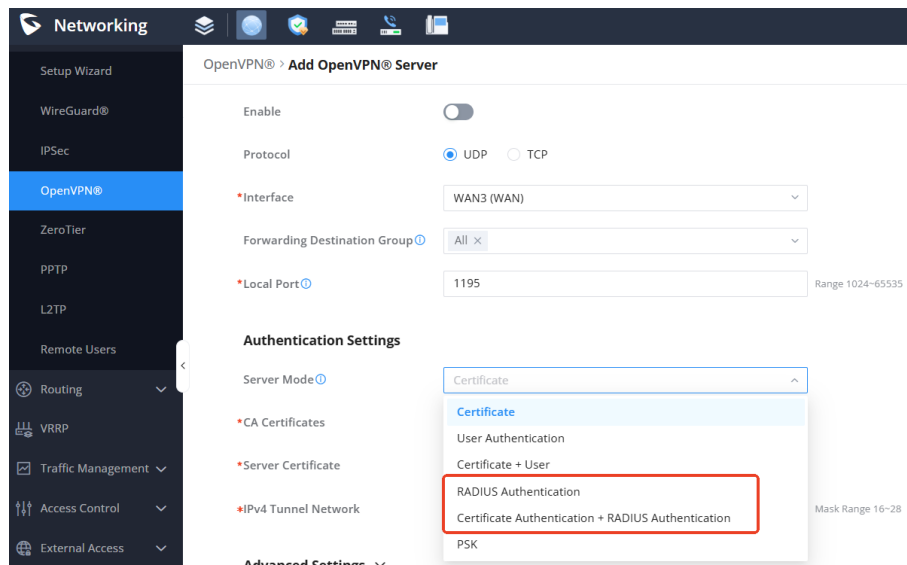

- **External Access** → **DDNS**: Added support for custom service providers
- **System Settings** → **File Sharing**: Added support of microSD and SSD external device
- **Firewall**
  - **Content Control**
    - **DNS Filtering**:



- Added VLAN configuration for web filtering and application filtering

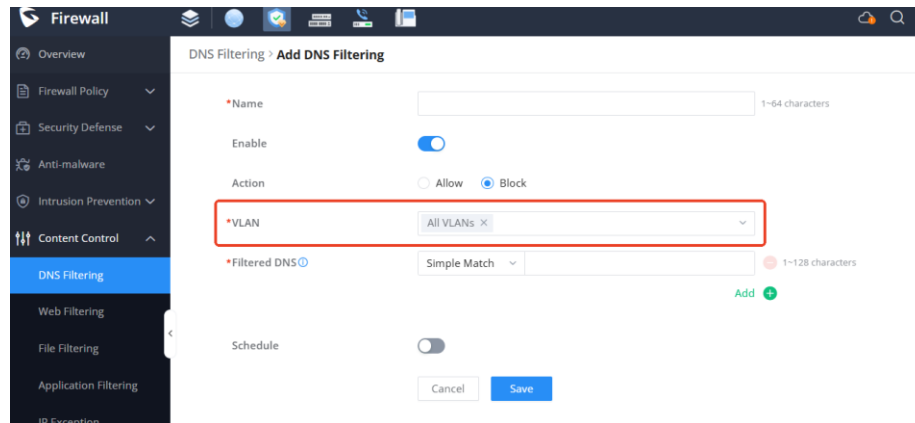

**Firewall**

DNS Filtering > Add DNS Filtering

\*Name  1-64 characters

Enable ☒

Action ☐ Allow ☒ Block


\*VLAN  (highlighted with a red box)

\*Filtered DNS  1-128 characters

Schedule ☐

Cancel Save

- Added DNS Filtering configuration and Redirect Blocked Webpage configuration

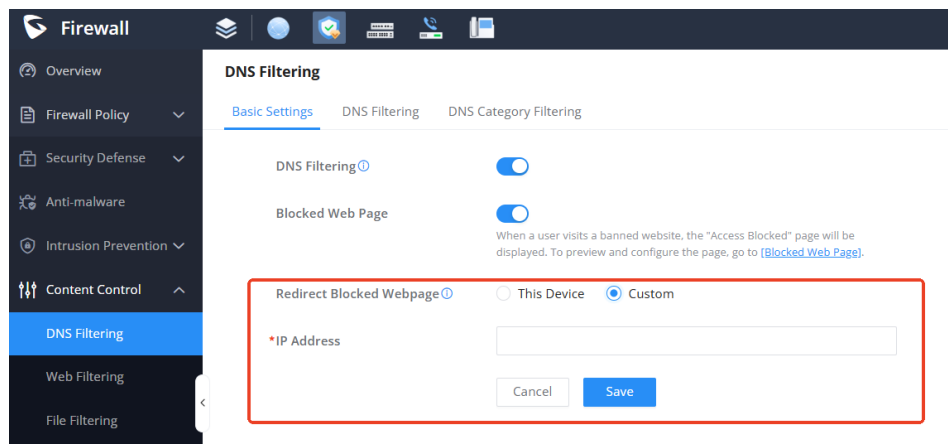

**Firewall**

DNS Filtering

Basic Settings DNS Filtering DNS Category Filtering

DNS Filtering ☒

Blocked Web Page ☒


When a user visits a banned website, the "Access Blocked" page will be displayed. To preview and configure the page, go to [Blocked Web Page](#).

Redirect Blocked Webpage ☐ This Device ☒ Custom (highlighted with a red box)

\*IP Address

Cancel Save

- Added new feature of File filtering

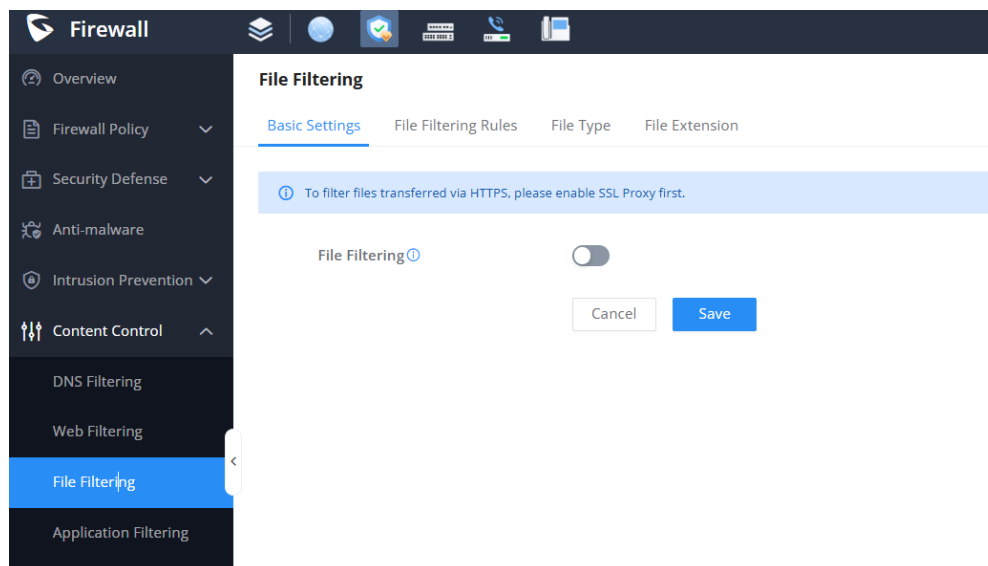

**Firewall**

File Filtering


Basic Settings File Filtering Rules File Type File Extension

To filter files transferred via HTTPS, please enable SSL Proxy first.

File Filtering ☐ (highlighted with a red box)

Cancel Save

- **SSL Proxy → Basic Settings:** Added **Forced Proxy** and **Optional Proxy** configurations, and added **Built-in Domain Exemptions**

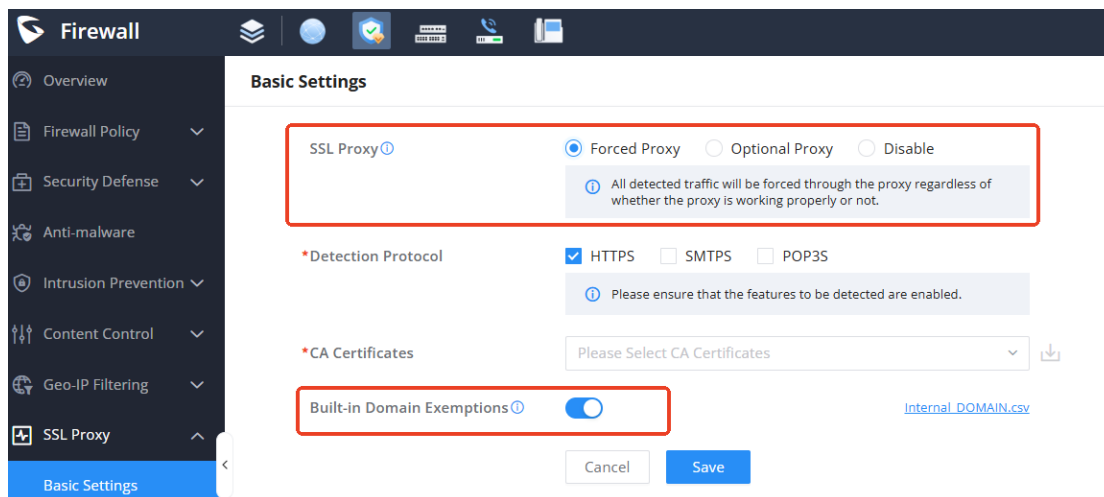

- **Security Log:** Added filter of **Firewall Policy**
- **Network Nodes**
  - **AP Management:** Added support for GWN767x models
  - **Switch Management:** Added support for GWN771x and GWN782x models
  - **Wi-Fi Management → SSIDs:** Changed the bandwidth limits for "Maximum Upstream Bandwidth" and "Maximum Downstream Bandwidth" to 1-10240 Mbps

## BUG FIXING

- Fixed a bug that causes device unable to route traffic between OpenVPN® server and OpenVPN® client.
- Fixed a bug that IPS incorrect trigger for Intrusion.
- Fixed an issue that Wireguard VPN cannot handle Domains for Endpoint address.

## **FIRMWARE VERSION 1.0.7.14 (SYS)**

### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

### **DATE**

8/6/2025

### **FIRMWARE FILE INFORMATION**

- GCC601x system firmware file name: gcc601xfw.bin  
MD5 checksum: e4fb5f65bd96bf348bb8e035ae84cabf

### **CHANGES/ENHANCEMENT**

- \*Fixed a constant rebooting issue introduced on 8/2/2025 by virus signature lib update.

*\*Note: Do not need to upgrade this firmware if the unit was not affected by 8/4/2025.*

## **FIRMWARE VERSION 1.0.7.10 (SYS)**

### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

### **DATE**

5/23/2025

### **FIRMWARE FILE INFORMATION**

- GCC601x system firmware file name: gcc601xfw.bin  
MD5 checksum: 41b1247288692db35096c26aea1e8686
- GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)  
MD5 checksum: 4fe23131df1d756fcd47afafa7ddf77a  
(Including SYS 1.0.7.10 + PBX 1.0.27.47)

### **CHANGES/ENHANCEMENT**

- Internal bug fixes.

## FIRMWARE VERSION 1.0.7.5 (SYS)

### PRODUCT NAME

GCC6010, GCC6010W, GCC6011

### DATE


4/21/2025

### FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin  
MD5 checksum: 125a3a460e8a392fde12a5e4a93c9bc9
- GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)  
MD5 checksum: f807833711e7378a28c2538e20a14da2  
(Including SYS 1.0.7.5 + PBX 1.0.27.44)

### CHANGES/ENHANCEMENT

- **Home**
  - Added **Feedback** and **Remote Management (GWN App)** in the top bar admin dropdown menu.

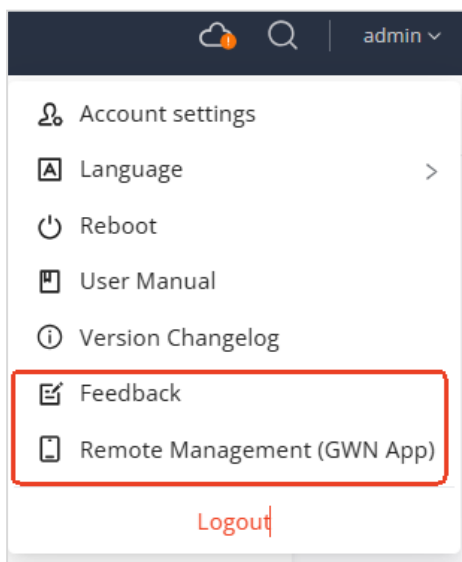

- Added **Real-time Session Statistics**, **Firewall service**, and **PBX** information in **Overview**.
- Added VLAN configuration when enabling **PBX** module.
- System Settings
  - o Basic Settings
    - Fixed Asuncion time zone to UTC-3
    - Fixed Kazakhstan Almaty time zone to UTC+5
    - Added settings for multiple NTP server
    - Changed default time zone to UTC+00:00 Etc/Universal, country to Spain
  - o Security Settings
    - Added **Multi-Factor Authentication** for **Accounts Settings**

| Security Settings             |                                                                                         |            |                                |
|-------------------------------|-----------------------------------------------------------------------------------------|------------|--------------------------------|
| Account Settings              | Web Access                                                                              | SSH Access | Remote Access without Password |
| Username                      | admin                                                                                   |            |                                |
| Password                      | ..... <a href="#">Modify</a>                                                            |            |                                |
| Email                         | 44li@grandstream.cn <a href="#">Modify</a>                                              |            |                                |
| Mobile Number                 | .. <a href="#">Modify</a>                                                               |            |                                |
| Multi-Factor Authentication ⓘ | Disable <a href="#">Multi-Factor Authentication Instructions</a> <a href="#">Modify</a> |            |                                |

- Added **Allowed IP Addresses** settings in **Web Access**
  - o Schedule
    - Added a button of **Reference Details**, from which user can check to where the schedule is applied
- Maintenance
  - o Upgrade
    - Added a factory reset prompt when downgrading to an incompatible firmware
- Log & Disgnostics
  - o Added **Core Files** retrieval

- **Networking**

- **Network Settings:**

- **WAN**


- Added **Bridge Mode**
    - Optimized the **Tracking IP** feature

- **LAN**

- Optimized the Static IP Binding settings


- **VPN**

- Added **Setup Wizard** for **WireGuard®**, **IPsec**, **OpenVPN®**, **PPTP** and **L2TP**

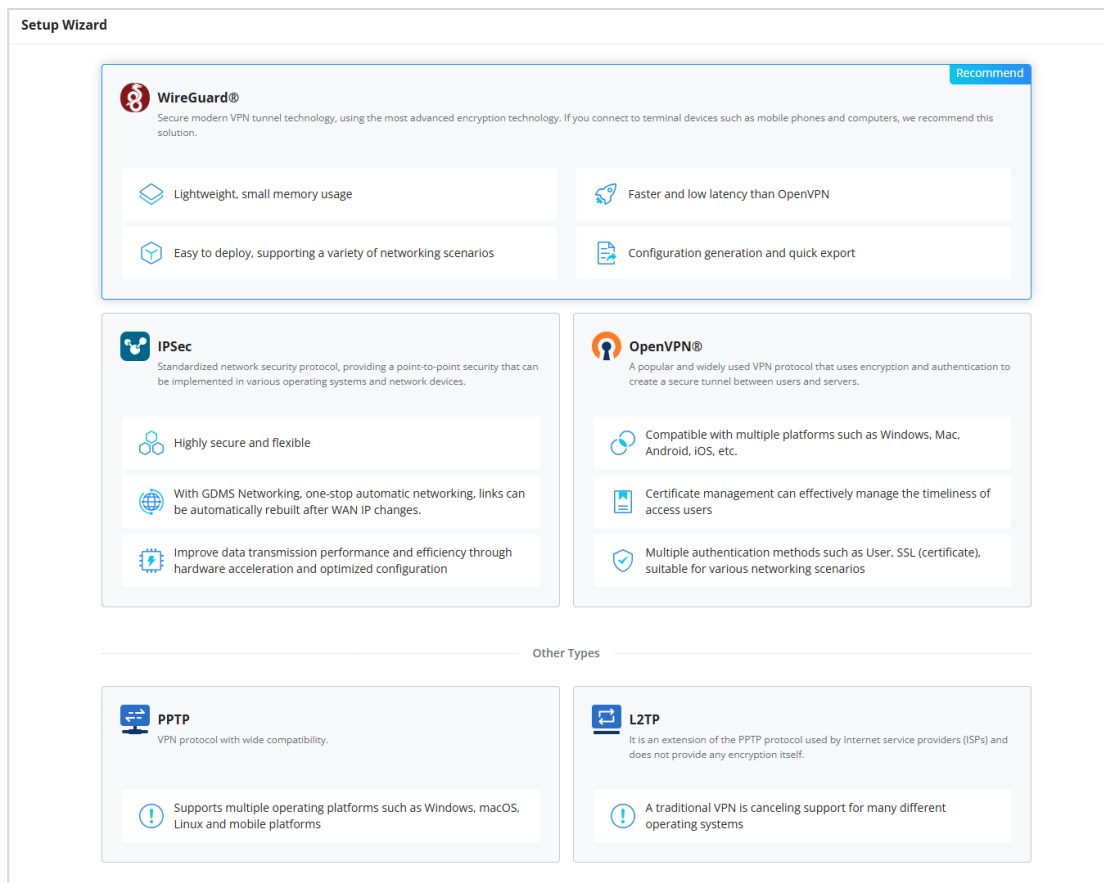

- Optimized UI configurations and added configuration guide link for **WireGuard®**, **IPsec**, **OpenVPN®**, **PPTP** and **L2TP**


- Added **Remote Clients** information list for **WireGuard®**
  - Added support of domains for the Endpoint address on **WireGuard®**.
  - Added Site-to-Site connection status to **IPsec**
  - Added column of **IP Address** and **Tunnel IP** to client list under **OpenVPN®** and **PPTP Servers**
  - Added support of **IPSec Encryption** to **L2TP** server.
  - Added support for users to manually adjust the MTU and MSS values for IPsec connections.
  - Added support of exporting client .ovpn file for **OpenVPN® Clients**
  - Optimized the logic that when a WAN interface is deleted, the dependent VPN will not be removed but set to disable instead.
- Routing
    - Added the **Routing Table** page
    - Optimized the UI configuration of **Static Routes** and **Policy Routes**
    - Added configuration pages for **OSPF**, **RIP**, and **BGP**

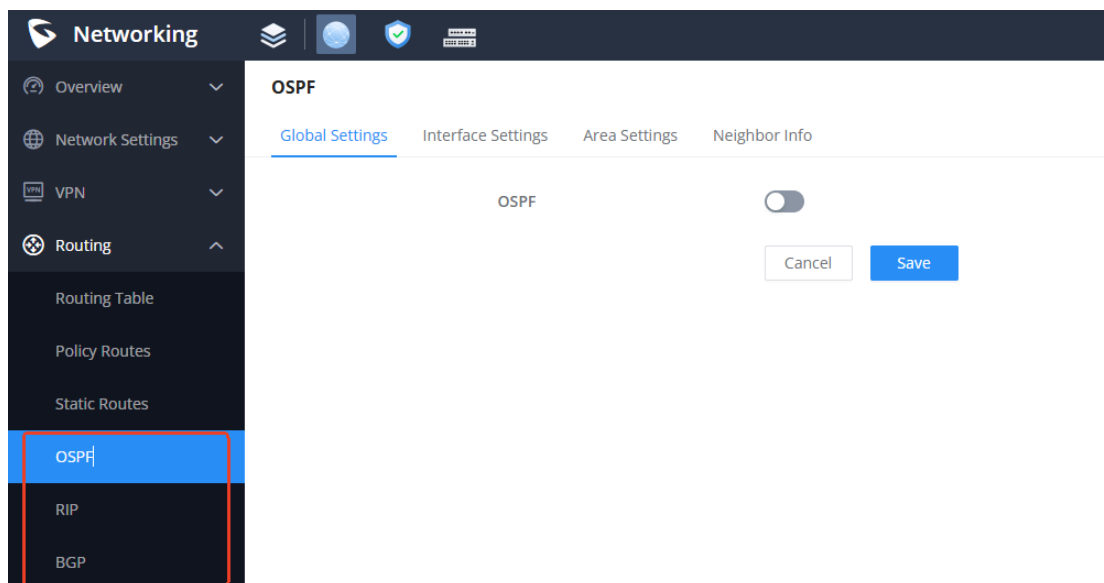


- Traffic Management
  - Added **Statistic by IP address** under **Traffic Statistics** → **Basic Settings**
- External Access
  - Added configurations of **IP Source** and **Update Interval (Min)** to **DDNS**




- Added the **Clone** feature to **Port Forwarding** rules
- **Maintenance**
  - Added an input restrictions to TR-069 ACS Username and Password.
  - From **System Diagnostics**, moved **Ping/Traceroute** to **Maintenance** → **Network Tools**, and **Core File** to **Home** → **Logs & Diagnosticse**
  - Added a feature of **Local Logs** download under **Syslog**
  - Added features of **NSlookup** and **Wake on LAN** under **Network Tools**

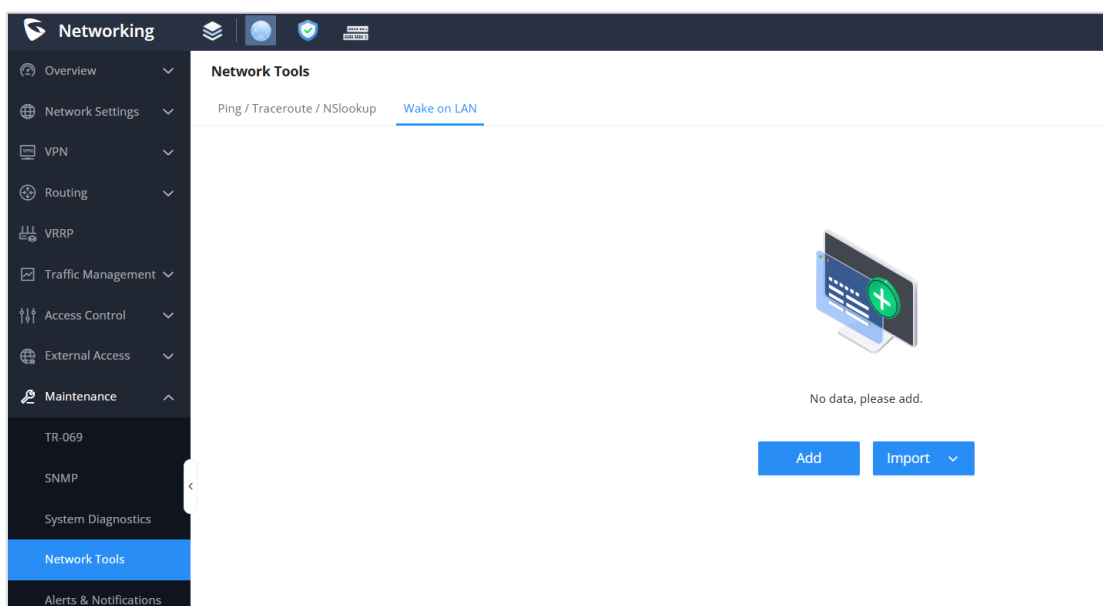

- Optimized the UI for **Alerts & Notifications** page
- **System Settings**
  - Added **Email Settings**
  - Moved **RADIUS, Certificates** to **Profiles**
- **Added Profiles**
  - Added support of **MAC Group, IP Address Group, FQDN, RADIUS, Certificates**
- **Firewall**
  - Added support of **Profiles** of **IP Address Group** and **FQDN** group to DoS Exception, IPS Exception, Bonet Exception, Content Control Exception, SSL Proxy Exception, SSL Proxy source address, Geo-IP Exception.

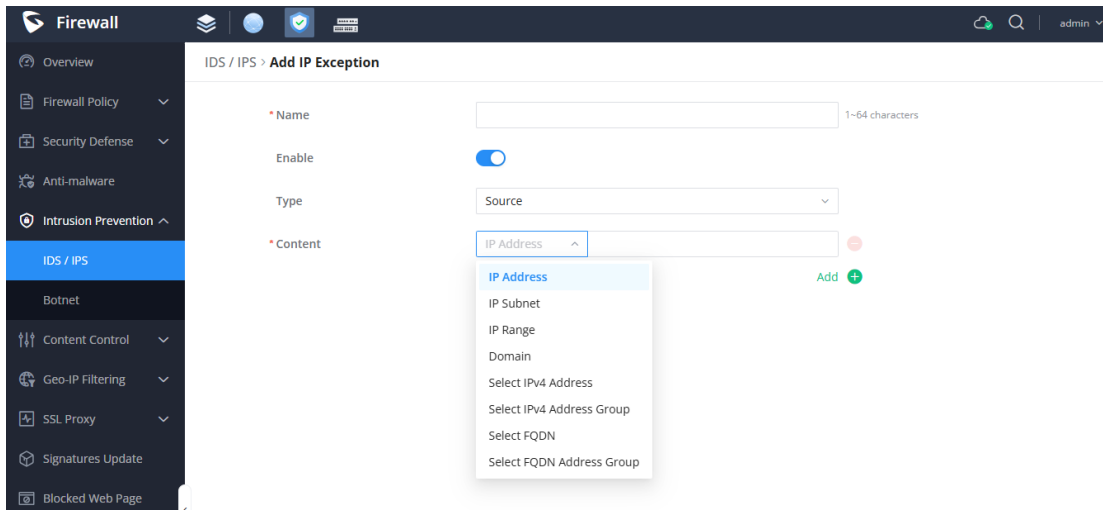


- Overview
  - o Added **App Category** for **APP Filtering** in **Top Security Log**
  - o Added **Refresh** button for **Firewall Service** plan
- Firewall Policy
  - o Added the feature of **Schedule** for **Traffic Rules**
  - o Added **Clone** button for **Traffic Rules** and Advanced NAT
- Added **Signatures Update** to manage all related Firewall module's signature libraries.

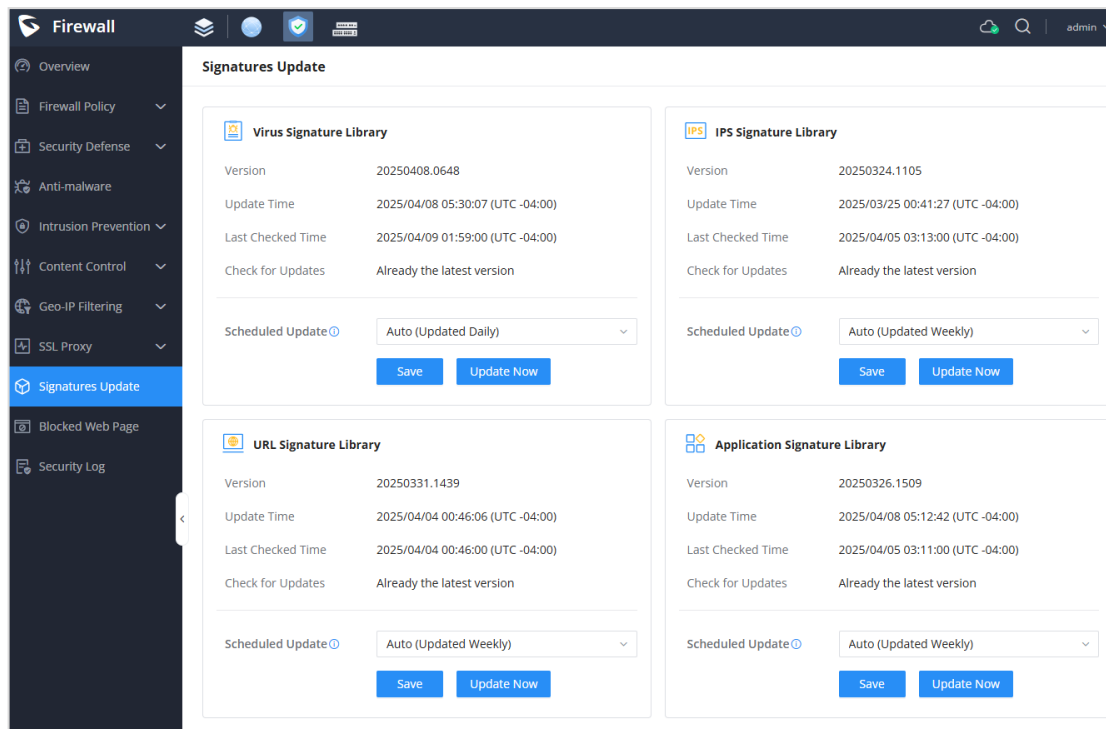


## - Content Control


### o Added **DNS Category Filtering** under **DNS Filtering**

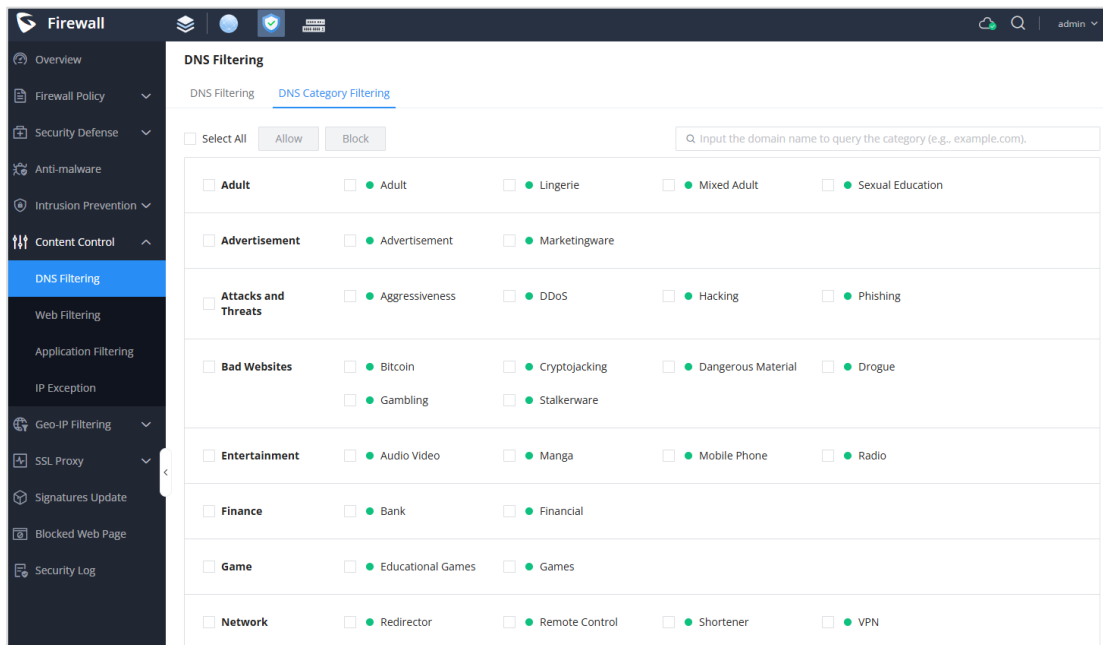

### o Optimized the **Application Filtering Rules** and **Application List** interface UI, and added **Network Protocol** and **Unknown Applications** categories

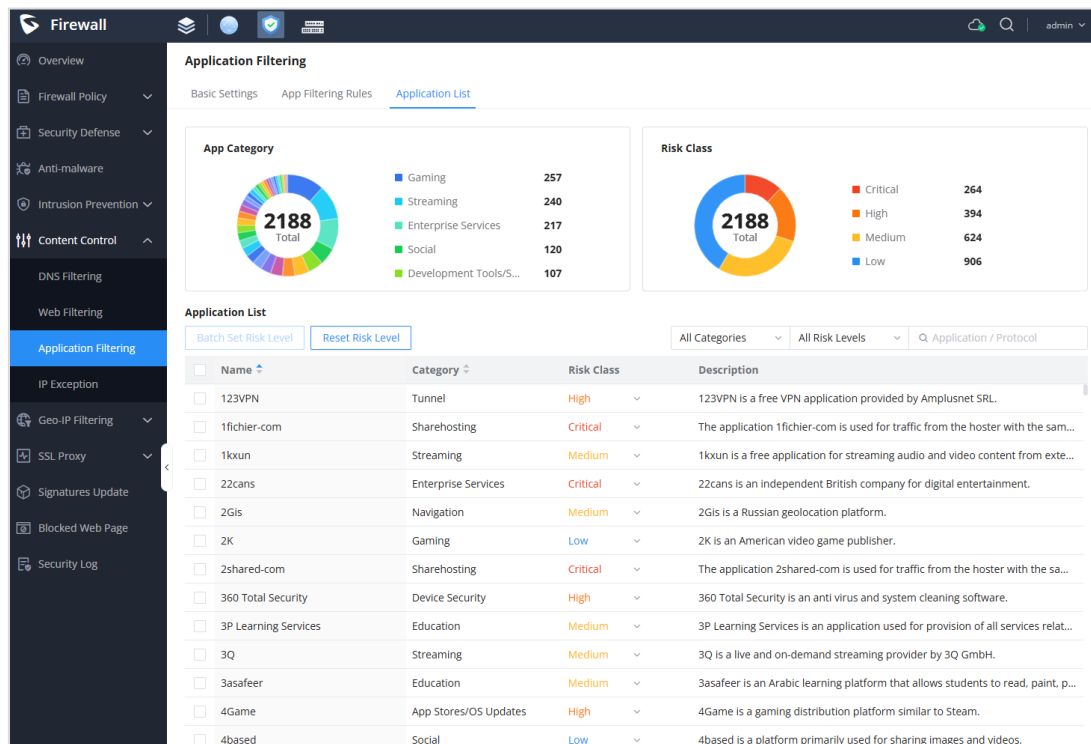

- Added **Blocked Web Page** to self-define the landing page for **Access Blocked** and **Virus detected**

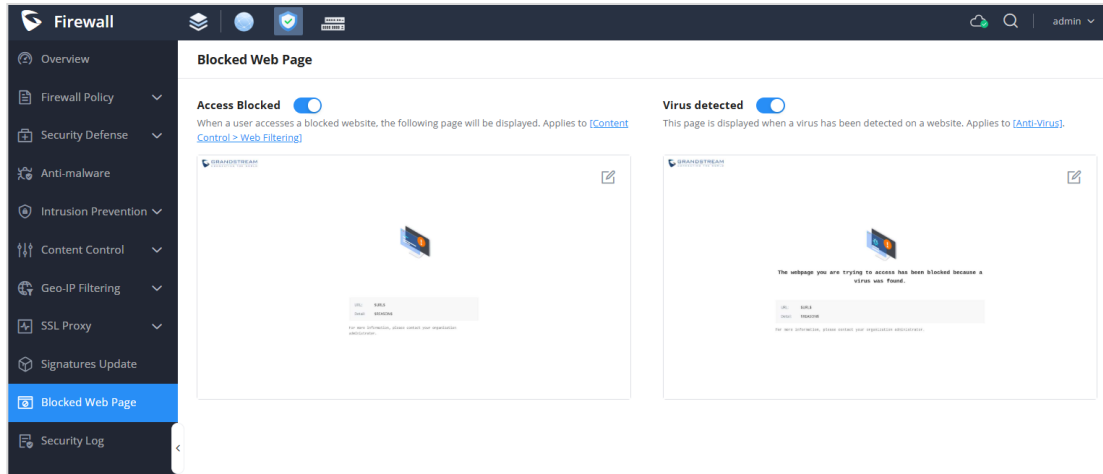

- Security Log
  - o Added **Details** for **DoS & Spoofing** and **Application Filtering**
  - o Added support of **Export All** logs
  - o Added **DNS Filtering Risk Level Settings** to **Log Level** and **Email Notification**

## • Network Nodes

- Added support of **VLAN ID** configuration to **Wi-Fi Management** → **PPSK**
- Added support of **Captive Portal** to wired clients
- Added **Bypass Splash Page** to **Captive Portal** → **Policy**

DNS Filtering Risk Level Settings

▲ Block

☒ Critical
 ☐ High
 ☐ Medium
 ☐ Low

Blocked DNS

☒ Critical
 ☐ High
 ☐ Medium
 ☐ Low

▲ Adult

☐ Critical
 ☐ High
 ☒ Medium
 ☐ Low

Adult

☐ Critical
 ☐ High
 ☒ Medium
 ☐ Low

Lingerie

☐ Critical
 ☐ High
 ☒ Medium
 ☐ Low

Mixed Adult

☐ Critical
 ☐ High
 ☒ Medium
 ☐ Low

Sexual Education

☐ Critical
 ☐ High
 ☒ Medium
 ☐ Low

▲ Advertisement

☐ Critical
 ☐ High
 ☐ Medium
 ☒ Low

Advertisement

☐ Critical
 ☐ High
 ☐ Medium
 ☒ Low

Marketingware

☐ Critical
 ☐ High
 ☐ Medium
 ☒ Low

▲ Attacks and Threats

☒ Critical
 ☐ High
 ☐ Medium
 ☐ Low

Aggressiveness

☒ Critical
 ☐ High
 ☐ Medium
 ☐ Low
 

DDoS

☒ Critical
 ☐ High
 ☐ Medium
 ☐ Low
 

Hacking

☒ Critical
 ☐ High
 ☐ Medium
 ☐ Low
 

Phishing

☒ Critical
 ☐ High
 ☐ Medium
 ☐ Low
 

▲ Bad Websites

☒ Critical
 ☐ High
 ☐ Medium
 ☐ Low

Bitcoin

☒ Critical
 ☐ High
 ☐ Medium
 ☐ Low
 

Cancel

Save

- Fixed a bug where UC endpoints could not detect VoIP devices on the WAN side.
- Fixed a bug that caused VPN configurations to be erased when the WAN connection was disabled or deleted.
- Fixed a bug that character "-" cannot be used in the special characters list for certificate names.
- Fixed a bug that Daylight Saving Time was applied in the Asuncion/Paraguay time zone.
- Fixed a bug of /31 subnet mask support.
- Fixed a bug that caused intermittent disconnections with IPSec VPN.

## **FIRMWARE VERSION 1.0.5.11 (SYS)**

### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

### **DATE**

1/13/2025

### **FIRMWARE FILE INFORMATION**

- GCC601x system firmware file name: gcc601xfw.bin  
MD5 checksum: 6f06b8ba6b41fa9c7ca704b5b68fce3e
- GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)  
MD5 checksum: 39c3816a7734cfd4c9aa94f1228a83cd  
(Including SYS 1.0.5.11 + PBX 1.0.27.17)

### **CHANGES/ENHANCEMENT**

- Internal bug fixes

## FIRMWARE VERSION 1.0.5.6 (SYS)

### PRODUCT NAME

GCC6010, GCC6010W, GCC6011

### DATE

12/6/2024

### FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin  
MD5 checksum: 0815d1f0a1e272e6d3b6b0216aedb870
- GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)  
MD5 checksum: 1b19dcb30ead367939324922dbe85d20  
(Including SYS 1.0.5.6 + PBX 1.0.27.14)

### CHANGES/ENHANCEMENT

- [Home] Added Operation Log page.
- [Home] Added the ability to schedule regular backups under the *Maintenance* → *Backup & Restore* page.
- [Home] Added support for MTA email method.
- [Networking] Added support for load balancing strategies under the *Routing* → *Policy Routes* page.
- [Networking] Added support for VRRP.
- [Networking] VPN settings are now retained after closing VPN.
- [Networking] DNS filtering now supports filtering by SNI and common name in the certificate.
- [Networking] IPSec is now limited to 64 tunnels.
- [Networking] Added support for connection speed test with GWN Cloud.
- [Networking] Added support for receiving PPSK configurations from GWN Cloud.
- [Firewall] Added ability to configure outbound traffic rules under the *Firewall Policy* → *Traffic Rules* page.

- [Firewall] IDS/IPS detection settings will now be applied to all WAN interfaces. Interfaces can no longer be excluded.
- [Firewall] Added support for SMTP(S) and POP3(S) detection protocols.
- [Firewall] Added support for importing and exporting SSL proxy exemption lists.
- [Firewall] Added ability to schedule the automatic turning on/off of DNS filtering, web filtering, and application filtering.
- [Firewall] Added support for Geo-IP filtering.
- [Firewall] SSL exemption list now supports wildcard input.
- [Firewall] Added security log risk levels and corresponding filters.
- [Firewall] Added *Application List* tab to the [Application Filtering] section. This page will show a list of all monitored applications and their corresponding risk levels.
- [Network Nodes] Added support for 6GHz band in the SSID, Radio, and Mesh settings.
- [UC Endpoints] Fast Provision will now also include the PBX module's local LDAP phonebook information.
- Several bug fixes.



## **FIRMWARE VERSION 1.0.3.6 (SYS)**

### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

### **DATE**

10/8/2024

### **FIRMWARE FILE INFORMATION**

- GCC601x system firmware file name: gcc601xfw.bin  
MD5 checksum: 25957d6a84dd13b2976c6d08ae386221
- GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)  
MD5 checksum: dd0e37ef081abf11ea56151029724fc0  
(Including SYS 1.0.3.6 + PBX 1.0.25.41)

### **CHANGES/ENHANCEMENT**

- [Home] Fixed an issue that offline device disappears from Network Topology
- [Networking] Fixed an issue that on GCC6010 SFP1 only supports maximum 1G bandwidth. Now it opens to 2.5G.
- Internal bug fixes.

## FIRMWARE VERSION 1.0.3.5 (SYS)

### PRODUCT NAME

GCC6010, GCC6010W, GCC6011

### DATE

9/20/2024

### FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin  
MD5 checksum:     bbcd081cb648443fd7e9cac33e5ff333
- GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)  
MD5 checksum:     89d6b124242b06bf2e82790b5929a0fc  
(Including SYS 1.0.3.5 + PBX 1.0.25.40)

### CHANGES/ENHANCEMENT

- [Home] Added support for formatting M.2 SSD
- [Home] Added support of **Real-time Session Statistics** in Overview page
- [Home] Added support of **Show Offline Device** in Topology page
- [Home] Added configuration of **Redirect from Port 80** in System Settings → Security Settings → Web Access
- [Home] Added support of complete firmware upgrade to upgrade both System and PBX firmware by one .bin file
- [Home] Fixed the bug that prompts “internal error” when performing “Detect New Version” in firmware Upgrade
- [Networking] Allowed same VLAN ID configuration on different WANs
- [Networking] Changed IPv6 MTU minimum value to 1280
- [Networking] Added **WAN Port MAC address** configuration

- [Networking] Added **Blackhole** option for Static Routes → Outgoing Interface
- [Networking] Added **PBX Service** configurations for Traffic Management → QoS → VoIP Settings
- [Networking] Added support of batch delete to Maintenance → System Diagnostics → Core File
- [Networking] Added support of saving capture on attached storage under Maintenance → System Diagnostics → Capture
- [Networking] Added **Takeover / Un-Takeover Switch Alert** option into Maintenance → Alerts & Notifications → E-mail Notification Settings
- [Networking] Fixed the bug that WAN related configurations are deleted when disabling WAN
- [Networking] Enforced minimum 1 LAN port when disabling Port under Network Settings → Port Configuration
- [Networking] Supported exporting pem format certificate in System Settings → Certificates
- [Firewall] Added support of **Static ARP List** under Security Defense → ARP Protection
- [Firewall] Moved Spoofing Defense from DoS Defense to ARP Protection
- [Firewall] Added support of **IP Exception** to Content Control
- [Firewall] Added search feature in Content Control → Application Filtering → App Filtering Rules
- [Firewall] UI optimization
- Internal bug fixes.

## **FIRMWARE VERSION 1.0.1.34 (SYS)**

### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

### **DATE**

8/21/2024

### **FIRMWARE FILE INFORMATION**

- GCC601x system firmware file name: gcc601xfw.bin  
MD5 checksum: 2736f9bd5a51e24e53857546887a22ec

### **CHANGES/ENHANCEMENT**

- Added support of new models, GCC6010W, GCC6011
- Blocked system firmware downgrade to any older version
- Internal bug fixes.

## FIRMWARE VERSION 1.0.1.32 (SYS)

### PRODUCT NAME

GCC6010

### DATE

7/26/2024

### FIRMWARE FILE INFORMATION

- GCC6010 system firmware file name: gcc601xfw.bin  
MD5 checksum: 3b6810c23b4ee941c534649ef84d41ea

### CHANGES/ENHANCEMENT

- Resolved the Tiktok Live streaming issue when Antivirus is enabled.
- Changed the default value from Enable to Disable for **“Allow DHCP Option 43 and 66 to Override Server”** and **“Check/Download New Firmware at Bootup”**. Upon upgrade from older version, these two options will be disabled, please re-enable it if needed.
- Changed the default value from 10sec to 300sec for all **Flood Attack Defense** timeout settings.
- Changed the default action to **Drop** for WAN **Inbound Rules** under **Firewall Policy**.
- Updated the DPI library, latest library is not compatible with SYS version lower than 1.0.1.32.
- Updated the IPS, URL, and Antivirus signature library.
- Internal bug fixes.

## FIRMWARE VERSION 1.0.1.10 (SYS)

### PRODUCT NAME

GCC6010

### DATE

6/28/2024

### FIRMWARE FILE INFORMATION

- GCC6010 system firmware file name: gcc601xfw.bin  
MD5 checksum: c3b812966176a904282000ab622f3011

### CHANGES/ENHANCEMENT

- Disable **Check/Download New Firmware at Bootup** by default.
- Internal bug fixes.

## **FIRMWARE VERSION 1.0.1.8 (SYS)**

### **PRODUCT NAME**

GCC6010

### **DATE**

6/4/2024

### **FIRMWARE FILE INFORMATION**

- GCC6010 system firmware file name: gcc601xfw.bin  
MD5 checksum: 0294ea7965254b2e99d10a5399bfd05b

### **CHANGES/ENHANCEMENT**

- This is the initial release of GCC6010 system firmware.