

msi 4026 NVIDIA VBIOS Update Instructions

[Home](#) » [MSI](#) » msi 4026 NVIDIA VBIOS Update Instructions 

Contents

- [1 Knowledge Base No. 4026](#)
- [2 Documents / Resources](#)
- [3 Related Posts](#)




Knowledge Base No. 4026

[How To] NVIDIA VBIOS Update


i To prevent the graphics driver from being installed by Windows Update automatically, please keep network disconnecting during VBIOS update process.

i Some anti-virus programs would detect the VBIOS update program as a suspected virus, so please disable anti-virus program, if any.


1. Visit MSI product page to download the latest VBIOS.
2. Disconnect the network.
3. Open the folder where you extracted the VBIOS file, right click on Address bar, and click "Copy address".

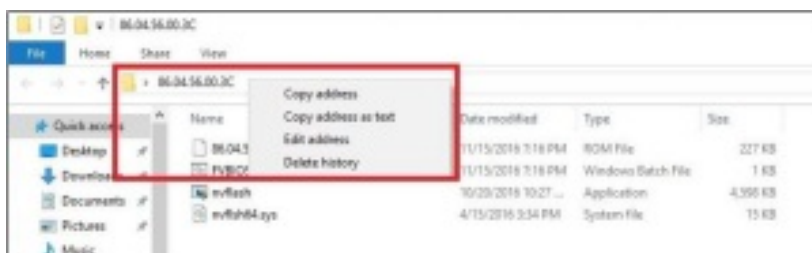


4. Run Command Prompt (Admin).
 - I. In Windows search area, type "cmd".
 - II. Right click on "Command Prompt" and select "Run as administrator".

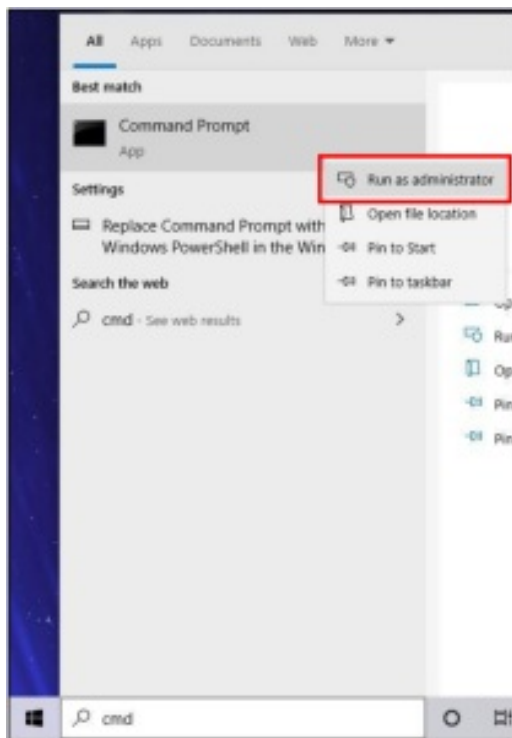

5. In Command Prompt, type “cd\” and press Enter to go to C:\>

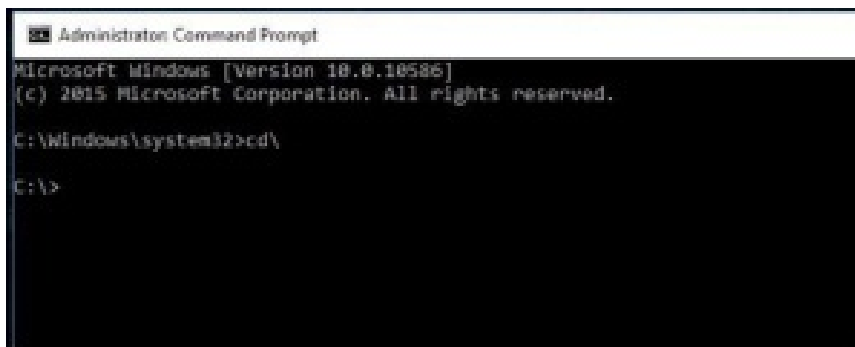

6. Type “cd” and press “Space bar”. Then, using Ctrl +V to paste the directory of VBIOS file and press Enter key.

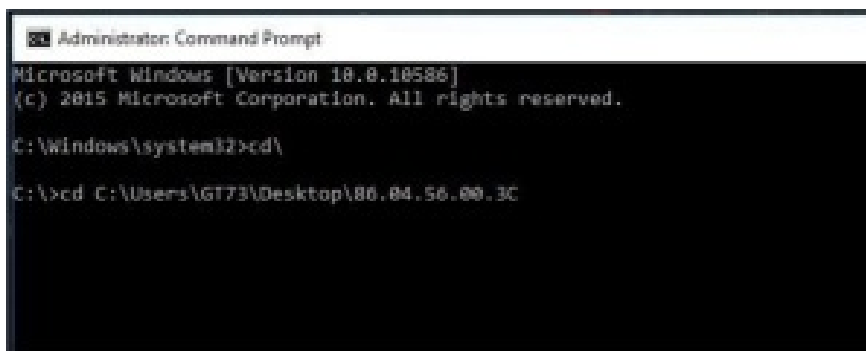

7. Type “fvbios” and then press Enter key.

```
Administrator: Command Prompt

Microsoft Windows [Version 10.0.18363]
(c) 2015 Microsoft Corporation. All rights reserved.

C:\Windows\system32>cd\

C:\>cd C:\Users\GT73\Desktop\86.04.56.00.3C

C:\Users\GT73\Desktop\86.04.56.00.3C>FVBIOS
```

8. Press “y” to confirm VBIOS update.

```
Administrator: Command Prompt - FVBIOS

C:\Users\GT73\Desktop\86.04.56.00.3C>FVBIOS

C:\Users\GT73\Desktop\86.04.56.00.3C>nvflash -G 86.04.56.00.3C.nv

NVIDIA Firmware Update Utility (Version 5.333.0)
Simplified Version for OEM Only
Checking for matches between display adapter(s) and image(s)...

Adapter: GeForce GTX 1080 (10DE,10E9,1462,1180) H:--:MM S:00,M:01,D:00,F:00

WARNING: Firmware image PCI Subsystem ID (1462,11FF)
does not match adapter PCI Subsystem ID (1462,1180).

Please press 'y' to confirm override of PCI Subsystem ID's:
Overriding PCI subsystem ID mismatch
Current - Version:86.04.20.00.10 ID:10DE:10E9:1462:11FF
GP104 Board (Normal Board)
Replace with - Version:86.04.56.00.3C ID:10DE:10E9:1462:11FF
GP104 Board (Normal Board)

Update display adapter firmware!
Press 'y' to confirm (any other key to abort):
```

9. VBIOS update is completed when you see the message “Update successful”. Please close Command prompt window and restart Windows.

```
Administrator: Command Prompt

Simplified Version for OEM Only
Checking for matches between display adapter(s) and image(s)...

Adapter: GeForce GTX 1080 (10DE,10E9,1462,1180) H:--:MM S:00,M:01,D:00,F:00


WARNING: Firmware image PCI Subsystem ID (1462,11FF)
does not match adapter PCI Subsystem ID (1462,1180).

Please press 'y' to confirm override of PCI Subsystem ID's:
Overriding PCI subsystem ID mismatch
Current - Version:86.04.20.00.10 ID:10DE:10E9:1462:11FF
GP104 Board (Normal Board)
Replace with - Version:86.04.56.00.3C ID:10DE:10E9:1462:11FF
GP104 Board (Normal Board)

Update display adapter firmware!
Press 'y' to confirm (any other key to abort):
Identifying EEPROM...
EEPROM ID (EP,0004) : Winbond W25Q64 1.05-1.05V 8192Kx15, page
Storing updated firmware image...
.....
Verifying update...
Update successful.

Firmware image has been updated from version 86.04.20.00.10 to 86.04.56.00.3C.

A reboot is required for the update to take effect.
```

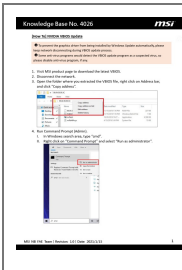

[msi 4026 NVIDIA VBIOS Update](#) [pdf] Instructions
4026, NVIDIA VBIOS Update