




[Home](#) » [SALUS CONTROLS](#) » **SALUS CONTROLS iT600 Coordinator Update Tool Installation Guide**

Contents [[hide](#)]

- [1 SALUS CONTROLS iT600 Coordinator Update Tool](#)
- [2 Product Information](#)
- [3 Download Instructions](#)
- [4 Installation Procedure](#)
- [5 Launching the Tool](#)
- [6 App Update Process – iT600 Coordinator Update Tool](#)
- [7 Firmware Update Process – Updating the coordinator](#)
- [8 Key Troubleshooting Steps](#)
- [9 Error-Specific Solutions](#)
- [10 Frequently Asked Questions](#)
- [11 Documents / Resources](#)
 - [11.1 References](#)



SALUS CONTROLS iT600 Coordinator Update Tool

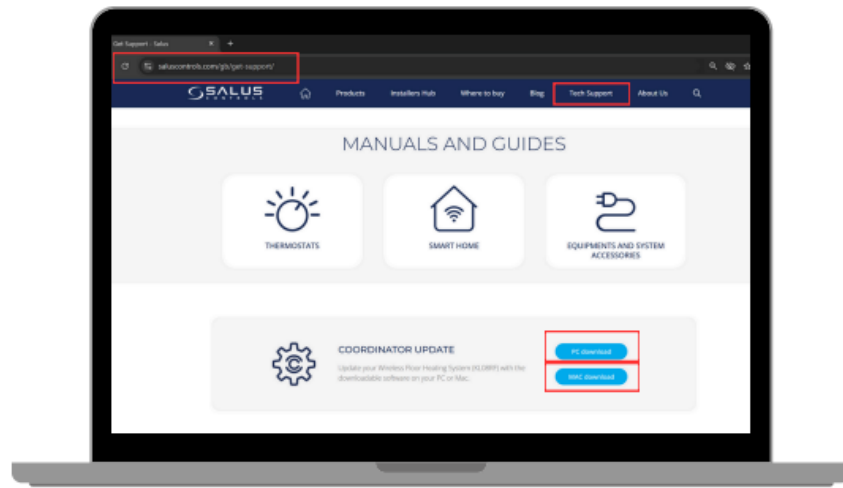

Product Information

Specifications:

- Product Name: iT600 Coordinator Update Software
- Operating Systems: Windows, macOS
- File Type: .exe (Windows), .dmg (macOS)
- Official Download Portal: <https://saluscontrols.com/gb/get-support>

Download Instructions

- [Access official download portal: https://saluscontrols.com/gb/get-support](https://saluscontrols.com/gb/get-support)
- [Navigation path: Downloads → Coordinator Tools → SALUS_EU_Coordinator_Upgrade_Tool_er_boxed.exe](#)
- [File Verification:](#)
 - [Filename: SALUS_EU_Coordinator_Upgrade_Tool_er_boxed.exe \(Windows\)](#)
 - [SHA-256: 7a3b8d... \(MAC\)](#)
- File Details: SALUS_EU_Coordinator_Upgrade_Tool_er_boxed (Windows Installer Package)

Installation Procedure


Windows:

1. Disable antivirus temporarily (optional but recommended)
 - Run installer as Administrator:


☒ SALUS_EU_Coordinator_Upgrade_Tool_er_boxed

2. Follow installation wizard:

Welcome Screen: Click Next →

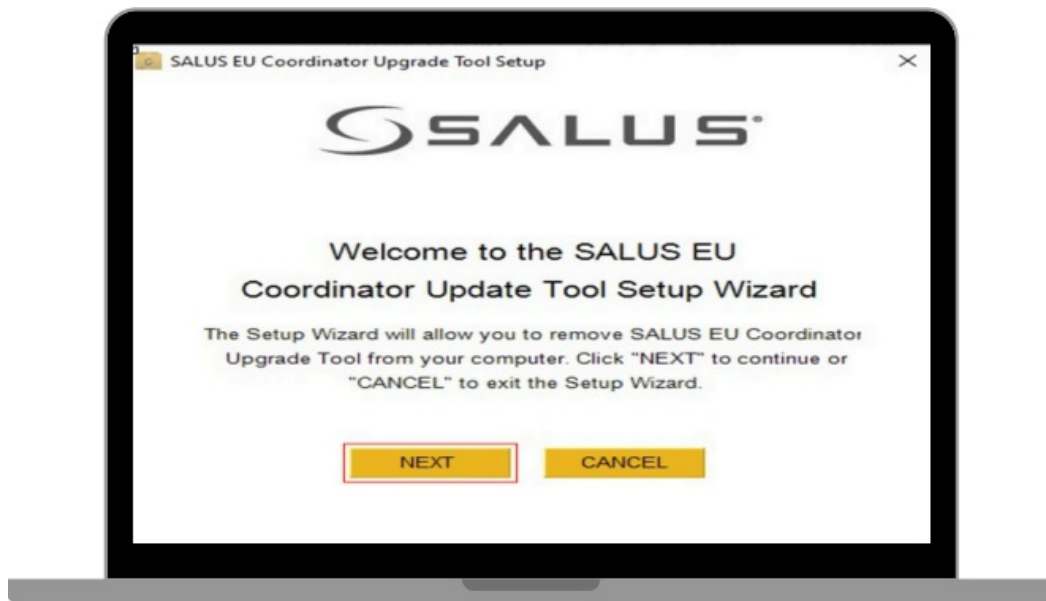

Installation Confirmation: Click Install →

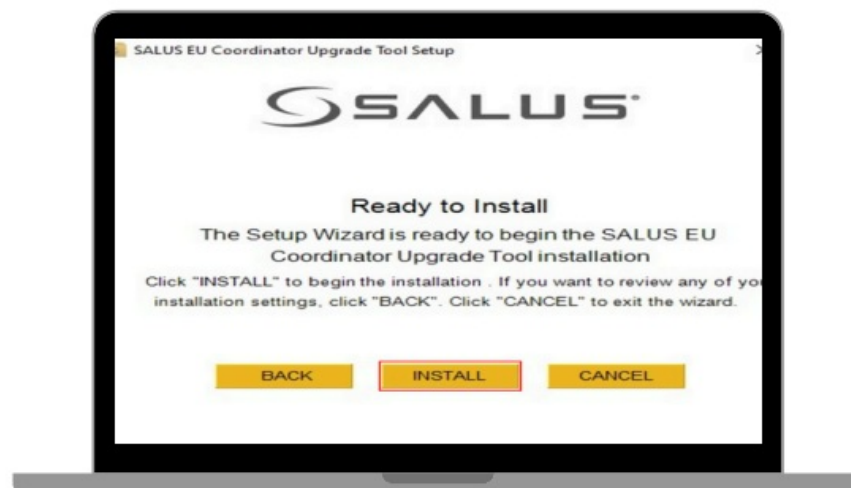


Progress: Wait for completion →



Finalize setup:

- Click the "Finish" button to exit the Setup Wizard and launch the Tool from desktop.

- Click “Run” button to launch Salus EU Coordinator Upgrade Tool.

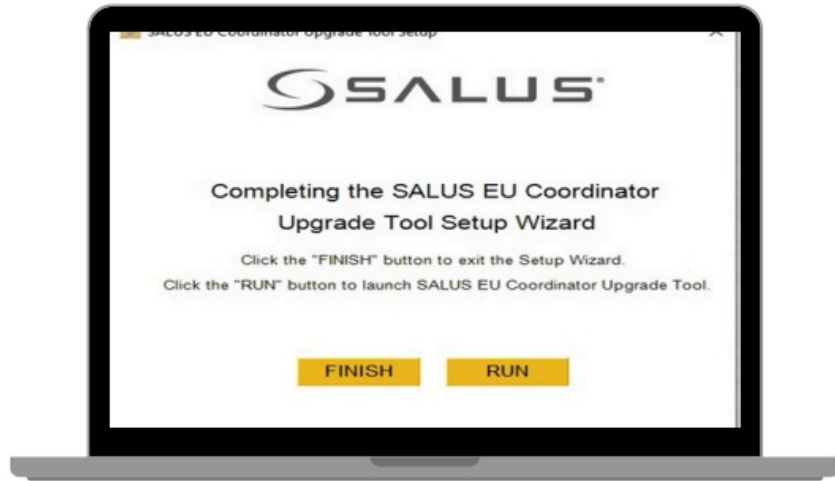

macOS:

1. Right-click .dmg → Open (bypass Gatekeeper)
2. Drag icon to Applications folder

Launching the Tool

Open via desktop shortcut or Start menu.

Initial Interface: Ensure the coordinator is disconnected at this stage.



App Update Process – iT600 Coordinator Update Tool

1. Version Check:




2. Update Initiation:

Click Update




3. Progress Monitoring:

Coordinator Update Tool is downloading and updating.

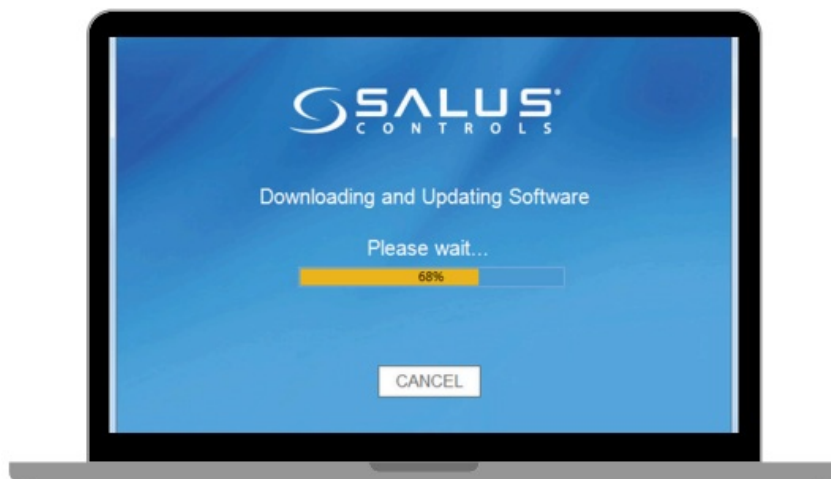

4. Completion:


"Update successful!" message appears.

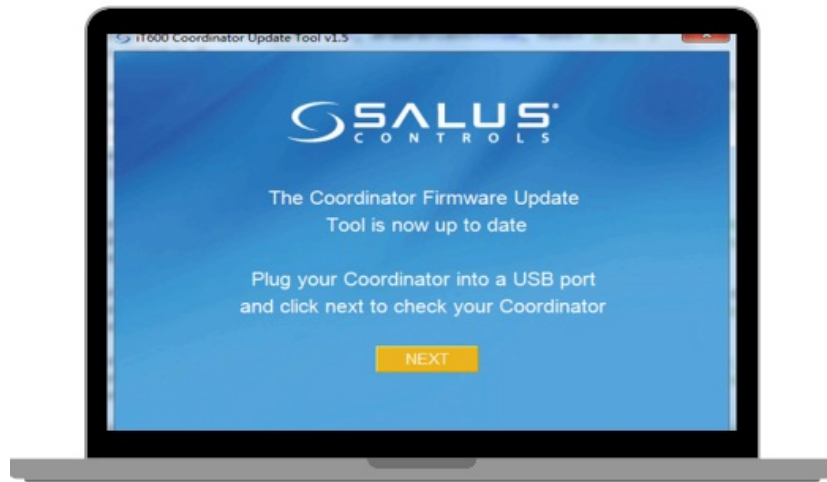

Firmware Update Process – Updating the coordinator

1. Version Check:

1. Ensure that Bluetooth is disabled on laptop/PC. Open Windows Settings → Bluetooth & devices → Toggle Bluetooth OFF.
2. Plug the Coordinator into a USB port.
3. Click NEXT to check Coordinator.

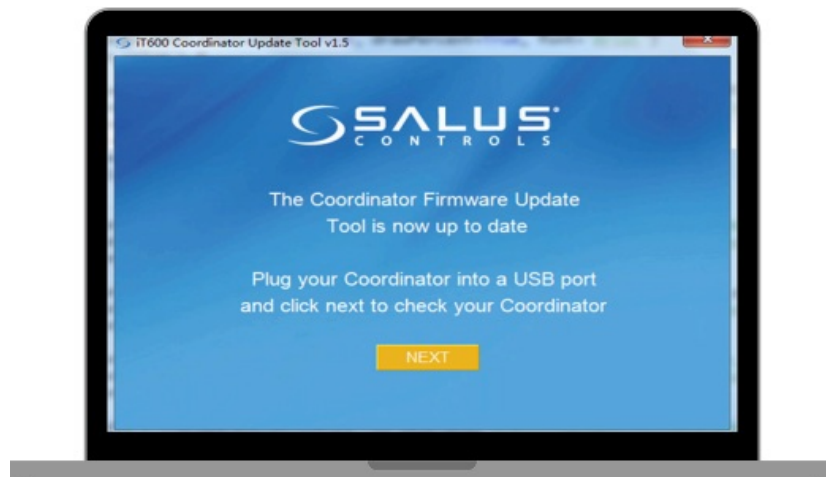

If Bluetooth is disconnected and CO10 is not found, please click Install Driver.



2. Update Initiation:

Click Update



3. Progress Monitoring:

Critical! Removing the coordinator or switching your computer off will cancel the update.



4. Completion:

“Update successful!” message appears. Coordinator reboots automatically.



Key Troubleshooting Steps

Issue: COM port conflicts (e.g., COM5/COM6 appear but tool fails).

Solution:

1. Disable Bluetooth: Open Windows Settings → Bluetooth & devices → Toggle Bluetooth OFF.
2. Check COM ports: Open Device Manager → Ports (COM & LPT). Verify if COM5/COM6 disappeared.
3. Relaunch tool: If conflicting ports vanished, reconnect coordinator and retry update.

Error-Specific Solutions

Error Message	Resolution Steps
“Signature verification failed”	Re-download installer (file corruption)
“Update timed out”	Disable firewall/VPN → Retry in Safe Mode
Application crash on launch	Install latest .NET Framework + VC++ Re dist

<https://saluscontrols.com/gb/get-support>

Frequently Asked Questions


Q: What should I do if the update process gets interrupted?

A: If the update process gets interrupted, restart the Coordinator Update Tool and follow the update initiation steps again.

Q: How can I verify if the update was successful?

A: A message indicating a successful update will appear upon completion of the update process.

Documents / Resources

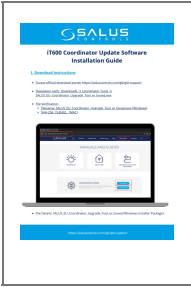

[SALUS CONTROLS iT600 Coordinator Update Tool \[pdf\]](#) Installation Guide
e
DAGt-la3His, BAE5KC2L0fA, CO10, iT600 Coordinator Update Tool, iT600, Coordinator Update Tool, Update Tool, Tool

References

- [User Manual](#)

 SALUS

CONTROLS

 BAE5KC2L0fA, CO10, Coordinator Update Tool, DAGt-la3His, iT600, iT600 Coordinator Update Tool, SALUS CONTROLS, tool, Update Tool

Leave a comment

Your email address will not be published. Required fields are marked *

Comment *

Name

Email

Website

☐ Save my name, email, and website in this browser for the next time I comment.

[Post Comment](#)

Search:

[Search](#)

[Manuals+](#) | [Upload](#) | [Deep Search](#) | [Privacy Policy](#) | [@manuals.plus](#) | [YouTube](#)

This website is an independent publication and is neither affiliated with nor endorsed by any of the trademark owners. The "Bluetooth®" word mark and logos are registered trademarks owned by Bluetooth SIG, Inc. The "Wi-Fi®" word mark and logos are registered trademarks owned by the Wi-Fi Alliance. Any use of these marks on this website does not imply any affiliation with or endorsement.