

EBECO F-10 Connection Termination Kit



EBECO F-10 Connection Termination Kit Installation Guide

[Home](#) » [EBECO](#) » EBECO F-10 Connection Termination Kit Installation Guide 

Contents

- [1 EBECO F-10 Connection Termination Kit](#)
- [2 Contents of the kit](#)
- [3 Instructions Termination End](#)
- [4 Installation Connection-end](#)
- [5 CONTACT INFORMATION](#)
- [6 Documents / Resources](#)
 - [6.1 References](#)
- [7 Related Posts](#)

EBECO

EBECO F-10 Connection Termination Kit






Contents of the kit

- 2 pcs shrinking tube 4/1 mm, Length 90 mm
- 1 pc green/yellow shrinking tube 6/2 mm, Length 100 mm
- 2 pcs shrinking tube 9/3 mm, Length 25 mm
- 1 pc shrink cap
- 1 pc heating cable sign

Instructions Termination End


1. Strip the outer sheath 20 mm.
2. Push back the earth braid. Make sure the conductors are not touching each other. Slide over a 9/3 mm shrinking tube and heat with a hot-air gun. Pinch together the part of the shrinking tube that lies outside of the cable using flat pliers so that the adhesive is forced out.
3. Pull the earth braid back over the shrinking tube-clad cable end. Wind a single turn of insulation tape over the earth braid to secure it. Thread on the end shrink cap and heat so the adhesive is forced out. Start heating from the tip.

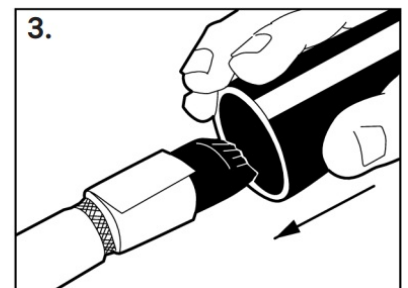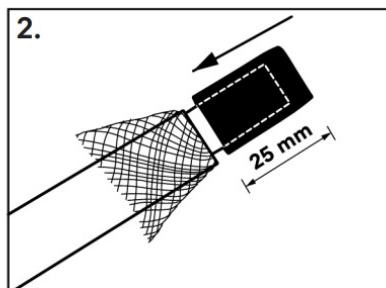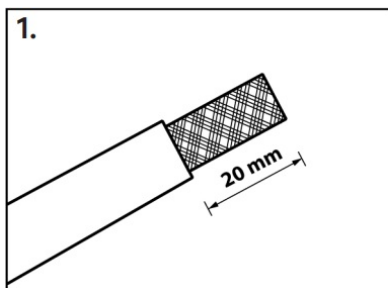

Installation Connection-end

1. Strip of the outer sheath 110 mm.
2. Open the earth braid and twist it.

3. Strip the inner insulation 100 mm.
4. Make two cuts from the center of the cable out towards the conductors.
5. Pull out the conductors from the sides and down to the edge of the internal insulation. Use two pairs of flat pliers. Cut away the inner core material. It makes no difference if the core material remains on the conductors.
6. Slide the 4/1 mm shrinking tube over the conductors and the yellow-green shrinking tube over the earth braid. Heat with a hot air gun.
7. Slide over the 9/3 mm shrinking tube and heat. Pinch together using flat pliers between the conductors.
8. Insulation measures the cable, min 10 MΩ. The cable is now ready for connection.

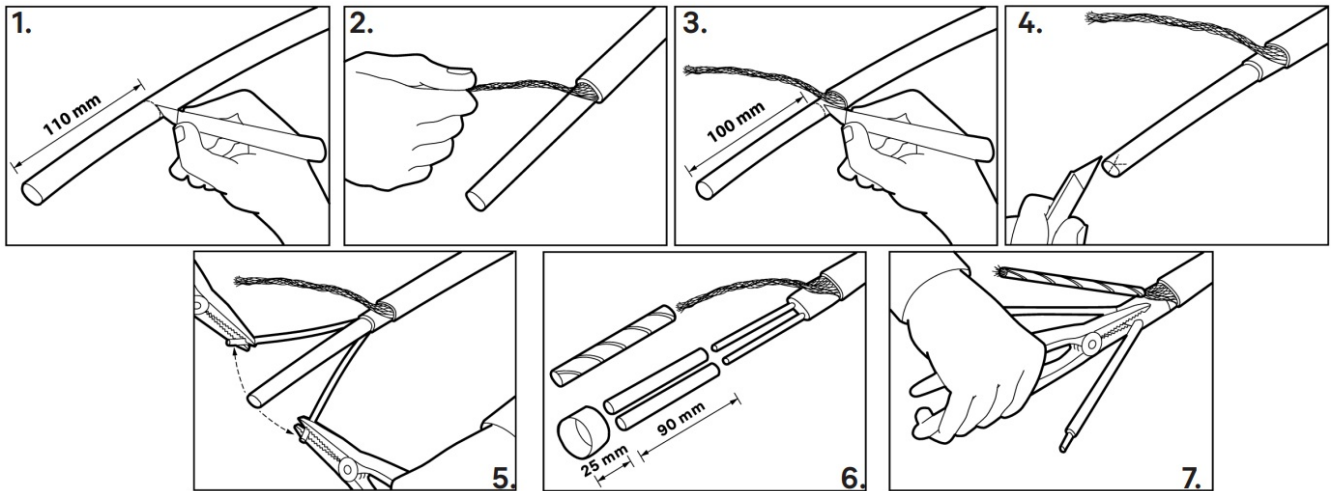

CONTACT INFORMATION

- EBECO AB
- Lärjeågatan 11, 415 02 Göteborg, Sweden
- +46 (0)31-707 75 50
- info@ebeco.se.
- www.ebeco.com.

Documents / Resources

	<p>EBECO F-10 Connection Termination Kit [pdf] Installation Guide</p> <p>F-10, F-10 Connection Termination Kit, Connection Termination Kit, Termination Kit, Kit</p>
--	---

References

- [User Manual](#)

[Manuals+](#). [Privacy Policy](#)

This website is an independent publication and is neither affiliated with nor endorsed by any of the trademark owners. The "Bluetooth®" word mark and logos are registered trademarks owned by Bluetooth SIG, Inc. The "Wi-Fi®" word mark and logos are registered trademarks owned by the Wi-Fi Alliance. Any use of these marks on this website does not imply any affiliation with or endorsement.