

TOSHIBA TPD4204F DC 300V Input BLDC Motor Sensorless Control Circuit User Guide

Home » Toshiba » TOSHIBA TPD4204F DC 300V Input BLDC Motor Sensorless Control Circuit User Guide Table 1



oshib

TPD4204F DC 300V Input BLDC Motor Sensorless Control Circuit **User Guide**

Contents

- 1 Introduction
- 2 Specifications
- 3 Circuit Diagram, Bills of Material, and PCB Pattern **Diagram**
- **4 Description of Circuit Operation**
- 5 Terms of Use
- 6 Documents / Resources
- **7 Related Posts**

Introduction

This reference guide (hereinafter referred to as "this guide") explains the specifications and steps of operation of the DC 300 V Input BLDC Motor Sensorless Control Circuit (hereinafter referred to as "this reference design"). The fan of the indoor unit of air conditioners is run using a brushless motor generally driven at a DC 300 V level.

Previously, motors were driven mainly by square-wave energization using Hall sensors, etc., but in recent years, in response to demands for lower system costs, higher efficiency, and quieter motors, motors have been driven by sinusoidal energization without the use of Hall sensors and with vector control.

In this reference design, a microcontroller TMPM374FWUG is used for controlling the motor, and for implementing sensorless vector control.

An intelligent power device consisting of a switch for a three-phase inverter and a gate driver in a compact package is used for driving the motor. This reference design (RD180- 3) uses a TPD4204F (MOSFET built-in type, withstanding voltage of 600 V, the maximum output current of 2.5 A, and SSOP30 package). This device helps in achieving a high-efficiency motor drive with a compact board mounting area.

Specifications

Item	Specifications	
Motor Power Input	DC 120 V to 340 V	
Control Power Input	DC 15 V, DC 5 V	
Motor Drive Maximum Current (per Phase)	2.5 A	
Motor Drive System	Sensorless Vector Control (Speed Control)	
Switching Frequency	15.625 kHz (changeable by software)	
MC() Control Method	Single MCU Control or External MCU Control	
Cooling System	Natural Air Cooling	
Protective Function	Overcurrent of Motor Power Input (10 A by Fuse) Overcurrent of Motor Output (Approx. 2.9A each phase)	
Board Size (Including the Accessory Board Part)	130 x 85 x 53.4 mm	
I/O Interface (Mounted on Accessory Board)	Red LED for Status Display x 3 DIP Switches for Status Setting x 4 Potentiometer for Speed Setting x 1 SWD Input/Output x 1	

2.1. Circuit Block Diagrams

Fig. 2.1 shows the block diagram of this reference design.

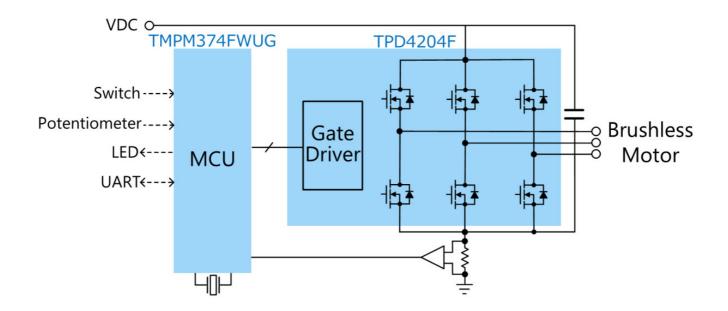


Fig. 2.1 DC 300 V Input BLDC Motor Sensorless Control Circuit Block Diagram

2.2. External View and Component Layout

Fig. 2.2 and Fig. 2.3 show the external appearance of this reference design, and Fig. 2.4 shows the layout of the main components.

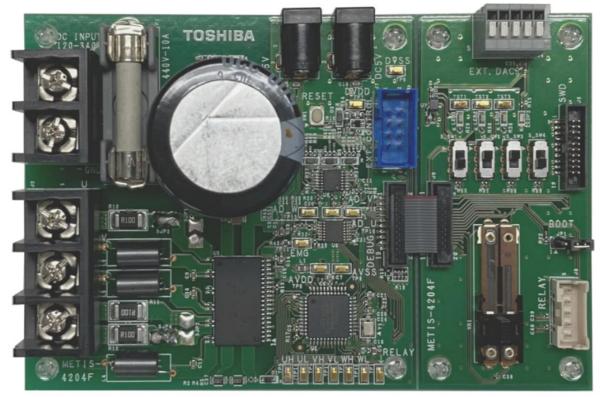


Fig. 2.2 DC 300 V Input BLDC Motor Sensorless Control Circuit Board Front View (For RD179-3)



Fig. 2.3 DC 300 V Input BLDC Motor Sensorless Control Circuit External view of PCB (for RD179-3)

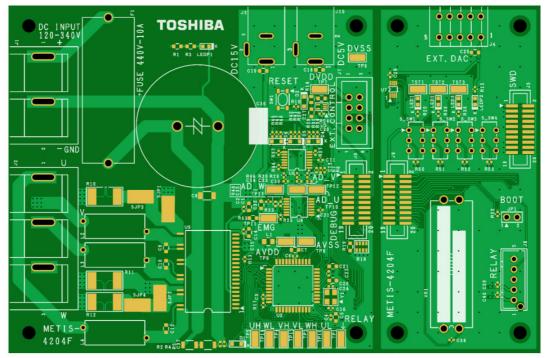


Fig. 2.4 Component Layout (for RD179-3)

Circuit Diagram, Bills of Material, and PCB Pattern Diagram

3.1. Circuit Diagram

Refer to the following file:

RD179-3 (equipped with TPD4204F): RD179-SCHEMATIC3-xx.pdf (xx is the revision number)

3.2. Component List

Refer to the following file:


RD179-3(equipped with TPD4204F): RD179-BOM3-xx.pdf (xx is the revision number)

3.3. PCB Pattern Diagram


Fig. 3.1 shows the PCB pattern diagrams of this reference design.

Also, refer to the following file:

RD179-3(equipped with TPD4204F): RD179-LAYER3-xx.pdf (xx is the revision number)

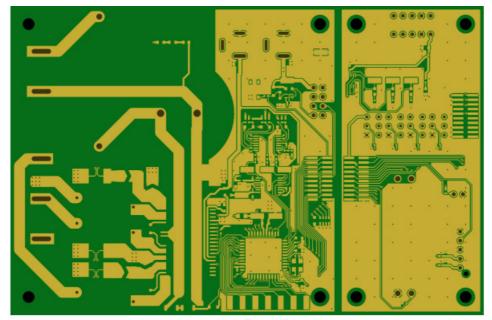

<Layer 1, Front side>

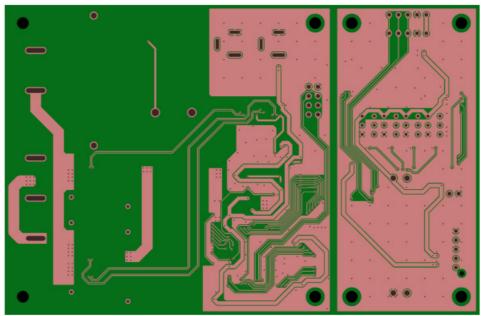

<Layer 2, Back side>

Description of Circuit Operation

4.1. Name and Function of Components

4.1.1. Shunt Method Setting Solder Jumper (SJP1, SJP2, SJP3, SJP4)

To switch the current detection method, set four solder jumpers as described below.

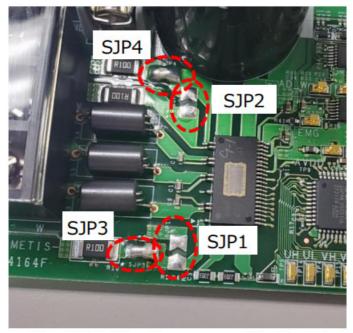


Fig. 4.1 Solder Jumpers on the Board

Table 4.1 Solder Jumper Settings

Current Detection System	SJP1	SJP2	SJP3	SJP4
3-shunt system	Open	Open	Short	Short
1-shunt system	Short	Short	Open	Open

4.1.2. Motor Power Input Connector (J1)

Used for input DC power to drive the motor.

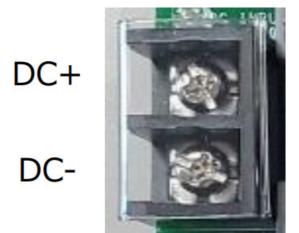


Fig. 4.2 Motor Power Input Connector on Board (J1)

4.1.3. Motor Connector (J2)

Used for connecting a 3-phase BLDC motor.

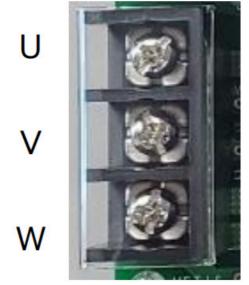


Fig. 4.3 Motor Connector on Board (J2)

4.1.4. Control Power Input Connectors (J3, J10)

Used for supplying Input power for control. The connector is a jack-type connector (inner positive polarity) so it can be supplied using an AC adapter, etc. J3 is for 15 V input and is used to operate Intelligent Power Device (TPD4204F). And, J10 is for 5 V input and is used as a power supply for MCU, peripheral IC, etc. Since both Connectors are of same type, be careful not to connect them incorrectly.

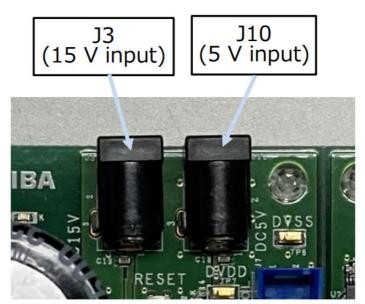


Fig. 4.4 Control Power Input Connectors (J3, J10) on the Board

4.1.5. Switches and LEDs (S_SW1 4, LED1 3, LEDP1 2)

Switches and LEDs operate as follows.

S_SW1, S_SW2, S_SW3, S_SW4, LED1, LED2, and LED3 are connected to the GPIO pins of the MCU and are controlled by software.

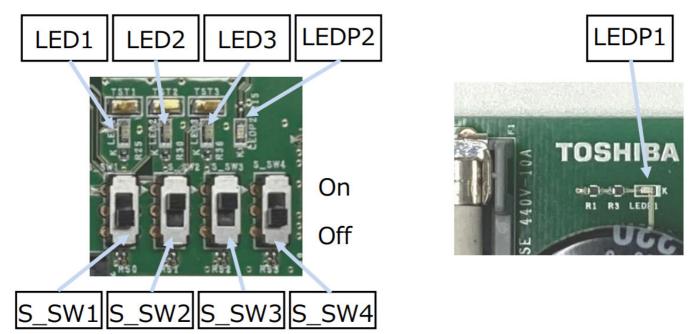


Fig. 4.5 Switches and LEDs on the Board

Table 4.2 Switch and LED Specifications

Component	Function	Remark
S SW1	(not used)	
S SW2	MCU Control Method	On: External MCU control, Off Single MCU control (It should be set to Off in this reference design.)
S SW3	Motor Rotation Direction	On: CW (clockwise), Off: CCW (counterclockwise)
S SW4	(Not used)	
LED1	Error Indicator	No Er Error: Off Error: On or Blink
LED2	Vector Engine Indicator	VE Interrupt in progress: On
LED3	Communication Indicator	Communicating: On Communication stopped due to error: Blinks every 0.5 seconds
LEDP1	Motor Power ON Indicator	When motor power is ON: On (yellow) LEDP1 also On while the capacitor is charged. Be careful not to touch the board while it is On.
LEDP2	Control Power Supply Energization Indica tor	Control power (5 V) energized: On (green)

4.1.6. Potentiometer (VR1)

The potentiometer can be used to set the motor speed (cHZ_MIN to 60 Hz range).

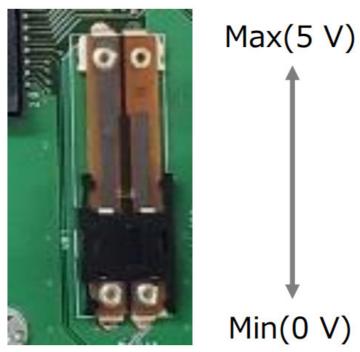


Fig. 4.6 Potentiometer on Board (VR1)

Electric angular rotation

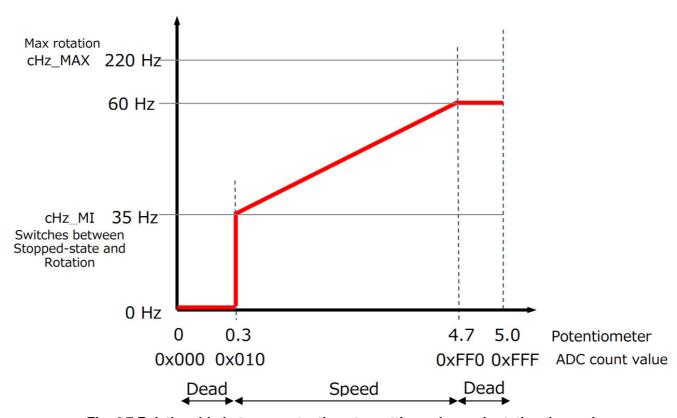


Fig. 4.7 Relationship between potentiometer setting value and rotational speed

4.1.7. External MCU Connector (J7)

Connector for connecting to an external (host) MCU. Not used in this reference design.

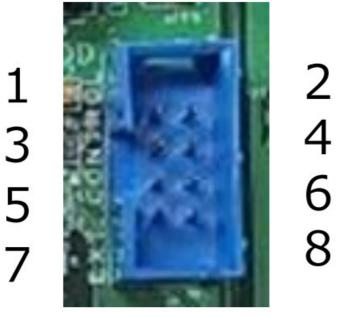


Fig. 4.8 External MCU Connector (J7)

Table 4.3 External MCU Connector Specifications

Pin		Function	Remark
1	DVDD	Digital power supply (5 V)	
2	DVS	Digital power supply (GND)	
3	UART RX	UART Reception	
4	UART_TX	UART Transmission	
5	GPIO connection	Reserved (not used)	Same as S SW1
6	GPIO connection	Control mode	Same as S SW2
7	RESET#	Reset input	To MCU reset
8	GPIO connection	Reserved (not used)	GPIO connection

4.1.8. External DAC Connector (J4)

The data to be processed inside the MCU is output as serial data. By connecting an external DAC, the processing data can be checked as a waveform using an oscilloscope, etc.

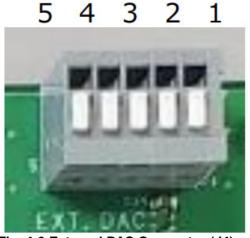


Fig. 4-9 External DAC Connector (J4)

Table 4.4 External DAC Connector Specifications

Pin		Function	Remarks
1	DVDD	5 V power output	
	GND	GND	
3	SYNC	DAC sync signal	Uses GPIO
4	SDO	DAC data	Uses SIO
5	SCLK	DAC clock	Uses SIO

4.1.9. Debugger Connector (J5)

20-pin connector for connecting to the emulator/debugger probe. It conforms to the MIPI-20 connector standard and supports only the SWD interface.

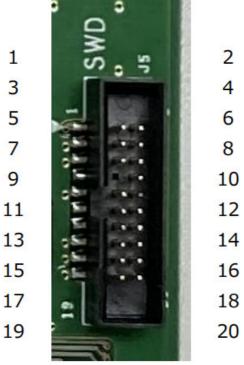


Fig. 4.10. Debugger Connector (J5)

Table 4.5 Debugger Connector Specifications

Pin	Function	Pin	Function
1	VDD(5 V)	2	SWDIO
3	GND	4	SWCLK
5	GND	6	SWV
7	(n.c.)	8	(n.c.)
9	GND	10	RESET
11	(n.c.)	12	(n.c.)
13	(n.c.)	14	(n.c.)
15	GND	16	(n.c.)
17	GND	18	(n.c.)
19	GND	20	(n.c.)

4.2. Operation Check

4.2.1. Preparation

Connect a 3-phase BLDC motor to the motor connector (J2). Connect the DC power supply to the motor power input connector (J1). Set switch S_SW2 (MCU control method) on the board to Off (single MCU control). Turn on the power in the following order: control power (5 V) input connector (J10) \rightarrow control power (15 V) input connector (J13) \rightarrow motor power input connector (J1).

4.2.2. Operation Method

The motor is in the stopped state when the potentiometer (VR1) is in Min-position (0 Hz). The motor can be started by raising the potentiometer (VR1) setting from the Min-position (0 Hz). If the motor is stopped when the potentiometer is not in the MIN position, change VR1 to the Min position once. While in a stopped state, LED1, LED2, and LED3 are turned off.

After motor operation starts, the speed can be varied by using VR1. The closer VR1 is to the Max position (60 Hz), the faster the rotational speed. The closer it is to the Min position, the slower the rotational speed. When S_SW3 (rotation direction) is On, the motor rotates in CW (clockwise) direction and when it is Off, the motor rotates in CCW (counterclockwise) direction.

4.2.3. Operation when Abnormality is Detected

If the following error is detected, the system enters an EMG (Emergency) state, the motor stops, and the LED1 either blinks or turns on.

- 1. Abnormal voltage detection: When abnormal voltage is detected, LED1 blinks in 250 ms cycles.
- 2. Abnormal current detection: When abnormal current is detected, LED1 blinks in 500 ms cycle.
- 3. Software overcurrent detection: When overcurrent is detected using software processing, LED1 blinks in 1 s cycles.
- 4. Hardware overcurrent detection: When overcurrent is detected using the MCU hardware function, LED1 turns on.

The EMG status is canceled by lowering VR1 to the MIN position.

4.3. Precautions for Use

Pay special attention to the following when operating.

- Jumper setting before energizing must be confirmed. Especially the 3-shunt/1-shunt solder jumper setting must be checked.
- The polarity of connectors and terminals must be correct.
- The smoothing capacitor on the motor power supply takes approximately 10 minutes to get fully discharged. Even after the power is turned off, the board must not be touched until LEDP1 turns off.
- During the operation, the BOARD must be covered with an acrylic case for safety.

Terms of Use

This terms of use is made between Toshiba Electronic Devices and Storage Corporation ("We") and customers who use documents and data that are consulted to design electronics applications on which our semiconductor devices are mounted ("this Reference Design"). Customers shall comply with these terms of use. Please note that it is assumed that customers agree to any and all these terms of use if customers download this Reference Design. We may, at its sole and exclusive discretion, change, alter, modify, add, and/or remove any part of this terms of use at any time without any prior notice. We may terminate these terms of use at any time and for any reason. Upon termination of these terms of use, customers shall destroy this Reference Design. In the event of any breach thereof by customers, customers shall destroy this Reference Design, and furnish us a written confirmation to prove such destruction.

Restrictions on usage

- 1. This Reference Design is provided solely as reference data for designing electronics applications. Customers shall not use this Reference Design for any other purpose, including without limitation, verification of reliability.
- 2. This Reference Design is for the customer's own use and not for sale, lease or other transfer.
- 3. Customers shall not use this Reference Design for evaluation in high or low temperature, high humidity, or high electromagnetic environments.
- 4. This Reference Design shall not be used for or incorporated into any products or systems whose manufacture, use, or sale is prohibited under any applicable laws or regulations.

Limitations

- 1. as to this Reference Design without notice.
- 2. This Reference Design should be treated as a reference only. We are not responsible for any incorrect or incomplete data and information.
- 3. Semiconductor devices can malfunction or fail. When designing electronics applications by referring to this Reference Design, customers are responsible for complying with safety standards and for providing adequate designs and safeguards for their hardware, software and systems which minimize risk and avoid situations in which a malfunction or failure of semiconductor devices could cause loss of human life, bodily injury or damage to property, including data loss or corruption. Customers must also refer to and comply with the latest versions of all relevant our information, including without limitation, specifications, data sheets and application notes for semiconductor devices, as well as the precautions and conditions set forth in the "Semiconductor Reliability Handbook".
- 4. When designing electronics applications by referring to this Reference Design, customers must evaluate the whole system adequately. Customers are solely responsible for all aspects of their own product design or applications. WE ASSUME NO LIABILITY FOR CUSTOMERS' PRODUCT DESIGN OR APPLICATIONS.
- 5. No responsibility is assumed by us for any infringement of patents or any other intellectual property rights of

- third parties that may result from the use of this Reference Design. No license to any intellectual property right is granted by this terms of use, whether express or implied, by estoppel or otherwise.
- 6. THIS REFERENCE DESIGN IS PROVIDED "AS IS". WE (a) ASSUME NO LIABILITY WHATSOEVER, INCLUDING WITHOUT LIMITATION, INDIRECT, CONSEQUENTIAL, SPECIAL, OR INCIDENTAL DAMAGES OR LOSS, INCLUDING WITHOUT LIMITATION, LOSS OF PROFITS, LOSS OF OPPORTUNITIES, BUSINESS INTERRUPTION AND LOSS OF DATA, AND (b) DISCLAIM ANY AND ALL EXPRESS OR IMPLIED WARRANTIES AND CONDITIONS RELATED TO THIS REFERENCE DESIGN, INCLUDING WARRANTIES OR CONDITIONS OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, ACCURACY OF INFORMATION, OR NONINFRINGEMENT.

Export Control

Customers shall not use or otherwise make available this Reference Design for any military purposes, including without limitation, for the design, development, use, stockpiling, or manufacturing of nuclear, chemical, or biological weapons or missile technology products (mass destruction weapons). This Reference Design may be controlled under the applicable export laws and regulations including, without limitation, the Japanese Foreign Exchange and Foreign Trade Law and the U.S. Export Administration Regulations. Export and re-export of this Reference Design are strictly prohibited except in compliance with all applicab

1. We reserve the right to make chanle export laws and regulations.

Governing Laws

These terms of use shall be governed and construed by the laws of Japan.

© 2022
Toshiba Electronic Devices & Storage Corporation

Documents / Resources



TOSHIBA TPD4204F DC 300V Input BLDC Motor Sensorless Control Circuit [pdf] User Gui de

TPD4204F DC 300V Input BLDC Motor Sensorless Control Circuit, TPD4204F DC 300V Input BLDC Motor, Sensorless Control Circuit Motor, Sensor Less Circuit Motor, Motor, TPD4204F

Manuals+,